COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Power and Ground Checks Before Any Other Tests	2 and 1	All Eight Window Switches (all positions)	Open Circuit
	1, 6, 7, 4, 3, 7, 6, 5, and 4	All Eight Window Switches (at rest)	Closed Circuit
Left Front Window Circuit	2 and 6	Down	Closed Circuit
	2 and 7	Up	Closed Circuit
Right Front Window Circuit	2 and 3	Down	Closed Circuit
	2 and 4	Up	Closed Circuit
Left Rear Window Circuit	2 and 7	Down	Closed Circuit
	2 and 6	Up	Closed Circuit
Right Rear Window Circuit	2 and 5	Down	Closed Circuit
	2 and 4	Up	Closed Circuit
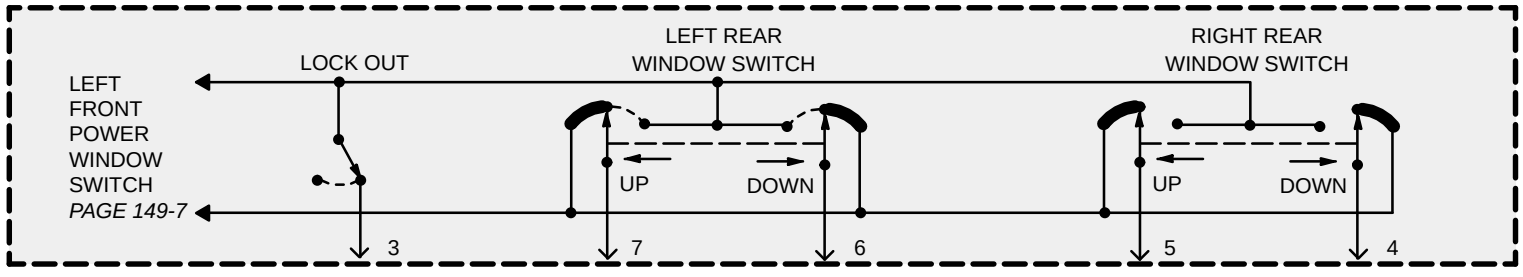
SCHEMATIC