COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Check Power and Grounds Before Any Other Tests	4 and all others except 2	All 3 Switches at Rest	Closed Circuit
	2 and 4	All 3 Switches at Rest	Open Circuit
Front Tilt Circuit	2 and 7	Up	Closed Circuit
	2 and 5	Down	Closed Circuit
Rear Tilt Circuit	2 and 1	Up	Closed Circuit
	2 and 6	Down	Closed Circuit

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Horizontal Movement	2 and 3	Forward	Closed Circuit
	2 and 8	Rearward	Closed Circuit

TERMINALS

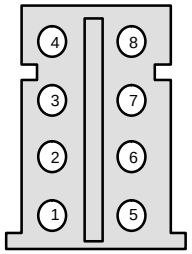
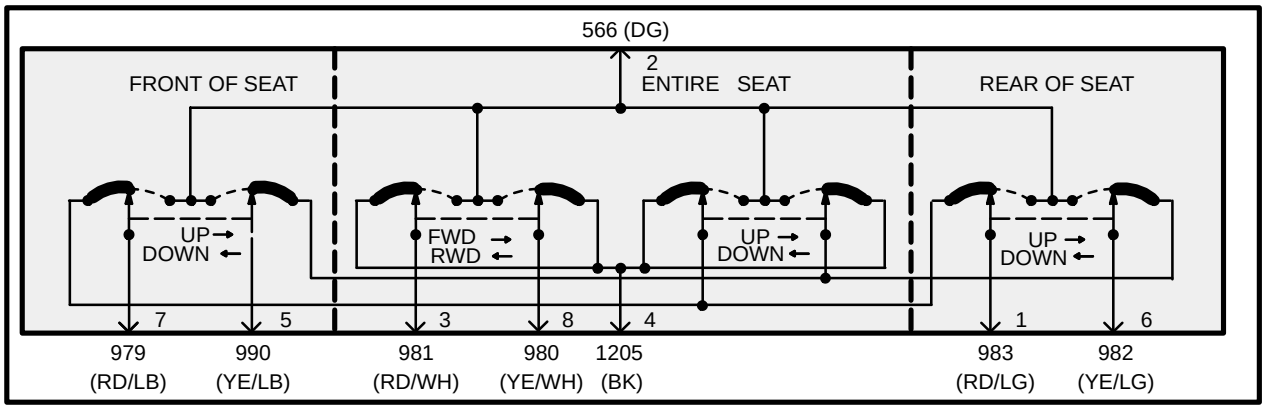
SCHEMATIC