C141 (BU)

15525

Heated Oxygen Sensor (HO2S) #22 (9G444)

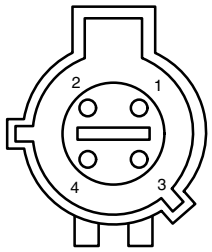

F04082

Pin	Circuit	Circuit function
1	1138 (VT/WH)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22 (9G444), heater, control
3	359 (GY/RD)	signal, return
4	393 (VT/LG)	Sensor signal

C142 (BU)

15525

Heated Oxygen Sensor (HO2S) #12 (9G444)

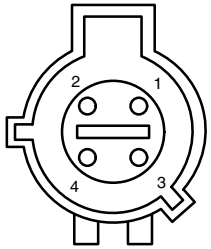

F04082

Pin	Circuit	Circuit function
1	1138 (VT/WH)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater, control
3	359 (GY/RD)	signal, return
4	392 (RD/LG)	Sensor signal

C143 (BK)

15525

Turbine Shaft Speed (TSS) sensor

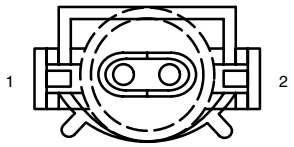

F02031

Pin	Circuit	Circuit function
1	971 (PK/BK)	signal, return
2	970 (DG/WH)	Turbine Shaft Speed (TSS) sensor, signal