Component Testing – Ignition switch

SCHEMATIC

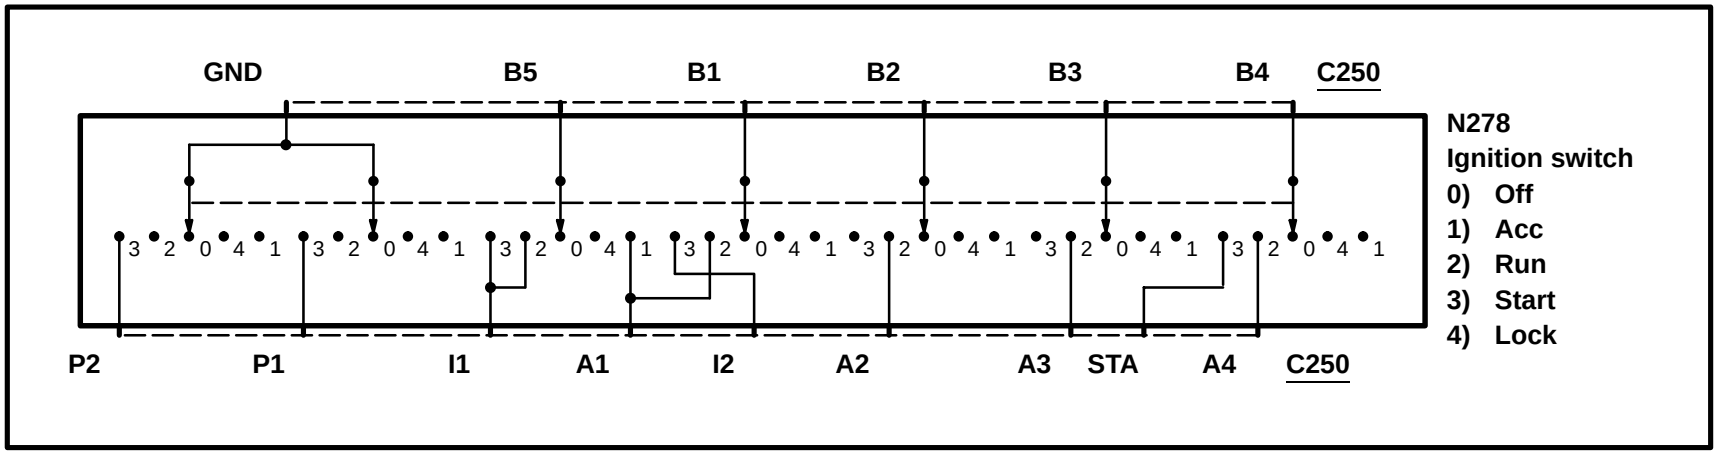

TERMINALS

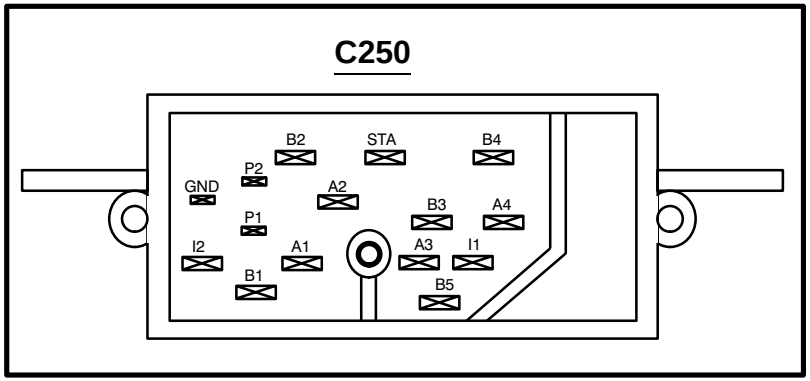

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Key to These Positions	A Good Switch Will Indicate
Run Power Circuit	B1 and A1 B2 and A2 B4 and A4	Off/Lock	Open Circuit
		Acc	Open Circuit
		Run	Closed Circuit
		Start	Open Circuit
Run/Start Power Circuit	B5 and I1	Off/Lock	Open Circuit
		Acc	Open Circuit
		Run	Closed Circuit
		Start	Closed Circuit
Run/Acc Power Circuit	B5 and A1	Off/Lock	Open Circuit
		Acc	Closed Circuit
		Run	Closed Circuit
		Start	Open Circuit
Start Power Circuit	GND and P1 B4 and STA	Off/Lock	Open Circuit
		Acc	Open Circuit
		Run	Open Circuit
		Start	Closed Circuit