Schematic

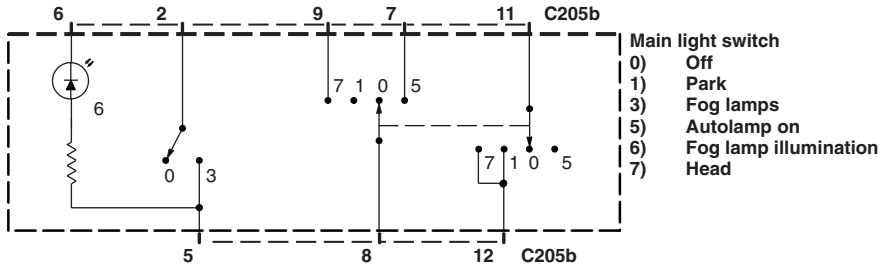

Terminal

C205a

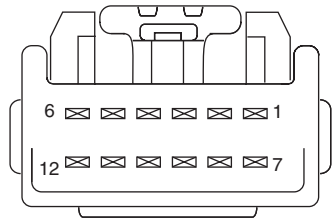

F12101

Component Testing Procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Headlamp	9 and 8	Off	Open circuit
		Head	Closed circuit
		Park	Open circuit
		Autolamps	Open circuit
Park lamps	11 and 12	Off	Open circuit
		Head	Closed circuit
		Park	Closed circuit
		Autolamps	Open circuit
Autolamps	7 and 8	Off	Open circuit
		Head	Open circuit
		Park	Open circuit
		Autolamps	Closed circuit
Fog lamps	2 and 5	On	Closed circuit
		Off	Open circuit