COUPE

TERMINALS

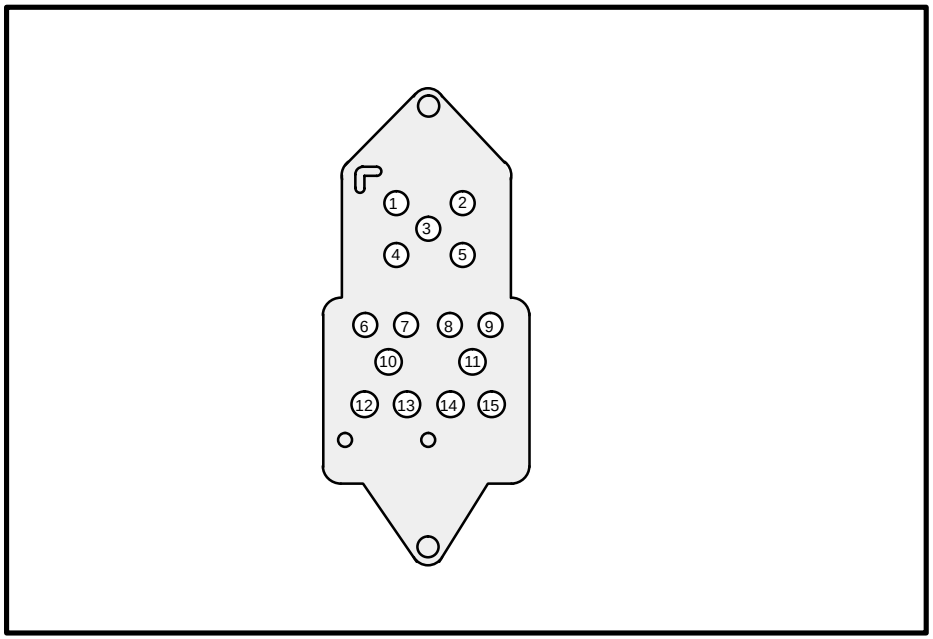

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Power and Grounds Checks Before Any Other Tests	10 and 12 10 and 7 11 and 14 11 and 9	Window Switches (All Positions)	Open Circuit
	12 and 6 7 and 13 14 and 15 9 and 8	Window Switches (At Rest)	Closed Circuit
	3 and 2 or 4	Door Lock Switch (At Rest)	Open Circuit
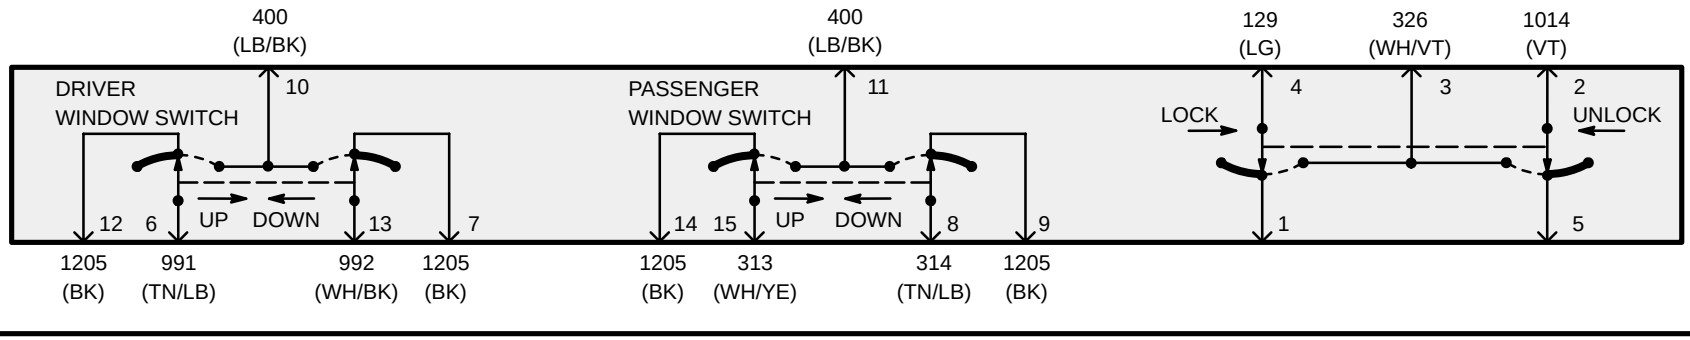
SCHEMATIC