COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Power and Ground Checks Before Any Other Tests	19 and 13	All Four Switches (all positions)	Open Circuit
	13 and all others except 20	All Four Switches (at rest)	Closed Circuit
Left Front Window Circuit	19 and 8	Up	Closed Circuit
	19 and 10	Down	Closed Circuit
Right Front Window Circuit	19 and 9	Up	Closed Circuit
	19 and 11	Down	Closed Circuit
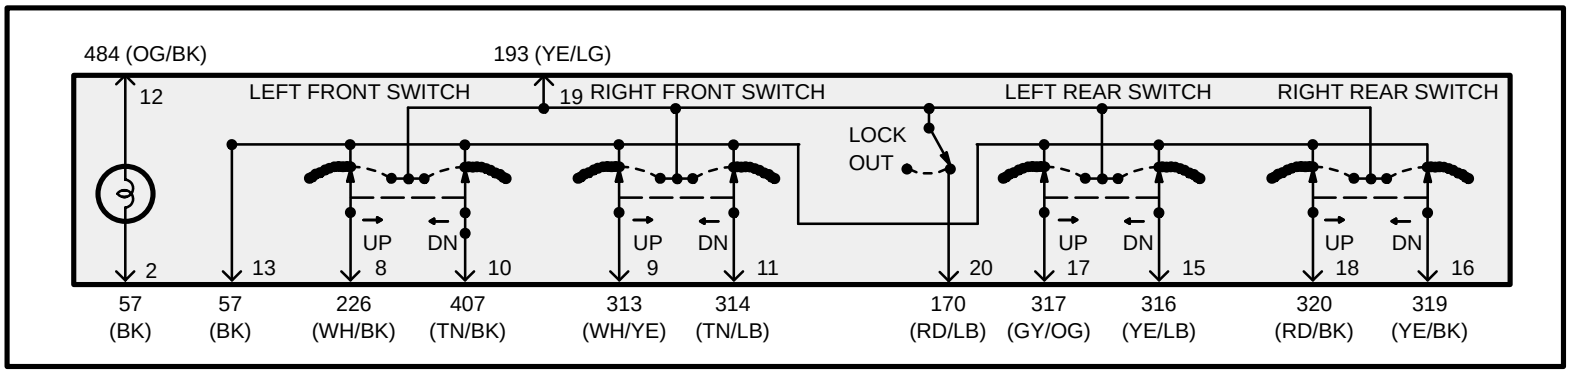
SCHEMATIC