Component Testing – Multifunction Switch, Wiper/Washer Portion

SCHEMATIC

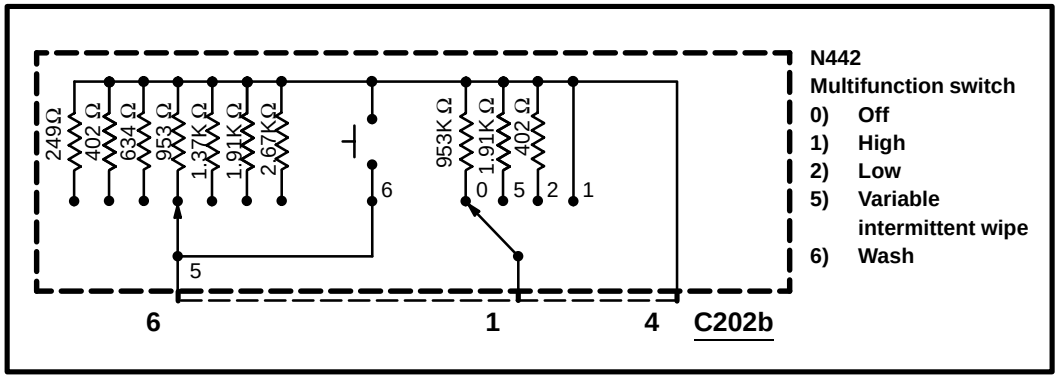

N442
Multifunction switch
0) Off
1) High
2) Low
5) Variable intermittent wipe
6) Wash

TERMINAL LOCATIONS

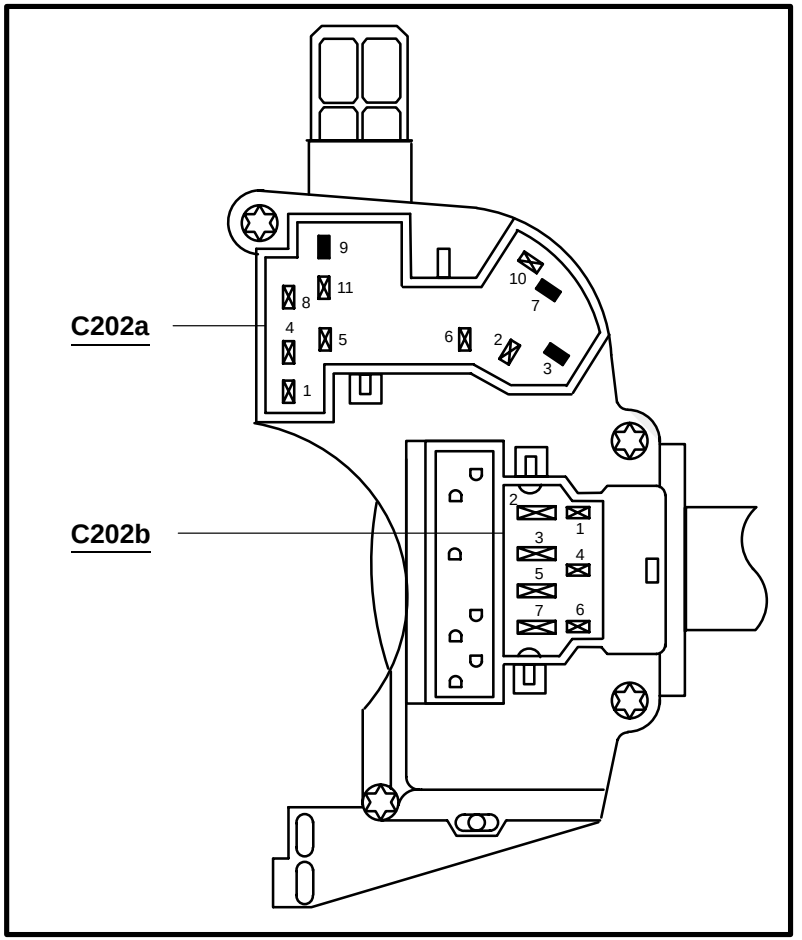

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch will Indicate
Washer Switch Circuit	4 and 6	Off Switch Depressed	Closed Circuit
		Off Switch Normal	Open Circuit
Wiper Switch Circuit	1 and 4	Off	953Ω
		Int	1.91KΩ
		Low	402Ω
		High	Closed Circuit
Intermittent Wiper Circuit	4 and 6	#1 Detent	2.67KΩ
		#2 Detent	1.91KΩ
		#3 Detent	1.37KΩ
		#4 Detent	953Ω
		#5 Detent	634Ω
		#6 Detent	402Ω
		#7 Detent	249Ω