### TERMINALS

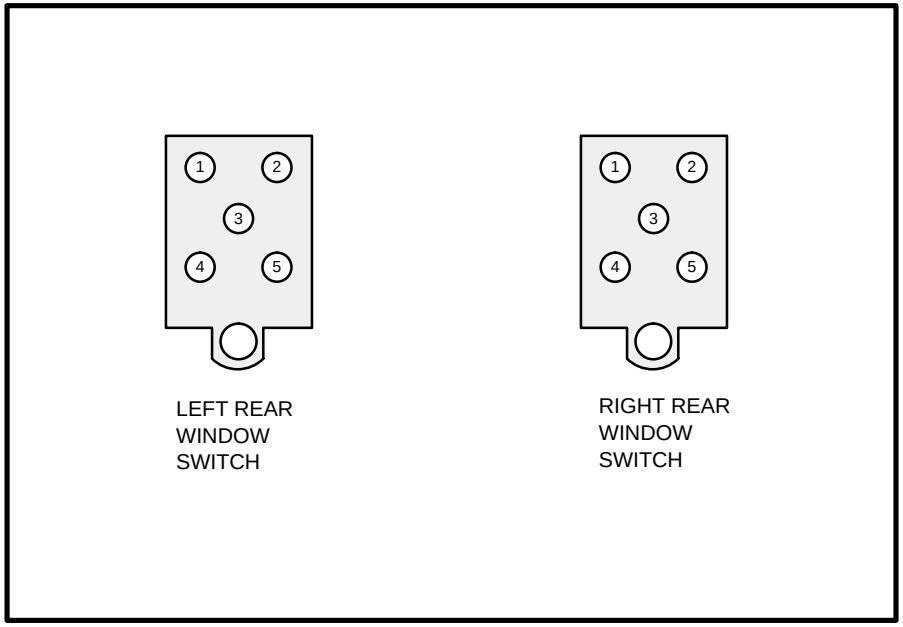


### COMPONENT TESTING PROCEDURE

| TO TEST | Connect Self Powered Test Light or Ohmmeter to Terminals | Move Switch to These Positions | A Good Switch Will Indicate |
|---|---|---|---|
| **Power and Ground Checks Before Any Other Tests** | 3 and 2<br>3 and 4 | Window Switch (All Positions) | Open Circuit |
| | 2 and 5<br>4 and 1 | Window Switch (All Rest) | Closed Circuit |
| **Window Circuit** | 3 and 5<br>4 and 1 | Up | Closed Circuit |
| | 3 and 1<br>5 and 2 | Down | Closed Circuit |
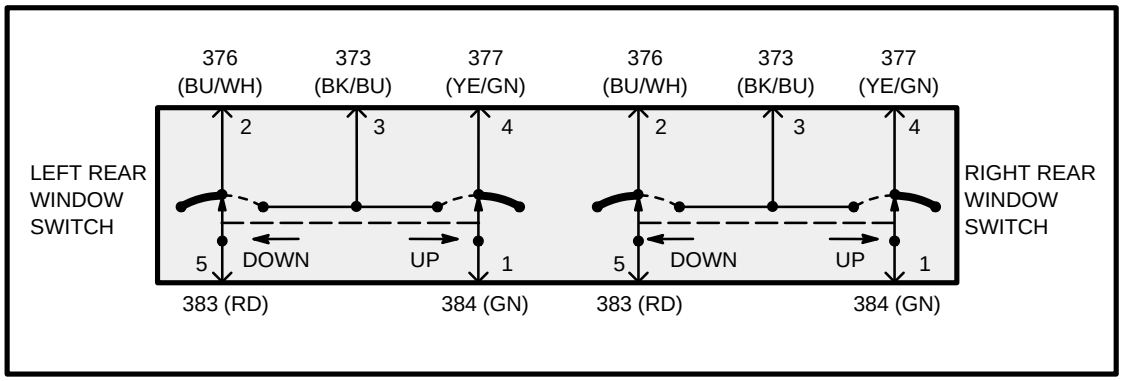
### SCHEMATIC