Window adjust switch

Schematic

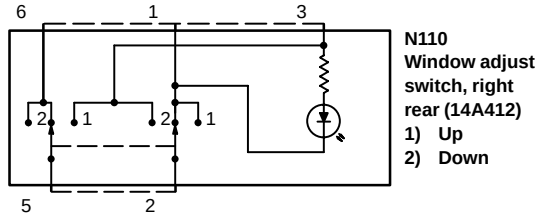

N110
Window adjust switch, right rear (14A412)
1) Up
2) Down

Terminals

C604
C701
C801

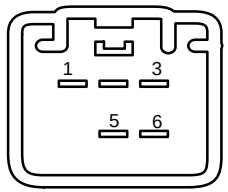

F06213

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Down Switch Circuit	3 and 2	Down	Closed circuit
	6 and 5, 1 and 2	Rest	Closed circuit
Up Switch Circuit	3 and 5	Up	Closed circuit
	6 and 5, 1 and 2	Rest	Closed circuit