C142 (BU–DURATEC) (BK–ZETEC)

12A522

Heated Oxygen Sensor (HO2S) #12 (9G444)

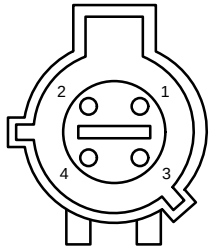

F04251

Pin	Circuit	Circuit function
1	34 (LB/OG)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
3	89 (OG)	signal, return
4	392 (RD/LG)	Heated Oxygen Sensor (HO2S) #12 (9G444), input

C143 (WH)

12A522

Turbine shaft speed sensor (7M101)

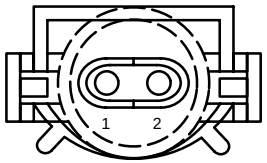

F02031

Pin	Circuit	Circuit function
1	1202 (BN/LG)	Ground
2	20 (WH/LB)	Turbine shaft speed sensor (7M101)

C150 (BK)

14290

Wheel speed sensor, left front (2C205)

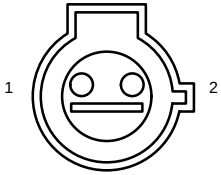

F02299

Pin	Circuit	Circuit function
1	522 (TN/BK)	Wheel speed sensor, left front (2C205) –
2	521 (TN/OG)	Wheel speed sensor, left front (2C205) +

C152 (BK/BU)

14290

Fog lamp, left front (15200)

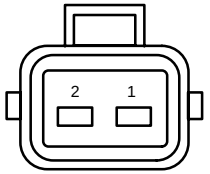

F02301

Pin	Circuit	Circuit function
1	478 (TN/OG)	Fog lamp relay, to front fog lamp
2	57 (BK)	Ground