C1094

12B637

A285
4R44E Transmission

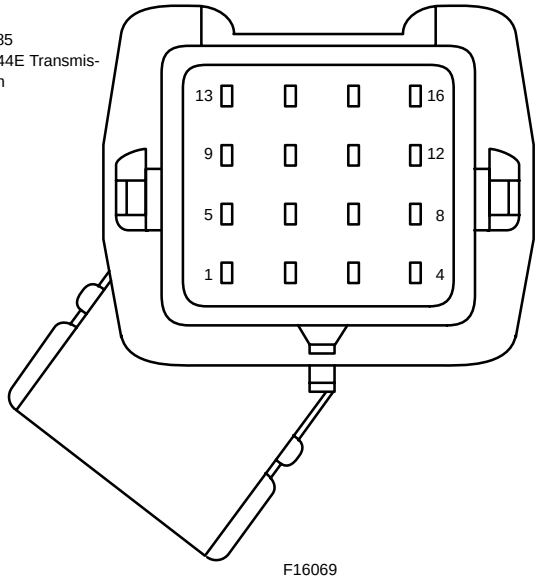

F16069

Pin	Circuit	Circuit Function
1	34 (LB/OG)	Voltage supplied in Start and Run (overload protected)
2	970 (DG/WH)	Turbine shaft speed (TSS) sensor
3	359 (GY/RD)	signal, return
4	923 (OG/BK)	Transmission Fluid Temperature (TFT) sensor, input
5	480 (VT/YE)	Torque Converter Clutch (TCC) solenoid
6	–	not used
7	971 (PK/BK)	Shift solenoid C
8	359 (GY/RD)	signal, return
9	924 (BN/OG)	Coasting clutch solenoid
10	34 (LB/OG)	Voltage supplied in Start and Run (overload protected)
11	34 (LB/OG)	Voltage supplied in Start and Run (overload protected)
12	925 (WH/YE)	Electronic Pressure Control (EPC) solenoid
13	–	not used
14	315 (VT/OG)	Shift solenoid B
15	–	not used
16	237 (OG/YE)	Shift solenoid A

C1100a

14A280

O1
Battery



F01059

Pin	Circuit	Circuit Function
1	2037 (RD)	Battery cable +
	2037 (RD)	Battery cable +

C1100b

14A280

O1
Battery



F01059

Pin	Circuit	Circuit Function
1	2057 (BK)	Battery cable –
	2057 (BK)	Battery cable –

C1107

12B637

B110
Output shaft speed sensor (OSS)

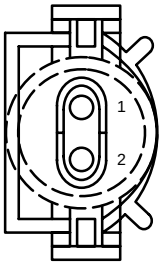

F02031

Pin	Circuit	Circuit Function
1	359 (GY/RD)	signal, return
2	136 (DB/YE)	Powertrain Control Module (PCM) - Output shaft speed sensor (OSS)