C244

14A005

B138
Dual axis accelera-
tion sensor

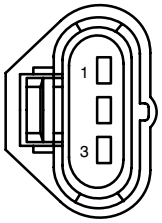

F03101

Pin	Circuit	Circuit Function
1	9-CF66 (BN/BU)	Sensor signal return (reference/ ground)
2	8-CF66 (WH/BU)	Sensor signal
3	7-CF66 (YE/BU)	Voltage D.C. supplied at all times (sensor)

C245

14A005

B139
Yaw velocity sensor

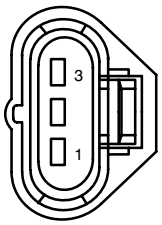

F03101

Pin	Circuit	Circuit Function
1	8-CF67 (WH/RD)	Sensor signal
2	9-CF67 (BN/RD)	Sensor signal return (reference/ ground)
3	7-CF67 (YE/RD)	Voltage D.C. supplied at all times (sensor)

C246

14A005

R75
Window heater, left

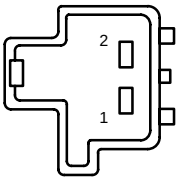

F02050

Pin	Circuit	Circuit Function
1	31-HB42 (BK/YE)	Ground
2	–	not used

C247

14A005

R76
Window heater, right

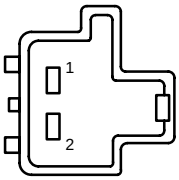

F02050

Pin	Circuit	Circuit Function
1	30S-HB42 (BK/YE)	Voltage supplied at all times (not overload protected), Switched
2	–	not used

C248

14401

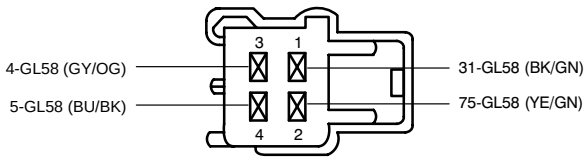

F04105

14B242

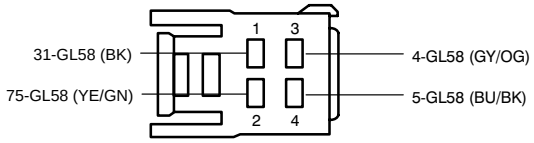

F04106