CONVERTIBLE

TERMINALS

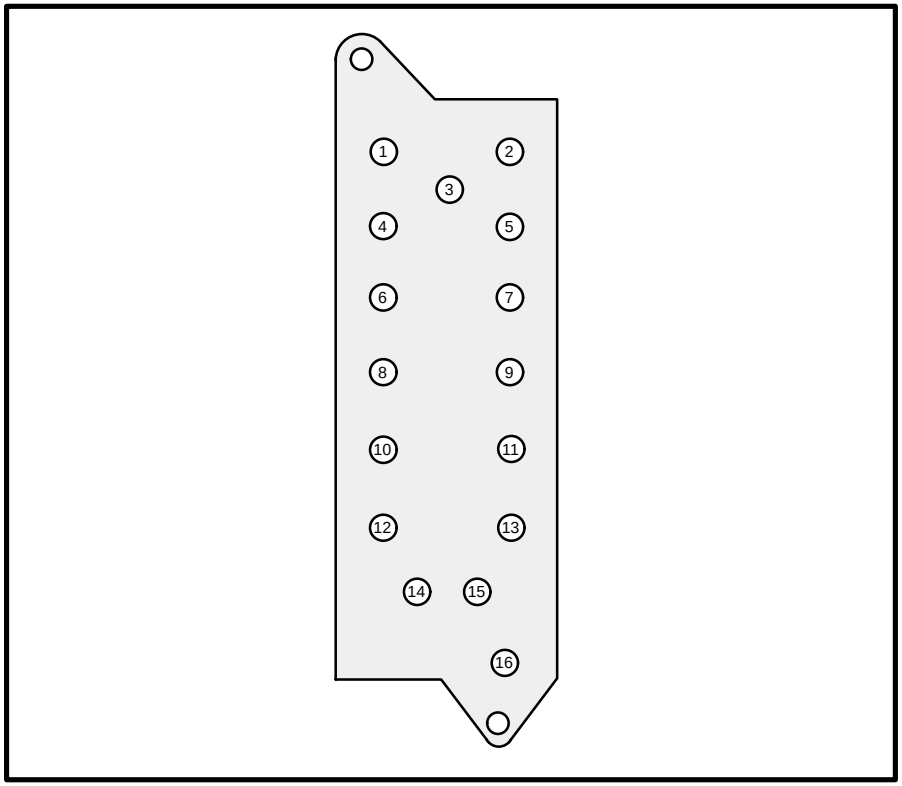

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Power and Ground Checks Before Any Other Tests	15 and 14	All Four Window Switches (All Positions)	Open Circuit
	14 and 8, 6, 7, 9, 10, 12, 11, 13	All Four Window Switches (At Rest)	Closed Circuit
	3 and 2 or 4	Door Lock Switch (At Rest)	Open Circuit
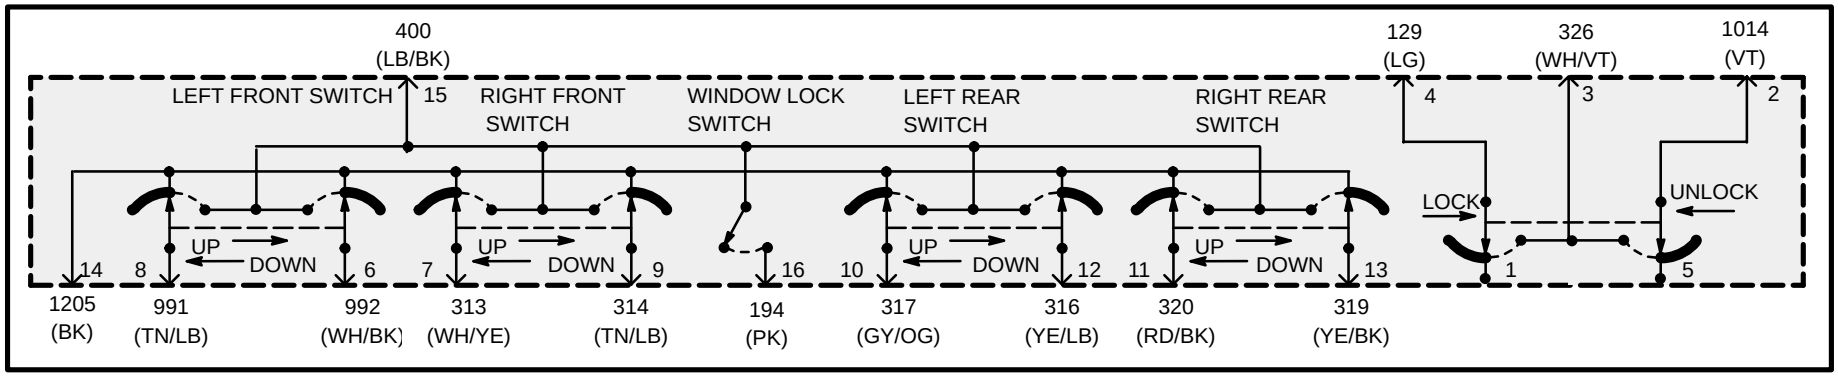
SCHEMATIC