COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Check Power and Grounds Before Any Other Tests	1 and all others except 3	All 3 Switches at Rest	Closed Circuit
	3 and 1	All 3 Switches at Rest	Open Circuit
Front Tilt Circuit	3 and 7	Up	Closed Circuit
	3 and 5	Down	Closed Circuit
Rear Tilt Circuit	3 and 4	Up	Closed Circuit
	3 and 6	Down	Closed Circuit

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Horizontal Movement	3 and 2	Forward	Closed Circuit
	1 and 8	Rearward	Closed Circuit

SCHEMATIC

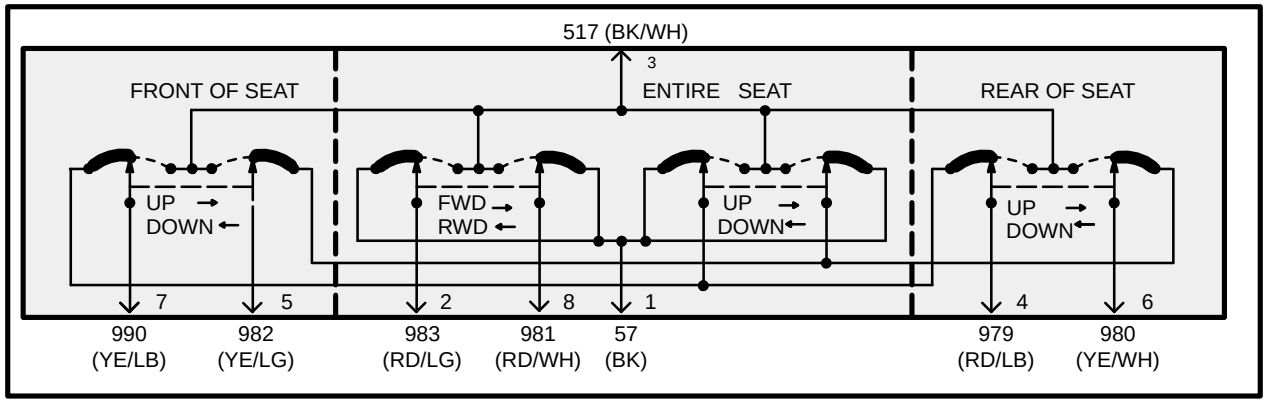

TERMINALS

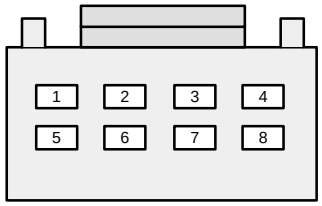

C327

(BASE AND POLICE)