Third row folding seat switch, right front

Schematic

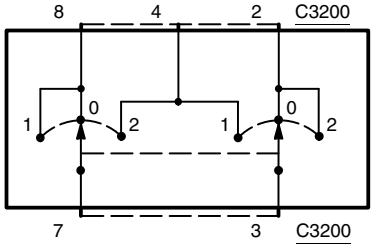

Third row folding seat switch, right front
0) Rest
1) Up
2) Down

Terminals

C3200

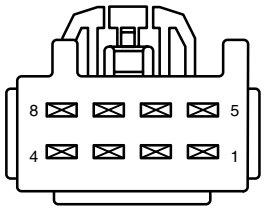

F08193

Component testing procedure

Circuit to test	Connect self–powered test light or ohm-meter to terminals	Move switch to these positions	A good switch will indicate
Up/Down Circuit	3 and 2	Up	Open circuit
		Rest	Closed circuit
		Down	
	3 and 4	Up	Closed circuit
		Rest	Open circuit
		Down	
	7 and 8	Up	Closed circuit
		Rest	
		Down	Open circuit
	7 and 4	Up	Open circuit
		Rest	
		Down	Closed circuit