149-3 COMPONENT TESTING: MULTIFUNCTION SWITCH

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Washer Switch Circuit	6 and 4	With Wiper Switch OFF: Push washer switch in Release washer switch	Closed Circuit 103.3k ohm ± 10%
Wiper Switch Circuit	2 and 4	OFF INT LOW HIGH	47.6k ohm ± 5% 11.33k ohm ± 5% 4.08k ohm ± 5% Closed Circuit
Interval Time Adjust	6 and 4	INT and OFF LOW and HIGH	Rotate Control toward OFF; Ohmmeter will show smoothly increasing resistance from 3.3k ohm min. to 103.3k ohm max. (± 10%) 3.3k ohm (± 10%)

SCHEMATIC

WIPER/WASHER PORTION

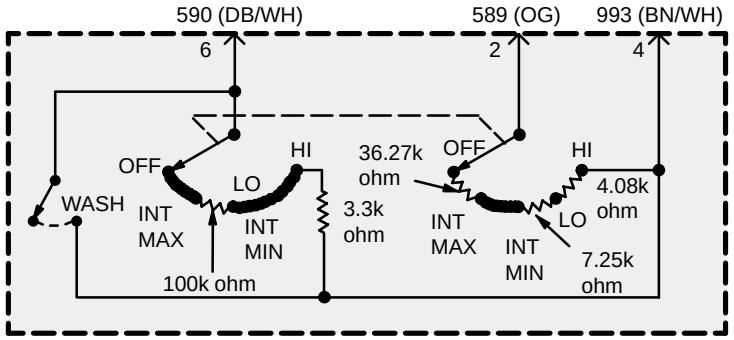
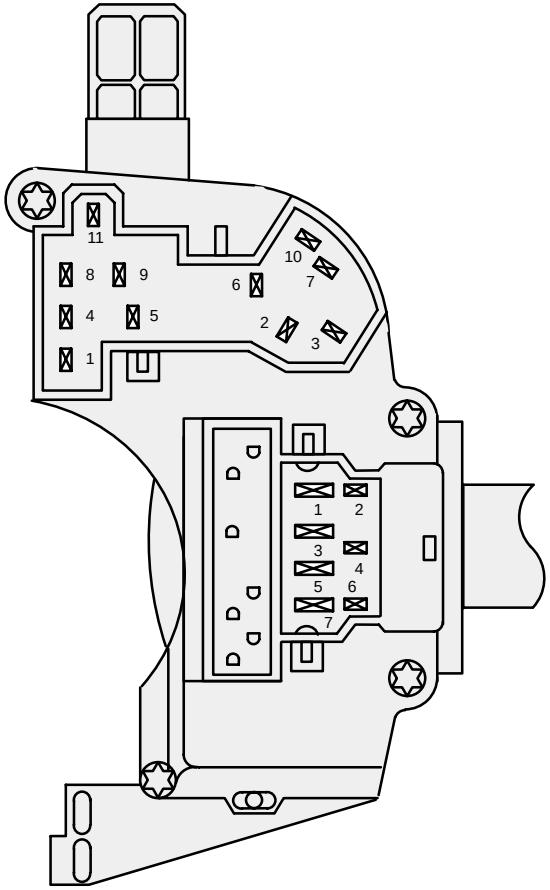
TERMINALS