TERMINALS

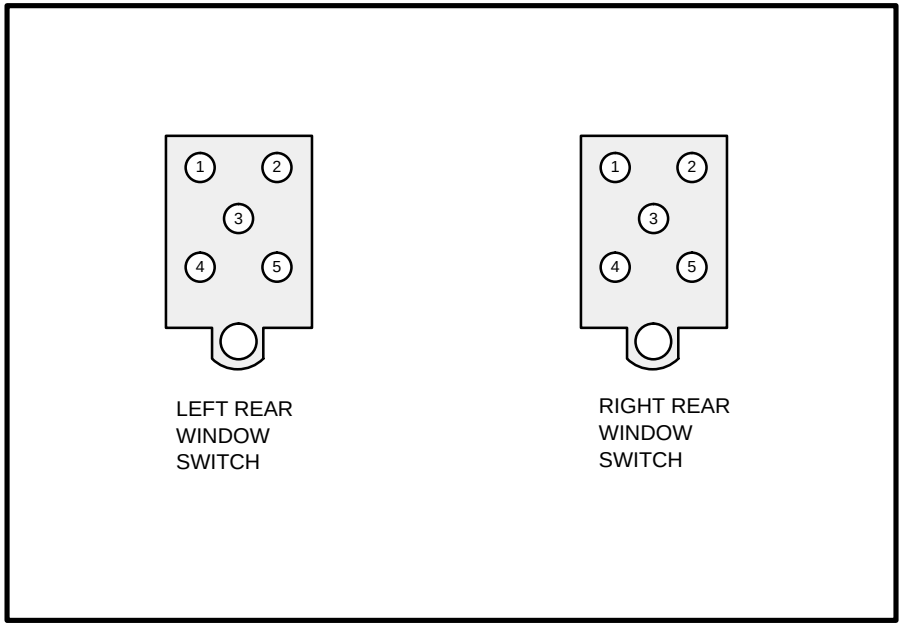

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Power and Ground Checks Before Any Other Tests	3 and 2 3 and 4	Window Switch (All Positions)	Open Circuit
	2 and 5 4 and 1	Window Switch (All Rest)	Closed Circuit
Window Circuit	3 and 5 4 and 1	Up	Closed Circuit
	3 and 1 5 and 2	Down	Closed Circuit
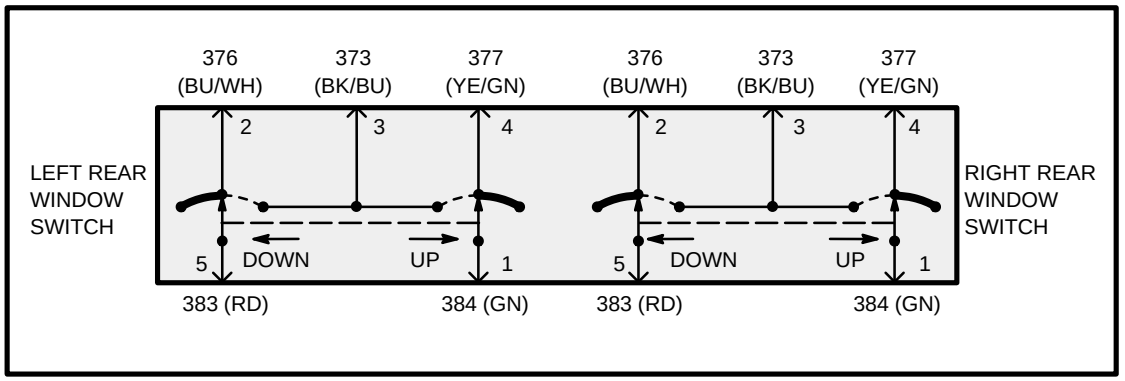
SCHEMATIC