TRANSMISSION—4R100—EXTENDED 1-2/3-4 UPSHIFTS DURING COLD START-UP CONDITIONS—VEHICLES EQUIPPED WITH 7.3L ENGINE AND 4R100 TRANSMISSION—VEHICLES PRODUCED 7/31/2000 THROUGH 9/23/2000	Article No. 01-2-4

FORD: 2001 EXCURSION, SUPER DUTY F SERIES

ISSUE

Some vehicles equipped with a 7.3L engine and 4R100 transmission built prior to 9/24/2000 may exhibit slightly extended 1-2/3-4 upshifts during cold startup conditions. This may be caused by the calibration of the Powertrain Control Module (PCM).

ACTION

Verify condition. If shift condition is verified and normal diagnostics cannot pinpoint condition, reprogram the PCM with new calibration. The new calibration increases clutch pressure during cold startup conditions. Refer to the following PCM Calibration Information Chart.

PCM CALIBRATION INFORMATION

Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
F-250/350 Federal	1C3F-ZB	PMT2	1C3Z-ZC	1F719S0A05	1F719S0A10	WDS Release B11.5
F-450/550, 50-State	1C3F-ADB	BKA2	1C3Z-ADC	1F719T0A05	1F719POB10	WDS Release B11.5
F-450/550, CFF/LEV	1C3F-AEB	KRK2	1C3Z-AEC	1F719POB05	1F719POB10	WDS Release B11.5
F-250/350, Calif.	1C3F-ABB	NMC2	1C3Z-ABC	1F719NOB05	1F719NOB10	WDS Release B11.5
Excursion, 50-State	1C3F-XB	EBM2	1C3Z-XC	1L119YOB05	1L119YOB10	WDS Release B11.5

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

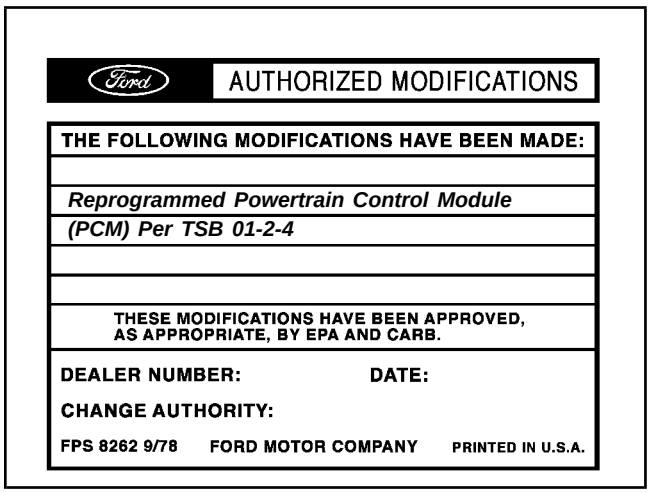

Copyright © 2001 Ford Motor Company

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 501000, 504000