• **DRIVEABILITY—NO START—SECURILOCK PASSIVE ANTI-THEFT SYSTEM (PATS)—UNABLE TO ACCESS—UNABLE TO PROGRAM IGNITION KEYS—VEHICLES PRODUCED 3/18/2001 THROUGH 4/3/2001 EQUIPPED WITH 4.0L ENGINE ONLY** • **ELECTRICAL—SECURILOCK PASSIVE ANTI-THEFT SYSTEM (PATS)—UNABLE TO ACCESS—UNABLE TO PROGRAM IGNITION KEYS—VEHICLES PRODUCED 3/18/2001 THROUGH 4/3/2001 EQUIPPED WITH 4.0L ENGINE ONLY**	**Article No. 01-24-5**

FORD: 2002 EXPLORER

MERCURY: 2002 MOUNTAINEER

ISSUE

Some vehicles equipped with the 4.0L engine may exhibit a condition of "unable to access" with the SecuriLock Passive Anti-Theft System (PATS). When an operation requiring PATS Security Access is attempted, an error message may be displayed, or a reference to Coded Access may be displayed. It will not be possible to enter Security Access to erase or program ignition keys into the vehicle with this condition present. This may be caused by the calibration of the Powertrain Control Module(PCM).

ACTION

Verify the condition. If normal diagnostics cannot pinpoint the condition, reprogram PCM to the latest level calibration. Refer to the following Service Information for details.

SERVICE PROCEDURE

If the New Generation Star Tester (NGS) or Worldwide Diagnostic System (WDS) displays either of the following error messages when attempting to enter Security Access for the Passive Anti-Theft System (PATS), reprogram the PCM using the NGS or WDS as necessary.

- **WDS:** "The test has found a fault" followed by a screen, "Coded Access mode not supported"
- **NGS:** "Security Code number: _ _ _ _ _ _ Contact local hotline for access code"

PCM CALIBRATION INFORMATION

Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
Explorer/Mountaineer, USA	1L2F-AGK	LAE0	1L2Z-AGL	1U51AF0B13	1U51AF0B14	WDS B16.2 Release or Later
Explorer/Mountaineer, Canada	1L2F-ACK	CNK0	1L2Z-ACL	1U51BG0A13	1U51BG0A14	WDS B16.2 Release or Later
Explorer/Mountaineer, Mexico	1L2A-BJ	QBD9	1L2Z-BK	1U51AG0M13	1U51AG0M14	WDS B16.2 Release or Later

Copyright © 2001 Ford Motor Company

Article No. 01-24-5 Cont'd.

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

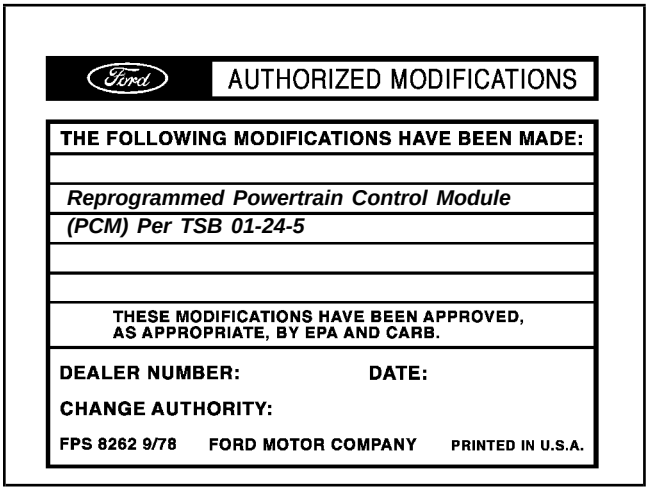

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 112000, 203000, 603300