POWERTRAIN CONTROL MODULE REPROGRAMMING

AFFECTED VEHICLES: **CERTAIN 2000 MODEL YEAR LINCOLN LS VEHICLES LOCATED IN THE U.S., U.S. TERRITORIES, MEXICO AND CANADA**

NOTE:

SOME VEHICLES MAY HAVE HAD THE PCM REPROGRAMMED PREVIOUSLY. ON THESE VEHICLES, VERIFY CALIBRATION USING APPROPRIATE DIAGNOSTIC TOOL.

SERVICE PROCEDURE

1. Reprogram the Powertrain Control Module (PCM) to the latest calibration listed in the table below (only one of these calibrations will be selectable for each vehicle), using one of the following two (2) methods:
   - Worldwide Diagnostic system (WDS). Use B7 CD-ROM or later.
   - Service Bay Technical System (SBTS) and the New Generation STAR (NGS) Tester with Rotunda flash cable (007-00531) and Rotunda flash card (007-00532). Use R00 Calibration CD-ROM dated May, 2000 or later.

PCM REPROGRAMMING INFORMATION

Application	Transmission	Tear Tag Number *	Qualifier *
3.0L Lincoln LS – 49S Non-Sport	5R55N — non-SST	BMTx	9LDA-AAx CALIBRATION
3.0L Lincoln LS – 49S Sport Model	5R55N — SST	AUTx	9LDA-ACx CALIBRATION
3.0L Lincoln LS – California Non-Sport	5R55N — non-SST	BORx	9LDA-BBx CALIBRATION
3.0L Lincoln LS – California Sport Model	5R55N — SST	CAJx	9LDA-BCx CALIBRATION
3.0L Lincoln LS – 50S Sport Model	Manual Trans.	JEKx	9LDM-ACx CALIBRATION
3.9L Lincoln LS – 50S Sport Model	5R55N — SST	WOKx	9WHA-BAx CALIBRATION
3.9L Lincoln LS – Mexico	5R55N — SST	VAHx	9WHA-AAx CALIBRATION
3.9L Lincoln LS – 50S Non-Sport (3.31 Axle)	5R55N — non-SST	NIAx	9WHA-BBx CALIBRATION
3.9L Lincoln LS – 50S Non-Sport (3.58 Axle)	5R55N — non-SST	MPUx	9WHA-ABx CALIBRATION

* The lower case “x” after each number is a variable digit or letter that can range from 0 to 9 or A to Z.

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
05/00

2. Obtain and prepare the Authorized Modifications Label. Write the modification completed, your P & A Code, date of repair and the program type and program number as shown below.

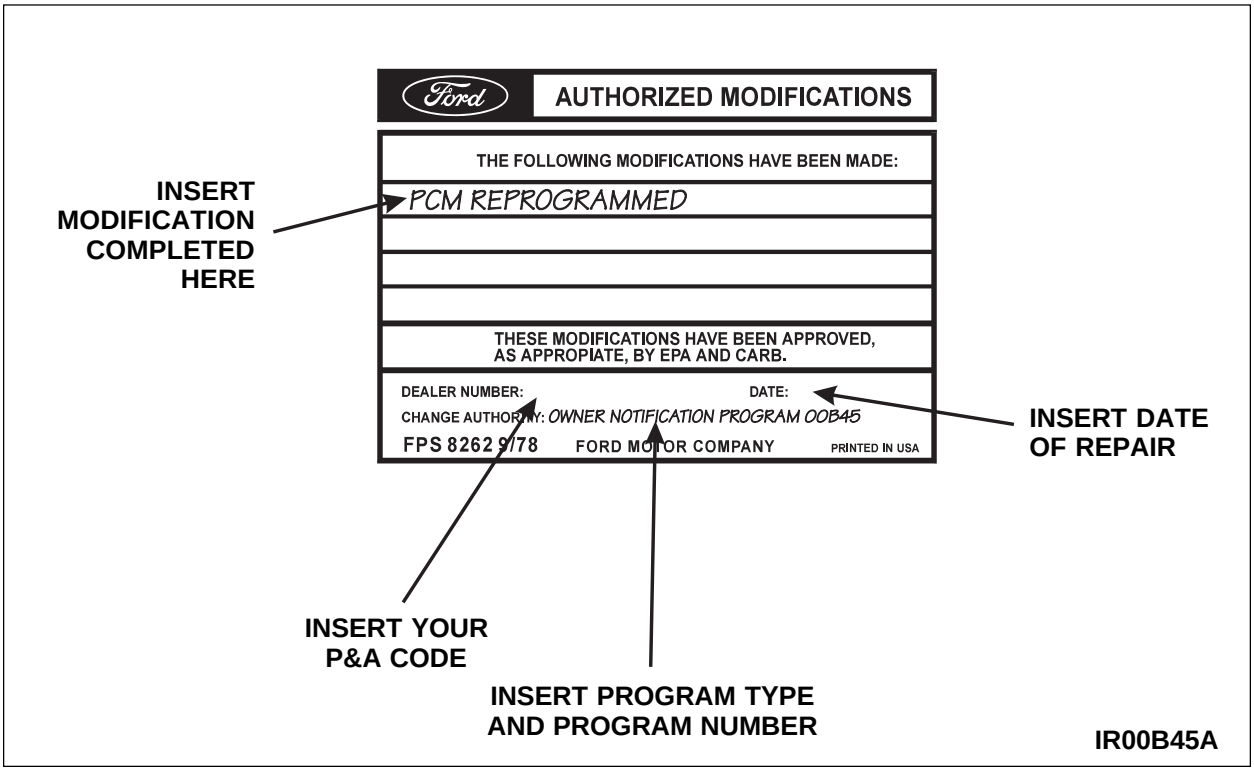


FIGURE 1

3. Apply label to clear area of the upper radiator support.

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
05/00