Ford Motor Company

November 2000

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: **DEMONSTRATION / DELIVERY HOLD – Safety Recall 00S37:** Certain 1994 - 2001 Model Year Mustang Vehicles Equipped With Manual Transmission – Park Brake Control Assembly Modification

AFFECTED VEHICLES

Certain 1994 through 2001 model year Mustang vehicles equipped with a manual transmission and built at the Dearborn Assembly Plant from October 4, 1993 through October 16, 2000.

SAFETY CONCERN

Affected vehicles have the potential for a mis-alignment condition within the park brake control assembly. Mis-alignment of the pawl to the sector gear teeth of the park brake self-adjust mechanism can allow for less than 100% sector tooth engagement when the parking brake is applied.

If this condition occurs, there is a potential for the pawl to fall into that sector tooth or skip to a different sector tooth. If one or more sector teeth are skipped, a reduction in the park brake cable load will result, which may lead to unintended vehicle movement.

SERVICE ACTION

Dealers will modify the park brake control assembly in accordance with the technical instructions included in this bulletin.

PLEASE NOTE

Do not drive, demonstrate, deliver or perform pre-delivery inspection on any vehicles affected by this recall until this repair has been performed.

Correct all vehicles in stock before delivery. Federal law requires dealers to complete any outstanding safety recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to $1,100 per vehicle.

DEMONSTRATION / DELIVERY HOLD CLARIFICATION

Any unsold / undelivered Mustang vehicles equipped with a manual transmission, as listed under the **AFFECTED VEHICLES** section, currently in dealer inventory are those vehicles for which the demonstration / delivery hold is applicable. The demonstration / delivery hold is not applicable on affected vehicles in the customer's possession.

PARTS AVAILABILITY INFORMATION

2001 Model Year Vehicles

- Dealers may order service repair kits and perform Safety Recall 00S37 service on affected vehicles. Owners of affected units will be notified by Ford Motor Company via first class mail.

1994 – 2000 Model Year Vehicles In Customers' Possession

- Dealers may advise affected vehicle owners that a service parts kit is expected to be available by mid-December, 2000. Owners of affected units will be notified by Ford Motor Company via first class mail.
- Dealers may advise owners of affected vehicles to follow the instructions found in their owner guide for the proper method to park their vehicles securely. The owner guide instructs customers to always apply the brake pedal and pull the parking brake handle up as far as possible and place the gearshift of the manual transmission securely in 1st (first) gear after setting the parking brake.
- Dealers should refer the vehicle owner to the appropriate section of the vehicle's Owner Guide for proper parking brake application. An example of the Mustang Owner Guide Parking Brake Section is attached. Dealers may consider providing copies to customers as a convenient reference.

ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Attachment IV: Example Mustang Owner Guide – Parking Brake
Customer Notification Letter

QUESTIONS?

Claims Information:……...1-800-423-8851
Other (Dealer Only) Recall Questions:……...1-800-325-5621

Sincerely,



Ann O'Neill
Director
Vehicle Service and Programs

Safety Recall 00S37
Certain 1994 - 2001 Model Year Mustang Vehicles Equipped with Manual Transmission – Park Brake Control Assembly Modification

OASIS

You must use OASIS to determine if a vehicle is eligible for this recall.

PROMPTLY CORRECT

Promptly correct all affected vehicles on your dealer VIN list which you will receive in the Ford Dealer Consolidated Communicator (FDCC). Also, correct other eligible vehicles which are brought to your dealership.

DEALER-OWNER CONTACT

Immediately contact any affected owner whose name is not on the list. Give the owner a copy of the Owner Letter and schedule a service date.

REGIONAL CONTACT

Advise regional office if an owner:

- cannot be contacted.
- does not make a service date.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid park brake control assembly modifications directly related to this condition which were made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

RENTAL CARS

Effective November 6, 2000, Ford Motor Company will pay for a rental vehicle under Safety Recall 00S37, with the following stipulations:

- for 2001 model year vehicles only
- for a maximum of two (2) days
- except for fuel which will be at owner's expense

Enter the word "RENTAL" plus the number of days the vehicle was used in the Miscellaneous Expense area. Follow ESP cost guidelines.

Safety Recall 00S37
Certain 1994 - 2001 Model Year Mustang Vehicles Equipped with Manual Transmission – Park Brake Control Assembly Modification

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Remove, Modify and Re-Install Park Brake Control Assembly	00S37B	0.7 Hours
Administrative Allowance	Misc. Expense Code "ADMIN"	0.1 Hour

PARTS REQUIREMENTS

Parts Ordering Information

Parts will not be direct shipped for this recall. Service parts kits for 2001 model year Mustang vehicles are now available through normal order processing channels as noted below. Dealers will be notified via DOESII / Combat and a Supplemental notification when the 1994 – 2000 service kit becomes available.

Emergency Orders	Before December 23, 2000	Call 1-800-325-5621
All Orders	After December 23, 2000	Normal order process

Part Number	Description	Quantity
1R3Z-2A753-AA	Kit, Flat Plate Bracket – ***2001 Model Year Mustang*** Equipped with Manual Transmission *Approximately 3800 involved vehicles*	1
1R3Z-2A753-xx[1/]	Kit, Over Bracket – ***1994 – 2000 Model Year Mustang*** Equipped with Manual Transmission	1

[1/] - It is anticipated that Over Bracket service parts kits for 1994 – 2000 model year vehicles will be available mid-December.

DOR/COR

DOR/COR Number 50193 identifies parts ordered for this campaign through the Recall Hotline (1-800-325-5621).

DEALER PRICE

For latest prices, refer to DOES II or your updated Price Book

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

The following information is from the 2000 Mustang Owner Guide

Parking brake (P)

Apply the parking brake whenever the vehicle is parked. To set the parking brake, apply the brake pedal and pull the parking brake handle up as far as possible. See Figure 1



00S37A


FIGURE 1

The BRAKE warning lamp in the instrument cluster illuminates and remains illuminated (when the ignition is turned ON) until the parking brake is released.

ALWAYS SET THE PARKING BRAKE FULLY AND MAKE SURE THAT THE GEARSHIFT IS SECURELY LATCHED IN P (PARK) (AUTOMATIC TRANSMISSION) OR IN 1 (FIRST GEAR) (MANUAL TRANSMISSION).

The parking brake is not recommended to stop a moving vehicle. However, if the normal brakes fail, the parking brake can be used to stop your vehicle in an emergency. Since the parking brake applies only the rear brakes, the vehicle's stopping distance will increase greatly and the handling of your vehicles will be adversely affected.

To release the parking brake, the brake handle may need to be pulled up slightly to release pressure before pushing in the button. See Figure 2

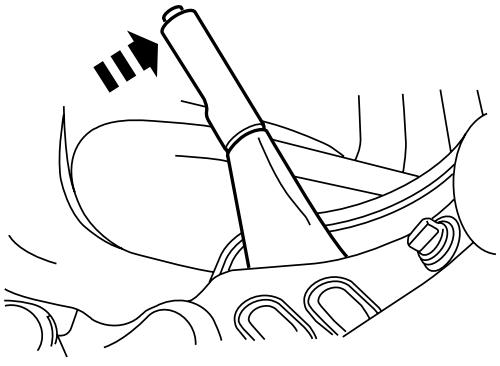

00S37B

FIGURE 2

Push the button on the end of the parking brake handle and push the handle down as far as possible. Driving with the parking brake applied will cause the brakes to wear out quickly and reduce fuel economy.

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
11/00

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121
1-800-392-3673

November 2000

00S37

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Ford Motor Company has decided that a defect which relates to motor vehicle safety exists in certain 1994 – 2001 model year Mustang vehicles equipped with manual transmission.

We apologize for this situation, and want to assure you that, with your assistance, we will correct this condition. Our commitment, together with Ford dealers, is to provide you with the highest level of service and support possible.

What the safety issue is …

Affected vehicles have the potential for a mis-alignment condition within the park brake control assembly that could cause the park brake to not hold and allow the vehicle to roll if the parking instructions in your owner guide are not followed.

The owner guide instructs customers to always apply the brake pedal and pull the parking brake handle up as far as possible and place the gearshift of the manual transmission securely in 1st (first) gear after setting the parking brake.

What Ford Motor Company and your dealer will do ...

Ford Motor Company will repair your vehicle free of charge (parts and labor). Owners who are affected by this recall are requested to return their vehicle to their dealer for modification of the park brake control assembly.

How long will it take?

The time needed for this repair is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time.

What we are asking you to do …

Call your dealer without delay. Ask for a service date and whether parts are in stock for Safety Recall 00S37.

If your dealer does not have the parts in stock, they can be ordered before scheduling your service date. Parts would be expected to arrive within a week after ordering.

When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.

If you've already paid for this service …

If you paid to have the park brake control assembly modified before the date of this letter, Ford is offering a full refund. For the refund, please give your paid original receipt to your dealer. To avoid delays, do not send receipts to Ford Motor Company.

If you've changed address or sold the vehicle …

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you have concerns …

If you have trouble getting your vehicle repaired promptly and without charge, please contact your dealership's Service Manager. If you still need assistance, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

CALL: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: (Eastern Standard Time)

Monday-Friday: 8:00 AM -11:00 PM
Saturday: 9:00 AM - 6:00PM

or you may contact us through the Internet at:
www.ownerconnection.com
Our current response time to Internet inquiries is three business days.

You also may send a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, S. W., Washington, D. C. 20590 or call the toll free Auto Safety Hotline 1-800-424-9393 (Washington, D. C. area residents may call 1-202-366-0123).

Quality Care service is there for you all year round.

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our Ford dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Thank you for your attention to this important matter.

Sincerely,



Ann O'Neill
Director
Vehicle Service and Programs