# POWERTRAIN CONTROL MODULE (PCM) REPROGRAM

**AFFECTED VEHICLES:** **CERTAIN 2000 MODEL YEAR TAURUS/SABLE EQUIPPED WITH 3.0L 4V ENGINE**

## SERVICE PROCEDURE

1. Reprogram the Powertrain Control Module (PCM) using the applicable calibration code from the calibration chart. Use one (1) of the following two (2) methods:
   - Service Bay Technical System (SBTS) and the New Generation STAR (NGS) Tester with Rotunda Flash Cable (007-00531) and Rotunda Flash Card (007-00532).
   - Worldwide Diagnostic System (WDS).

**CALIBRATION CHART**

| EMISSION STANDARD | OLD CALIBRATION | NEW CALIBRATION | NEW PART NUMBER |
|---|---|---|---|
| CLEAN AIR ACT (CAA) | 0DD15N0-A00<br>0DD14N0-A05 | 0DD15N0-A05<br>0DD14N0-A06 | YF1F-12A650-ADB<br>YU2F-12A650-ASA |
| LOW EMISSION VEHICLE (LEV) | 0DD15N0-505<br>0DD14N0-B05 | 0DD15N0-506<br>0DD14N0-B06 | YF1F-12A650-AEC<br>YU2F-12A650-AVA |
| KOREA/TAIWAN | 0DD15N0-K00<br>0DD14N0-K05 | 0DD15N0-K05<br>0DD14N0-K06 | YF1F-12A650-AFB<br>YU2F-12A650-ATA |
| EXPORT/LEADED | 0DD14L0-X06 | 0DD14L0-X07 | YF1F-12A650-VD |
| EXPORT/LEADED GULF COAST COUNTRIES (GCC) | 0DD14N0-G06 | 0DD14N0-G07 | YF1F-12A650-SD |

## PREPARING AUTHORIZED MODIFICATIONS LABEL

1. Obtain and prepare the Authorized Modifications Label. Write the modification completed with the Part Number from the calibration chart, your P&A Code, date of repair and the recall program type and program number. See Figure 1.

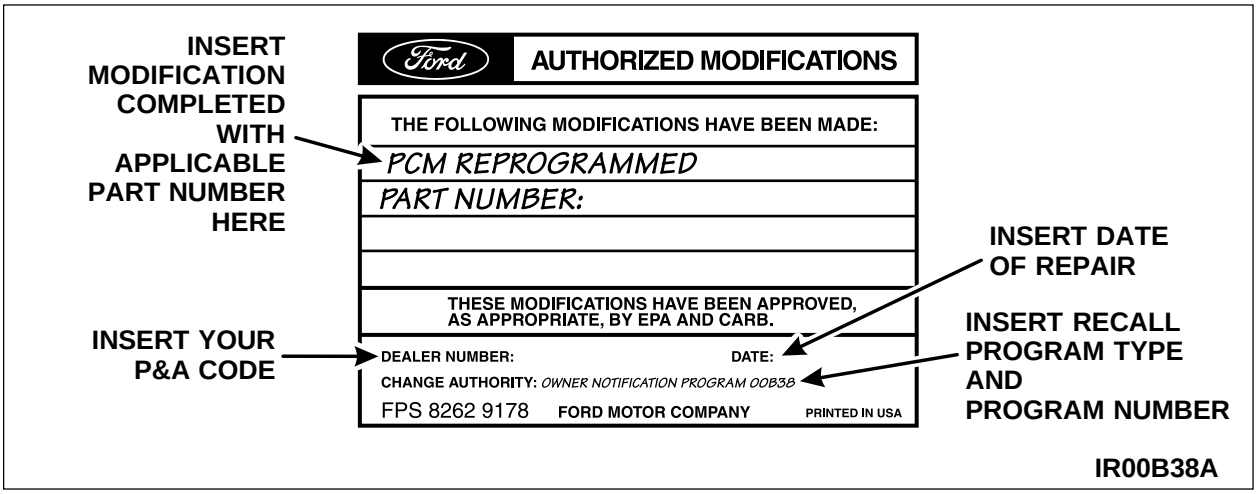



**FIGURE 1**

2. Apply the label to a clear area of the upper radiator support.

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
04/00