ELECTRICAL—CDX6 RADIO DAMAGED DURING SERVICE SHIPPING—CORRECT SHIPMENT PROCEDURES FOR CDX6 RADIO—SERVICE TIPS	Article No. 02-25-2

FORD: 2002 MUSTANG
2002-2003 THUNDERBIRD
2000-2003 ESCAPE
2001-2003 EXCURSION, EXPLORER SPORT TRAC, EXPLORER SPORT, EXPLORER, F-150, RANGER, SUPER DUTY F SERIES, WINDSTAR
2002-2003 E SERIES, EXPEDITION

LINCOLN: 2000-2003 LS
2002-2003 NAVIGATOR
2003 AVIATOR

MERCURY: 2001 COUGAR
2001-2002 MOUNTAINEER

ISSUE

The Compact Disc mechanism in CDX6 radio units may become damaged during shipment from the dealer to the radio repair center. To ensure that unnecessary damage does not occur, the Shipping Bracket must be installed prior to shipping.

ACTION

Use the following Service Procedure to correctly prepare the CDX6 radio for shipment to the radio repair center.

SERVICE INFORMATION

Before removing the radio from the vehicle, the following procedure must be performed:

1. Turn on the radio unit.
2. Remove any CDs from the unit.
3. Keep radio on and depress and Hold the "SCAN" & "1" station preset buttons together. Keep buttons depressed until the radio displays "Please Wait" for 2 seconds (Figure 1). Release the buttons.
4. The radio will display "In Ship Mode" for 3 seconds. At this point, the radio may now be removed from the vehicle (Figure 2).

NOTE

IF THE RADIO WILL NOT ENTER SHIP MODE THERE MAY BE CDs STUCK IN THE UNIT. DO NOT ATTEMPT TO REMOVE OR DAMAGE MAY

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle.

Copyright © 2002 Ford Motor Company

RESULT. MAKE NOTE THAT THE RADIO WILL NOT ENTER SHIP MODE ON THE 1878 FORM.

5. Obtain a Shipping Bracket to install in the radio. If unavailable at the dealer, your local Radio Repair Center will be able to supply. If using an Advance Exchange Unit, remove the Shipping Bracket from the exchange radio and install in the radio being sent in for service.

6. Install the Shipping Bracket into the top of the radio. The Shipping Bracket will support the CD mechanism ensuring unnecessary damage will not occur during transportation (Figure 3).

NOTE
THE SHIPPING BRACKET SHOULD EASILY SLIP INTO THE RADIO. DAMAGE WILL RESULT IF THE SHIPPING BRACKET IS FORCED INTO THE RADIO. MAKE NOTE THAT THE SHIPPING BRACKET COULD NOT BE INSTALLED INTO THE RADIO ON THE 1878 FORM.

7. Radio Repair Center information is located in the chart at the end of this article (Figure 4). In addition, your closest QS9000 Distributor can be found at the following website: www.evisteon.com. Select "Authorized Visteon Distributor" at the bottom of the page. Enter your zip code and submit to find the closet Visteon Authorized QS9000 Distributor.

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 207000

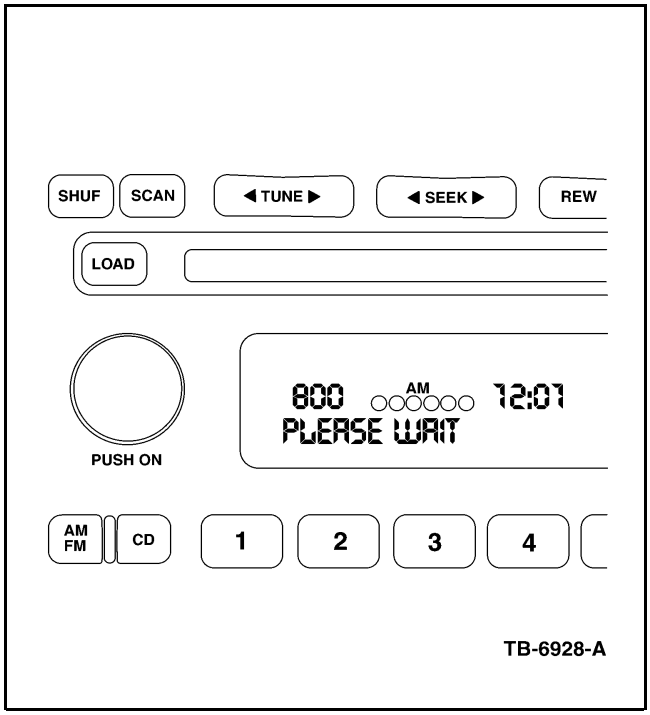


Figure 1 - Article 02-25-2

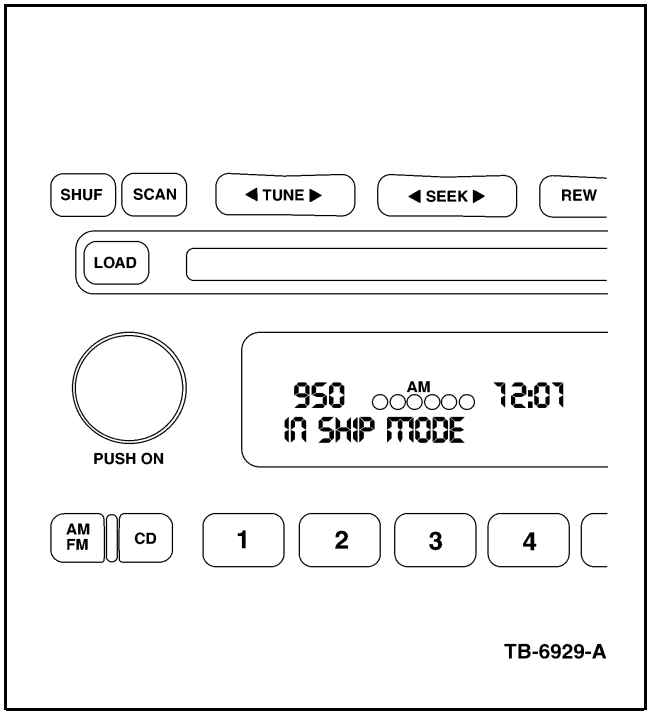


Figure 2 - Article 02-25-2

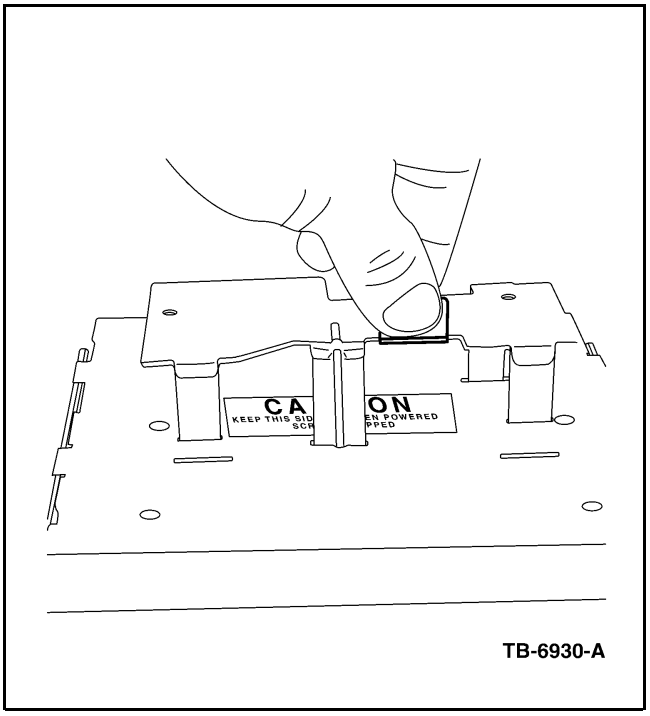


Figure 3 - Article 02-25-2

SERVICE CENTER

Auto Electric Radio (AER)
1841 W. Commonwealth Ave.
Fullerton, CA 92833
Phone: (714) 871-7357; (800) 321-6970
Fax: (714) 773-0815

Auto Radio Specialists, Inc.
1746 Columbia St.
San Diego, CA 92101
Phone: (619) 234-7532
Fax: (619) 234-1007

Autocraft Electronics
1612 Hutton Drive, Suite 120
Carrollton, TX 75006
Phone: (972) 466-6200; (800) 755-4161
Fax: (972) 466-6345

B&B Electronics O/A Ceritfied Radio
10407-107 Avenue
Edmonton, Alberta T5H-0V9
Phone: (780) 426-5375
Fax: (780) 420-6395

Bernie's Auto Air
58-02 37th Ave.
Woodside, NY 11377
Phone: (718) 651-6686
Fax: (718) 457-6296

Broadway Radio Shop Inc.
3401 Broadway
Kansas City, MO 64111
Phone: (816) 753-1960; (800) 255-7876
Fax: (816) 561-7397

Chicago Parts & Sound, Inc.
635 Wheat Lane
Wood Dale, IL 60191
Phone: (630) 350-1500; (800) 874-4437
Fax: (630) 350-0178

Custom Auto Radio Dist. of CT
10 Rosenthal St.
East Hartford, CT 06108
Phone: (860) 289-9394; (800) 289-9394
Fax: (860) 528-7381

D&B Auto Radio, Inc.
2140 Corporate Drive
Addison, IL 60101-1479
Phone: (630) 916-8787; (800) 323-4813
Fax: (630) 916-8922

Dayton Speedometer Service, Inc. (DSS)
7476 Webster Street
Dayton, OH 45414
Phone: (937) 454-4700; (800) 543-9687
Fax: (937) 454-4711

Downtown Radio Service, Inc.
2908 Stewart Creek Blvd.
Charlotte, NC 28216
Phone: (704) 391-0801; (800) 537-0116
Fax: (704) 393-9145

Downtown Radio Service, Inc.
10001 Kingston Pike, Ste 52
Knoxville, TN 37922
Phone: (423) 531-0098; (800) 343-0548
Fax: (423) 531-0869

Electra-Sound Inc.
5260 Commerce Parkway West
Parma, OH 44130
Phone: (216) 433-1050; (800) 262-9606
Fax: (216) 433-9425

Fortin Auto Radio, Inc.
5540 Metropolitain
St. Leonard, Quebec H1S 1A6
Phone: (514) 255-2720
Fax: (514) 255-1367

Gold Coast Autotronics
5601 Powerline Road, Suite 105
Fort Lauderdale, FL 33309
Phone: (954) 491-3800; (800) 669-3540
Fax: (954) 491-3802

H&R Auto Radio Service, Inc.
P.O. Box 39, 155 York Road
Warminster, PA 18974-0504
Phone: (215) 672-3707; (800) 523-6605
Fax: (215) 672-7674

Instrument Sales & Service
3839 N. 16th Street
Phoenix, AZ 85016
Phone: (602) 264-1379; (800) 227-7234
Fax: (602) 230-2229

Mid-State Distributing Co.
10811 Emiline St.
LaVista, NE 68128-5724
Phone: (402) 592-5965; (800) 798-5965
Fax: (402) 331-7382

Model Electronics Inc.
318 Roosevelt Avenue
Spring Valley, NY 10977
Phone: (845) 356-5669; (800) 433-9657
Fax: (845) 356-1189

National Auto Radio Service, Inc.
213 Grandstand Way
Fort Wayne IN 46825
Phone (219) 471-1396; (800) 748-0343
Fax: (219) 471-7320

PDA Inc.
271 W. County Line Road
Littleton, CO 80129
Phone: (303) 761-6022; (800) 766-3955
Fax: (303) 789-4370

Prime/MCS
Leibnitz 196
Col. Anzures C.P. 11590 Mexico, D.F.
Phone 011 (525) 531-4510
Fax: 011 (525) 254-3011

R.T. Grim Company
3925 East Trindle Road
Camp Hill, PA 17011
Phone: (717) 761-4113; (800) 382-1431
Fax: (717) 761-6535

R.T. Grim Company
57 New Frederick Street
Wilkes-Barre, PA 18701
Phone: (717) 829-2350; (800) 334-8067
Fax: (717) 829-2352

Radio Sales & Service Corporation
5920 Milwee St.
Houston, TX 77091
Phone: (713) 613-0700; (800) 727-2346
Fax: (713) 613-0701

Royal Radio Sales & Service Inc.
612 N. Main Street
Royal Oak, MI 48067
Phone: (248) 548-0060; (800) 482-0821
Fax: (248) 588-6460

Sounds on Wheels, Inc.
15315 1st Ave. S.
Seattle, WA 98148
Phone: (206) 248-3000
Fax: (206) 244-5798

Speed-O-Tach, Inc.
4090 Pike Lane
Concord, CA 94520
Phone: (925) 691-4090; (800) 442-4491
Fax: (925) 691-4101

Speedometer-Radio Service, Inc.
196 Forbes Ave.
St. Paul, MN 55102
Phone: (651) 224-3874; (800) 328-9136
Fax: (651) 224-6951

Speedometer Service Company
115 Mansell Place
Roswell, GA 30076
Phone: (770) 569-8255; (800) 332-1827
Fax: (770) 569-8266

Techni-Car Inc.
450 Commerce Blvd.
Oldsmar, FL 34677-2808
Phone: (813) 855-0022; (800) 886-0022
Fax: (813) 854-5098

United Radio, Inc. Automotive Div.
5705 Enterprise Parkway
East Syracuse, NY 13057
Phone: (800) 448-0944; (800) 448-0944
Fax: (315) 446-2434

Veltronix Inc.
1151 South Service Road West, Units 5&6
Oakville, Ontario L6L 6K4
Phone: (905) 469-0586
Fax: (905) 469-0925

Zarb Electronics
1750 California, Suite 117
Corona, CA 91719
Phone: (909) 279-0485; (800) 834-8802
Fax: (929) 371-4080

TB-6931-A

Figure 4 - Article 02-25-2