• NOISE—GEAR “WHINE” HEARD IN PASSENGER COMPARTMENT • TRANSAXLE—GEAR “WHINE” NOISE HEARD IN PASSENGER COMPARTMENT	Article No. 01-5-7

MERCURY: 1999-2001 VILLAGER

This article is being republished in its entirety to update the model years affected.

ISSUE

Some vehicles may exhibit a gear “whine” noise from the front under light acceleration while driving between 40 km/h (25 mph) and 113 km/h (70 mph). This condition may be due to the Automatic Transaxle (A/T) shift cable transmitting normal operational noise from the transaxle into the passenger compartment.

ACTION

Install a 300 gram mass damper on the A/T shift cable to reduce the amount of noise transmitted to the passenger compartment. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Road test the vehicle to confirm a gear whine noise is heard.
2. Install Mass Damper (XF5Z-7L256-AA) on the A/T shift cable so that it is positioned 10mm above the A/T shift cable rubber boot (refer to Figures 1 and 2).
3. Road test the vehicle to confirm the gear whine noise is resolved.

PART NUMBER	PART NAME
XF5Z-7L256-AA	Mass Damper

OTHER APPLICABLE ARTICLES: NONE
SUPERSEDES: 00-23-3
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
010507A	Install Mass Damper On Automatic Transmission Shift Cable	0.6 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
7E395	42

OASIS CODES: 597997, 702000, 702100, 702300

Copyright © 2001 Ford Motor Company

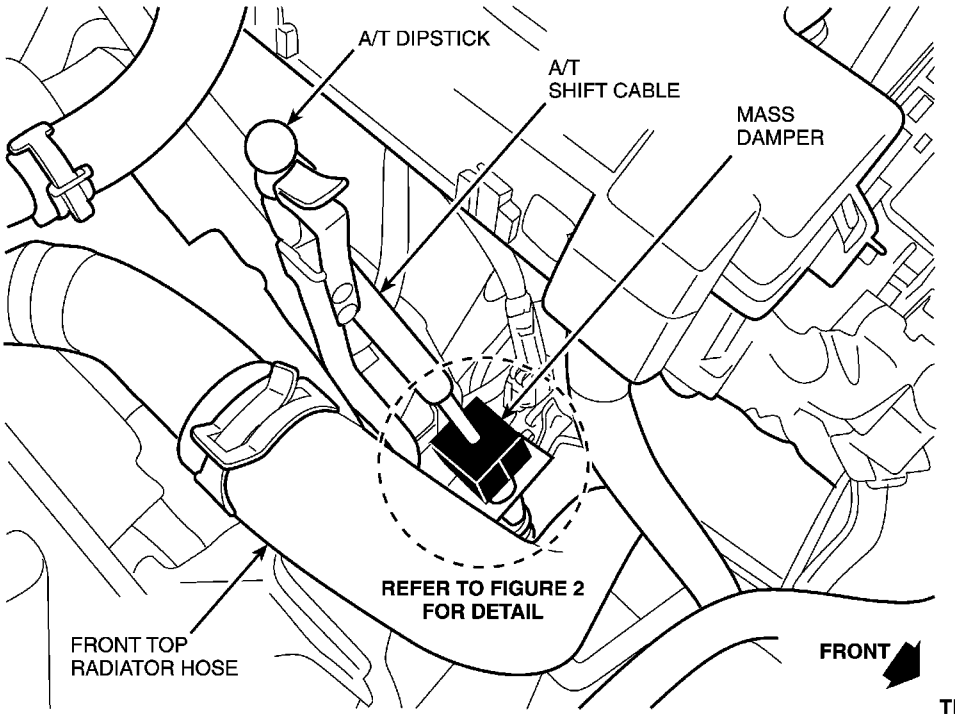

Figure 1 - Article 01-5-7

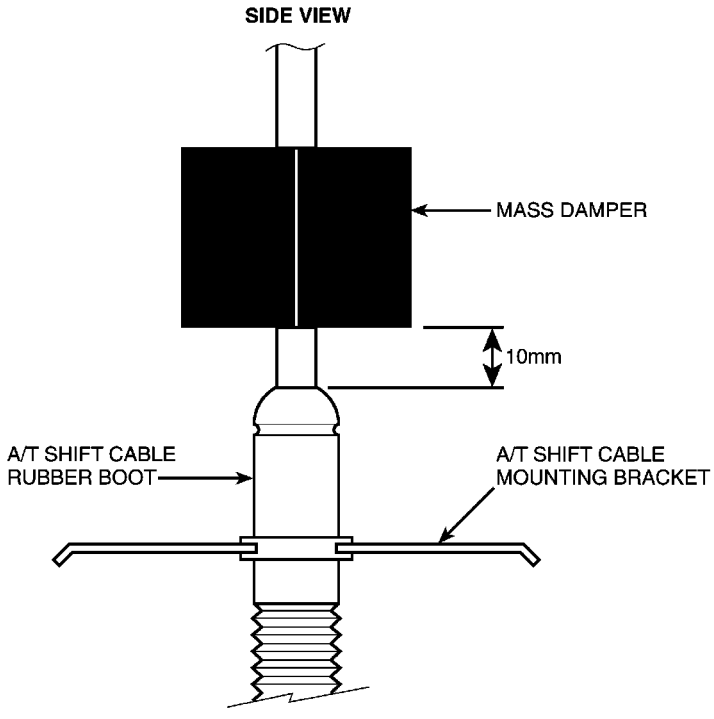

Figure 2 - Article 01-5-7