POWERTRAIN CONTROL MODULE (PCM) REPROGRAM

AFFECTED VEHICLES: **CERTAIN 2002 MODEL YEAR F-SUPER DUTY, EXCURSION AND E-SERIES**

SERVICE PROCEDURE

1. **NOTE: If you determine that the existing PCM calibration is already at the *new* level (or later) according to the chart, no reprogramming is necessary.**

   Identify the existing PCM calibration, then reprogram the PCM to the ***new*** calibration found in the applicable chart below. Use one (1) of the following two (2) methods:

   - Worldwide Diagnostic System (WDS), with the software level indicated in the chart.
   - New Generation STAR (NGS) Tester with Rotunda Flash Cable (007-00531) and Rotunda Flash Card (007-00532). The calibration must be downloaded to a flash card using WDS with the software level indicated in the chart.

2002 MODEL YEAR PCM REPROGRAM CHARTS

EXCURSION

Engine	Existing PCM Calibration	Existing PCM Part No.	Existing Catch word	NEW PCM Calibration	NEW PCM Part No.	Catch word	Current Fordstar/PTS Version or Newer	Current CD WDS Version or Newer
5.4L	2L114D0B06	2C7A-AC	AWX2	2L114D0B11	2C7A-AE	AWX4	B18.7	B19
5.4L	2L114D0B10	2C7A-AD	AWX3	2L114D0B11	2C7A-AE	AWX4	B18.7	B19
6.8L	2L118D0B05	2C7A-DB	DPW1	2L118D0B11	2C7A-DD	DPW3	B18.7	B19
6.8L	2L118D0B10	2C7A-DC	DPW2	2L118D0B11	2C7A-DD	DPW3	B18.7	B19

E-SERIES

Engine	Existing PCM Calibration	Existing PCM Part No.	Existing Catch word	NEW PCM Calibration	NEW PCM Part No.	Catch word	Current Fordstar/PTS Version or Newer	Current CD WDS Version or Newer
5.4L	2E414X0505	2C2A-TB	TYJ1	2E414X0505	2U7A-BDA	DDN0	B18.12*	B20
5.4L	2E414X0515	2C2A-AJA	WZB0	2E414X0516	2C2A-AJB	WZB1	B18.7	B19
5.4L	2E414R0B06	2C2A-RC	RIT2	2E414R0B06	2U7A-BBA	BOS0	B18.12*	B20
5.4L	2E414R0B15	2C2A-AMA	TVQ0	2E414R0B16	2C2A-AMB	TVQ1	B18.7	B19
5.4L	2E414U0B05	2C2A-SB	SFD1	2E414U0B05	2U7A-BCA	CJA0	B18.12*	B20
5.4L	2E414U0B15	2C2A-ANA	QQM0	2E414U0B16	2C2A-ANB	QQM1	B18.7	B19
6.8L	2E418H0B05	2C2A-AAB	ABV1	2E418H0B11	2C2A-AAD	ABV3	B18.7	B19
6.8L	2E418H0B10	2C2A-AAC	ABV2	2E418H0B11	2C2A-AAD	ABV3	B18.7	B19
6.8L	2E418Q0B06	2C2A-ADC	DSV2	2E418Q0B11	2C2A-ADE	DSV4	B18.7	B19
6.8L	2E418Q0B10	2C2A-ADD	DSV3	2E418Q0B11	2C2A-ADE	DSV4	B18.7	B19
6.8L	2E418R0B05	2C2A-AEB	ENL1	2E418R0B11	2C2A-AED	ENL3	B18.7	B19
6.8L	2E418R0B10	2C2A-AEC	ENL2	2E418R0B11	2C2A-AED	ENL3	B18.7	B19

* This version will be available on CD version B20 due out July 1, 2002. Until then, calibration is available via Fordstar download or www.wdscentral.com.

Ford Motor Company

CPR © 2002 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
05/02

2002 MODEL YEAR PCM REPROGRAM CHARTS

F-SUPER DUTY

Engine	Existing PCM Calibration	Existing PCM Part No.	Existing Catch word	NEW PCM Calibration	NEW PCM Part No.	Catch word	Current Fordstar/PTS Version or Newer	Current CD WDS Version or Newer
5.4L	2F714D0B05	2C4A-AB	AJM1	2F714D0B11	2C4A-AD	AJM3	B18.7	B19
5.4L	2F714D0B10	2C4A-AC	AJM2	2F714D0B11	2C4A-AD	AJM3	B18.7	B19
5.4L	2F714E0B05	2C4A-AGB	IGC1	2F714E0B11	2C4A-AGD	IGC3	B18.7	B19
5.4L	2F714E0B10	2C4A-AGC	IGC2	2F714E0B11	2C4A-AGD	IGC3	B18.7	B19
5.4L	2F714F0B05	2C4A-AHB	QOA1	2F714F0B05	2U7A-ATA	TBD0	B18.12*	B20
5.4L	2F714F0B15	2C3A-JA	JCV0	2F714F0B16	2C3A-JB	JCV1	B18.7	B19
5.4L	2F714G0B05	2C4A-AJB	SGF1	2F714G0B05	2U7A-AUA	UAB0	B18.12*	B20
5.4L	2F714G0B15	2C3A-HA	HXR0	2F714G0B16	2C3A-HB	HXR1	B18.7	B19
5.4L	2F714N0B05	2C4A-CB	CFY1	2F714N0B05	2U7A-AVA	VDK0	B18.12*	B20
5.4L	2F714N0B15	2C3A-KA	KNU0	2F714N0B16	2C3A-KB	KNU1	B18.7	B19
6.8L	2F717C0B05	2C4A-FB	FSW1	2F717C0B11	2C4A-FD	FSW3	B18.7	B19
6.8L	2F717C0B10	2C4A-FC	FSW2	2F717C0B11	2C4A-FD	FSW3	B18.7	B19
6.8L	2F717D0B05	2C4A-AMB	ABO1	2F717D0B11	2C4A-AMD	ABO3	B18.7	B19
6.8L	2F717D0B10	2C4A-AMC	ABO2	2F717D0B11	2C4A-AMD	ABO3	B18.7	B19
6.8L	2F717M0B05	2C4A-AKB	LRO1	2F717M0B11	2C4A-AKD	LRO3	B18.7	B19
6.8L	2F717M0B10	2C4A-AKC	LRO2	2F717M0B11	2C4A-AKD	LRO3	B18.7	B19
6.8L	2F717R0B05	2C4A-NB	NEB1	2F717R0B11	2C4A-ND	NEB3	B18.7	B19
6.8L	2F717R0B10	2C4A-NC	NEB2	2F717R0B11	2C4A-ND	NEB3	B18.7	B19
6.8L	2F717S0B05	2C4A-ALB	YKE1	2F717S0B11	2C4A-ALD	YKE3	B18.7	B19
6.8L	2F717S0B10	2C4A-ALC	YKE2	2F717S0B11	2C4A-ALD	YKE3	B18.7	B19
6.8L	2F717T0B05	2C4A-PB	PXQ1	2F717T0B11	2C4A-PD	PXQ3	B18.7	B19
6.8L	2F717T0B10	2C4A-PC	PXQ2	2F717T0B11	2C4A-PD	PXQ3	B18.7	B19
6.8L	2F718C0B06	2C4A-WC	WGF2	2F718C0B11	2C4A-WE	WGF4	B18.7	B19
6.8L	2F718C0B10	2C4A-WD	WGF3	2F718C0B11	2C4A-WE	WGF4	B18.7	B19
6.8L	2F718D0B05	2C4A-ANB	EBY1	2F718D0B11	2C4A-AND	EBY3	B18.7	B19
6.8L	2F718D0B10	2C4A-ANC	EBY2	2F718D0B11	2C4A-AND	EBY3	B18.7	B19
6.8L	2F718M0B05	2C4A-APB	QBL1	2F718M0B11	2C4A-APD	QBL3	B18.7	B19
6.8L	2F718M0B10	2C4A-APC	QBL2	2F718M0B11	2C4A-APD	QBL3	B18.7	B19
6.8L	2F718R0B06	2C4A-AAC	AFC2	2F718R0B11	2C4A-AAE	AFC4	B18.7	B19
6.8L	2F718R0B10	2C4A-AAD	AFC3	2F718R0B11	2C4A-AAE	AFC4	B18.7	B19
6.8L	2F718S0B05	2C4A-ARB	CZU1	2F718S0B11	2C4A-ARD	CZU3	B18.7	B19
6.8L	2F718S0B10	2C4A-ARC	CZU2	2F718S0B11	2C4A-ARD	CZU3	B18.7	B19
6.8L	2F718T0B05	2C4A-ABB	BHA1	2F718T0B11	2C4A-ABD	BHA3	B18.7	B19
6.8L	2F718T0B10	2C4A-ABC	BHA2	2F718T0B11	2C4A-ABD	BHA3	B18.7	B19
6.8L	2F728A0B05	2C4A-ACB	CYK1	2F728A0B11	2C4A-ACD	CYK3	B18.7	B19
6.8L	2F728A0B10	2C4A-ACC	CYK2	2F728A0B11	2C4A-ACD	CYK3	B18.7	B19
6.8L	2F728B0B05	2C4A-ASB	SZH1	2F728B0B11	2C4A-ASD	SZH3	B18.7	B19
6.8L	2F728B0B10	2C4A-ASC	SZH2	2F728B0B11	2C4A-ASD	SZH3	B18.7	B19

* This version will be available on CD version B20 due out July 1, 2002. Until then, calibration is available via Fordstar download or www.wdscentral.com.

Ford Motor Company

CPR © 2002 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
05/02

PREPARE AUTHORIZED MODIFICATIONS LABEL

1. Obtain and prepare the Authorized Modifications label. Write the modification completed, your P&A code, date of repair and the recall program number in the spaces provided on the label. See Figure 1.

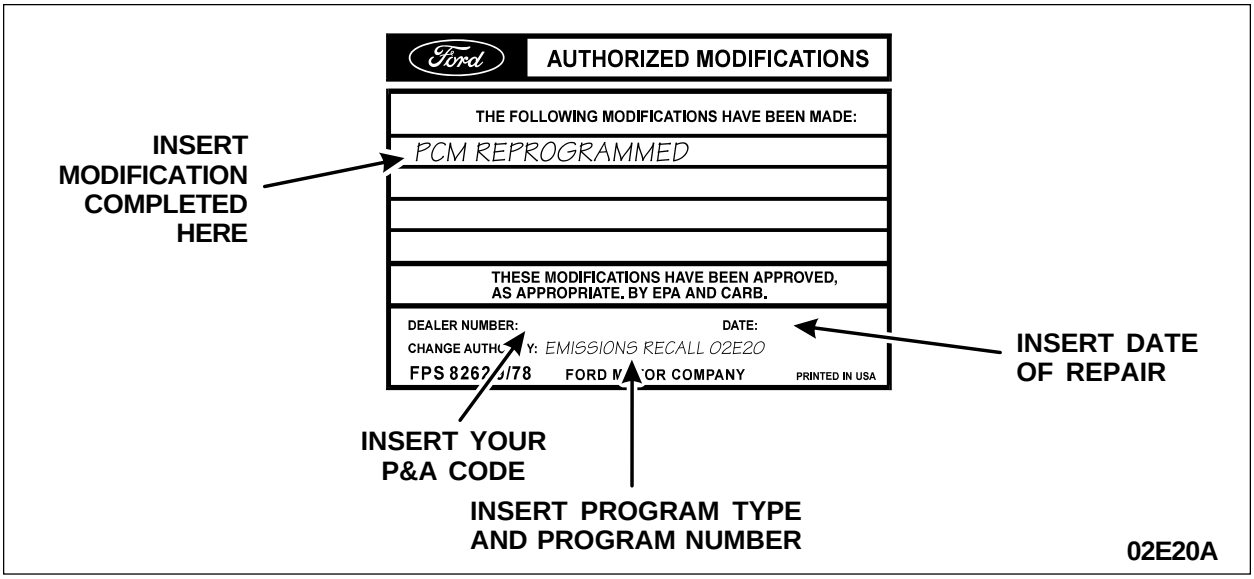


FIGURE 1

2. Open the hood and clean an area on the radiator support with isopropyl alcohol and a clean cloth.
3. Apply the label to the clean area.
4. Provide California owners with a completed Vehicle Emissions Recall–Proof of Correction certificate. See Figure 2.

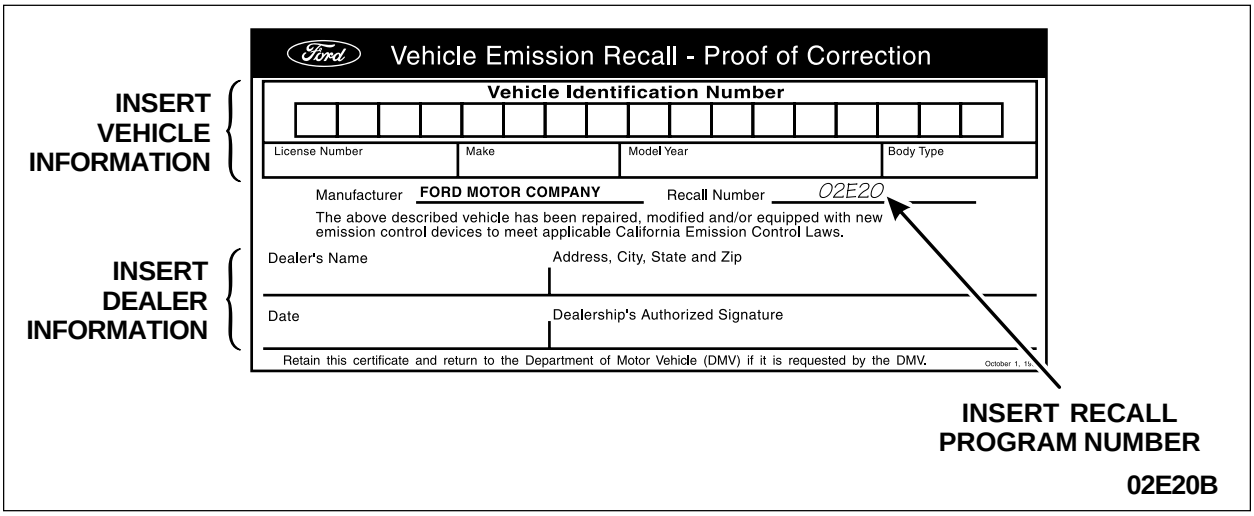


FIGURE 2

Ford Motor Company
CPR © 2002 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
05/02