DRIVEABILITY—BI-FUEL—REDUCED ENGINE POWER, RPM DIP OR IDLE SURGE GREATER THAN 200 RPM IMMEDIATELY FOLLOWING TIP-IN FROM A STOP—OPERATING IN ALTERNATIVE FUEL MODE—VEHICLES EQUIPPED WITH 5.4L BI-FUEL ENGINE ONLY

Article No. 01-24-3

FORD: 2000-2001 F-150

This article is being republished in its entirety to update the Calibration Information Chart.

ISSUE

Some Bi-Fuel equipped vehicles may exhibit reduced engine power, RPM dip or idle surge greater than 200 RPM immediately following tip-in, from a stopped position, using less than 1/4 throttle application, while operating on alternative fuel mode only. This may be caused by the calibration of the Powertrain Control Module (PCM).


ACTION

Verify the condition. If normal diagnostics cannot pinpoint the condition, reprogram the PCM to the latest level calibration. Refer to the following PCM Calibration Information chart for details.

SERVICE INFORMATION

PCM CALIBRATION INFORMATION						
Application	**Old Part Number (-12A650-)**	**Tear Tag**	**New Part Number (-12A650-)**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
2000 F150 3.55 Axle Ratio	YL3F-ARA	PMZ1	YU7A-AVB	0F51410B00	0F51410B00	WDS Release B16.2 or Later
2001 F150 3.55 Axle Ratio	1L3A-BAB	KVE2	1L3A-BAD	1F51410B10	1F51410B10	WDS Release B16.2 or Later
2001 F150 3.55 Axle Ratio	1L3A-BAC	KVE2	1L3A-BAD	1F51410B11	1F51410B11	WDS Release B16.2 or Later
2001 F150 3.73 Axle Ratio	1L3A-BBB	PQJ2	1L3A-BBD	1F51420B10	1F51420B10	WDS Release B16.2 or Later
2001 F150 3.73 Axle Ratio	1L3A-BBC	PQJ2	1L3A-BBD	1F51420B11	1F51420B11	WDS Release B16.2 or Later

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

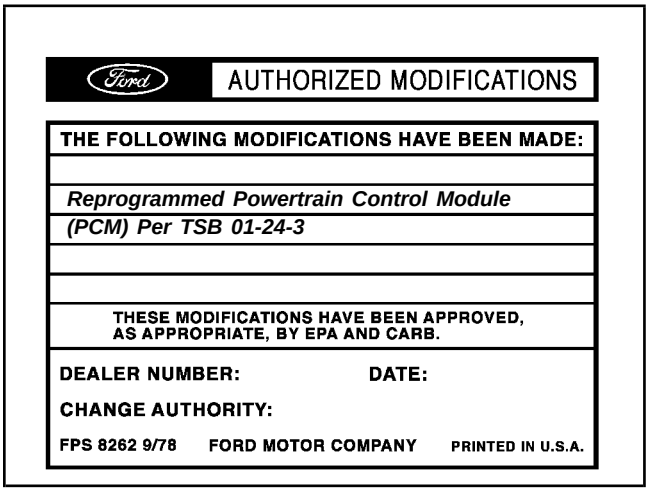

Copyright © 2001 Ford Motor Company

OTHER APPLICABLE ARTICLES: 00-06-11
SUPERSEDES: 01-15-3
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 607000, 607400, 607500, 617400, 618400, 619400