Ford Motor Company

A. R. O'Neill
Director
Vehicle Service and Programs
48121
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan

January 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Owner Notification Program 00B60: All 1998 through 2000 Model Year Crown Victoria Police Interceptor, Taxi Cab, Natural Gas Vehicles (NGV), and Lincoln Town Car Limousine Prep Package Vehicles – Rear Upper Control Arm Bracket Reinforcement

Note: Owner Notification Program 00B60 also affects most of the vehicles affected by 99B09-S1. Both programs should be completed at the same time, if applicable. Check OASIS.

OASIS : Yes
OWNER LIST: Yes
PARTS RETURN: No
PROGRAM TERMS: This program will be in effect until January 31, 2002, regardless of mileage.

AFFECTED VEHICLES

All 1998 through 2000 model year Crown Victoria Police Interceptor, Taxi Cab, Natural Gas Vehicles (NGV) built at the St. Thomas Assembly Plant, and Lincoln Town Car Limousine Prep Package vehicles built at the Wixom Assembly Plant.

REASON FOR PROGRAM

In some of the affected vehicles the rear suspension upper control arm brackets on the frame may develop minor cracks when subjected to severe duty service. In rare cases the cracks may allow one or both of the upper control arm brackets to separate from the frame. This could allow a noticeable "clunking" type noise from the rear suspension, or in extreme cases, a noticeable "loose feeling" could eventually develop in the rear suspension.

SERVICE ACTION

The rear upper control arm brackets will be inspected for cracks. If cracking is present, the cracks will be repaired and the reinforcing brackets will be installed. For units with no visible signs of cracking, the reinforcing brackets will be installed.

ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Customer Notification Letter

QUESTIONS?

Claims Information: 1-800-423-8851
Other Program Questions: 1-800-325-5621

Sincerely,

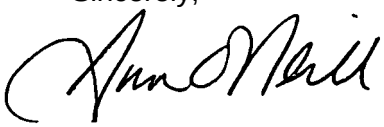

Ann O'Neill
Director
Vehicle Service and Programs

Owner Notification Program 00B60

All 1998 through 2000 Model Year Crown Victoria Police Interceptor, Taxi Cab, Natural Gas Vehicles (NGV), Lincoln Town Car Limousine Prep Package Vehicles – Rear Upper Control Arm Bracket Reinforcement

OASIS

You must use OASIS to determine if a vehicle is eligible for this program.

PROMPTLY CORRECT

Promptly correct all affected vehicles on your dealer VIN list which you will receive in the Ford Dealer Consolidated Communicator (FDCC). Also, correct other eligible vehicles brought to your dealership.

DEALER-OWNER CONTACT

Promptly correct all affected vehicles on the enclosed list and other eligible vehicles brought to your dealership. Immediately contact any affected owner whose name is not on the list. Give the owner a copy of the Owner Letter and schedule a service date.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

RENTAL CARS

Rental vehicle coverage is not included under this program.

Owner Notification Program 00B60

All 1998 through 2000 Model Year Crown Victoria Police Interceptor, Taxi Cab, Natural Gas Vehicles (NGV), Lincoln Town Car Limousine Prep Package Vehicles – Rear Upper Control Arm Bracket Reinforcement

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Perform reinforcement bracket installation:	00B60B	1.1 Hours
Perform crack repair and coach weld placement, reinforcement bracket installation:	00B60C	2.2 Hours

PARTS REQUIREMENTS

Parts Ordering Information

Parts will not be direct shipped for this program. Order your parts requirement through normal order processing channels as noted below:

Stock Orders	Effective immediately	Normal order process
Interim Orders	Effective immediately	Normal order process
Emergency Orders	First 30 days after launch	Call 1-800-325-5621
Emergency Orders	31 days after launch	Normal order process

Part Number	Description	Quantity
1W7Z-5L005-AA	Frame Reinforcing Kit (will cover both sides)	1

DOR/COR NUMBER

DOR/COR Number 50213 identifies parts ordered for this campaign through the Recall Hotline (1-800-325-5621).

DEALER PRICE

For latest prices, refer to

- DOES II
- Updated Price Book

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121
1-800-392-3673
www.ownerconnection.com

January 2001

00B60

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

Ford Motor Company is providing a no-charge Service Program, Number 00B60, to owners of certain 1998-2000 Ford Crown Victoria Police Interceptor, Taxi Cab, and Natural Gas Vehicles (NGV) built at the St. Thomas Assembly Plant and Lincoln Town Car Limousine Prep Package Vehicles built at the Wixom Assembly Plant.

Reason For This Program...

In some of the affected vehicles the rear suspension upper control arm brackets on the frame may develop minor cracks when subjected to severe duty service. In rare cases the cracks may allow one or both of the upper control arm brackets to separate from the frame. This could allow a noticeable "clunking" type noise from the rear suspension, or in extreme cases, a noticeable "loose feeling" could eventually develop in the rear suspension.

What *Ford Motor Company* and your dealer will do…

Ford Motor Company will repair your vehicle free of charge (parts and labor). Owners who are affected by this recall are requested to return their vehicle to their dealer for frame inspection and repair, including the installation of reinforcing brackets.

This program will be in effect until January 31, 2002, regardless of mileage.

What we are asking you to do…

Call your dealer without delay. Provide the dealer with your Vehicle Identification Number (located at the beginning of this letter). Ask for a service date and whether parts are in stock for Owner Notification Program 00B60.

If your dealer does not have the parts in stock, they can be ordered before scheduling your service date. Parts would be expected to arrive within a week after ordering.

How long will it take…

The time needed for this repair is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time. Please call your dealer for a service date.

When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.

Refund…

If you paid to have this service done before the date of this letter, Ford Motor Company is offering a full refund. For the refund, please give your paid original receipt to your dealer. To avoid delays, do not send receipts to Ford Motor Company.

If you've changed address or sold the vehicle…

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you have concerns…

If you have trouble getting your vehicle repaired promptly and without charge, please contact your dealership Service Manager. If you still need assistance, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

CALL: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: (Eastern Standard Time)
Monday-Friday: 8am - 11pm
Saturday: 9am - 6pm

or you may contact us through the Internet at:
www.ownerconnection.com

Our current response time to Internet inquiries is three business days.

Quality Care service is there for you all year round.

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Thank you for your attention to this important matter.

Sincerely,

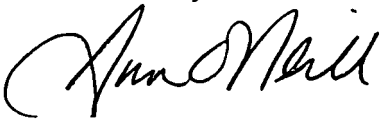

Ann O'Neill
Director
Vehicle Service and Programs