Ford Motor Company

March 2001

TO: All Ford Dealers

SUBJECT: DEMONSTRATION / DELIVERY HOLD: Safety Recall 01S12 - Certain 2001 Model Year F350 Crew Cab DRW 156 " WB equipped with 6 3/4 ft Box - Fuel Filler Pipe Ground

AFFECTED VEHICLES

Certain 2001 Model Year F350 Crew Cab DRW 156" WB vehicles equipped with 6 3/4 ft box, built at the Kentucky Truck Plant from January 2, 2001 through March 12, 2001.
(There are 234 vehicles affected by this program).

SAFETY CONCERN

The fuel filler pipe on the affected vehicles may not be properly grounded. If the vehicle is fueled from an ungrounded fuel hose, or an ungrounded fuel can, a static build-up may occur. This could result in an electrostatic discharge and potentially, a fire.

SERVICE ACTION

Before demonstrating or delivering any of the vehicles involved in this recall, the dealer must install a ground on the fuel filler pipe. This must be done on all of the affected vehicles.

PLEASE NOTE

Correct all vehicles in stock before delivery. Federal law requires dealers to complete any outstanding safety recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to $5,000 per vehicle.


ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Customer Notification Letter

QUESTIONS?

Claims Information:……..……....1-800-423-8851
Other (Dealer Only) Recall Questions:……..……...1-800-325-5621

Sincerely,

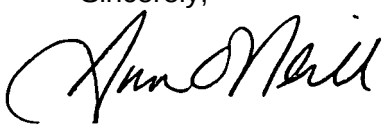

Ann O'Neill
Director
Vehicle Service and Programs

DEMONSTRATION / DELIVERY HOLD: Safety Recall 01S12
Certain 2001 F350 Crew Cab DRW 156" WB equipped with 6 3/4 ft Box
Fuel Filler Pipe Ground

OASIS

You must use OASIS to determine if a vehicle is eligible for this recall.

PROMPTLY CORRECT

Promptly correct all affected vehicles on your dealer Recall/ONP Involved Unit Listings available on QCDealer.com or in the Ford Dealer Consolidated Communicator (FDCC). Also, correct other eligible vehicles which are brought to your dealership.

DEALER-OWNER CONTACT

Immediately contact any affected owner whose name is not on the list. Give the owner a copy of the Owner Letter and schedule a service date.

REGIONAL CONTACT

Advise regional office if an owner:

- cannot be contacted.
- Does not make a service date.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

DEMONSTRATION / DELIVERY HOLD: Safety Recall 01S12
Certain 2001 F350 Crew Cab DRW 156" WB equipped with 6 3/4 ft Box
Fuel Filler Pipe Ground

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Install Filler Pipe Clamp	01S12B	0.3 Hour
Install Fuel Filler Pipe Ground Strap	01S12C	0.4 Hour
Administrative Allowance	Misc. Expense Code "ADMIN"	0.1 Hour

Most vehicles will ONLY require the Filler Pipe clamp. The remaining vehicles ONLY will require the ground strap. No vehicle will require both.

PARTS REQUIREMENTS

Parts Ordering Information

Parts will not be direct shipped for this recall.

This program involves only 234 total vehicles. Please confirm vin list involvement prior to ordering parts, then order through normal order processing channels as noted below:

Stock Orders	Effective immediately	Normal order process
Interim Orders	Effective immediately	Normal order process
Emergency Orders	First 30 days after launch	CALL 1-800-325-5621
Emergency Orders	31 days after launch	Normal order process

DEMONSTRATION / DELIVERY HOLD: Safety Recall 01S12
Certain 2001 F350 Crew Cab DRW 156" WB equipped with 6 3/4 ft Box
Fuel Filler Pipe Ground

Part Number	Description	Quantity
F2UZ-19A095-A	Ground Strap, unit of issue = 1	1
N806738-S301	M8 Bolt/washer bolt, unit of issue = 1	1
N811658-S301	J-Nut M8X 1.25 U P/T, unit of issue = 1	1
383525-S	Hose Clamp, unit of issue = 4	1

DEALER PRICE

For latest prices, refer to:

- DOES II
- Updated Price Book

DOR/COR NUMBER

DOR/COR number 50228 identifies parts ordered for this campaign through the Recall Hotline (1-800-325-5621).

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

March 2001

01S12

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Ford Motor Company has decided that a defect which relates to motor vehicle safety exists in certain 2001 F350 Crew Cab Dual Rear Wheel 156 inch Wheelbase vehicles, equipped with 6 3/4 ft Box.

What the safety issue is …	The pickup box may not have been properly grounded. Without proper grounding, an electrostatic discharge could result during fuel fill up – potentially leading to a fire.
What Ford Motor Company and your dealer will do ...	Ford Motor Company will repair your vehicle free of charge (parts and labor). Owners who are affected by this recall are requested to return their vehicle to their dealer for installation of a ground on the filler pipe.
How long will it take?	The time needed for this repair is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time.
What we are asking you to do …	Call your dealer without delay. Ask for a service date and have the Dealer order parts for Safety Recall 01S12. Parts would be expected to arrive within a week after ordering. When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.
If you've already paid for this service …	If you paid to have this service done before the date of this letter, Ford is offering a full refund. For the refund, please give your paid original receipt to your dealer. To avoid delays, do not send receipts to Ford Motor Company.

If you've changed address or sold the vehicle …

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you have Concerns …

If you have trouble getting your vehicle repaired promptly and without charge, please contact your dealership's Service Manager. If you still need assistance, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

CALL: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: (Eastern Standard Time)

Monday-Friday: 8am - 11pm
Saturday: 9am - 6pm

or you may contact us through the Internet at:
www.ownerconnection.com
Our current response time to Internet inquiries is three business days.

You also may send a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, S. W., Washington, D. C. 20590 or call the toll free Auto Safety Hotline 1-888-327-4236 or 1-800-424-9393.

Quality Care service is there for you all year round.

QualityCare™ at your service

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading Consumer Company for automotive products and services. Thank you for your attention to this important matter.

Sincerely,



Ann O'Neill
Director
Vehicle Service and Programs