TRIM—WEAR OR HOLE IN SEAT BACK COVER AT LOWER LEFT AREA OF SEAT BACK	Article No. 02-9-10

FORD: 1999-2000 WINDSTAR

ISSUE

Some Vehicles built between August 1998 and January 2000 may exhibit a small hole or wear mark in the driver's side seat back cover, near the lower left area of the seat, on the seat back. This may be caused by a protruding area of the seat frame.

ACTION

Inspect seat back cover for tears or wear marks. Install protective strip on seat frame and replace seat back cover. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Inspect the side of the lower seat backrest closest to the drivers door (Figure 1). If there are signs of wear in the lower left corner of the seat back cover, or a hole in the seat back cover, proceed to install the protective strip covering and replace the seat back cover.
2. Remove the seat. Refer to Workshop Manual Section (501-10).
3. Remove the armrest. Refer to Workshop Manual Section (501-10).
4. Remove the two armrest studs.
5. Remove the covers for the front seat back assist handle - two covers.
6. Remove the two seat back assist handle screws.
7. Remove the headrest.
8. Disconnect the J-retainer.
9. Partially remove the seat back cover. (Necessary to gain access to headrest guides).
10. Remove the headrest guides.
11. Remove the seat back cover.
12. Install the protective strip.

NOTE

PROTECTIVE STRIP INSTALLATION MUST BE PERFORMED DURING THE SEAT BACK COVER INSTALLATION (FIGURE 2).

Place the protective strip (2F2Z-16619A82-AA) over the exposed flange on the seat frame by sliding it into place (Figure 2).

INSTALLATION

CAUTION

MAKE SURE THE AIRBAG WIRE HARNESS IS NOT DAMAGED DURING THE FOLLOWING STEPS.

1. Install the seat back cover.
2. Install the headrest guides.
3. Position back the seat back cover.
4. Connect the J-Retainer.
5. Install the headrest.
6. Install the seat back assist handle-two screws.
7. Install the covers for the front seat back assist handle - two covers.
8. Install the armrest studs.
9. Torque the armrest studs.
10. Install the armrest. Refer to Workshop Manual Section (501-10).
11. Install the seat. Refer to Workshop Manual Section (501-10).

PART NUMBER	PART NAME
2F2Z-16619A82-AA	Protective Strip - Seat Frame

Copyright © 2002 Ford Motor Company

Article No. 02-9-10 Cont'd.

OTHER APPLICABLE ARTICLES: NONE


WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
020910A	Install Protective Strip On Seat Frame (Includes Time To Remove Seat, Replace Seat Back Cover Then Reinstall Seat)	0.8 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
1661018	30

OASIS CODES: 101000

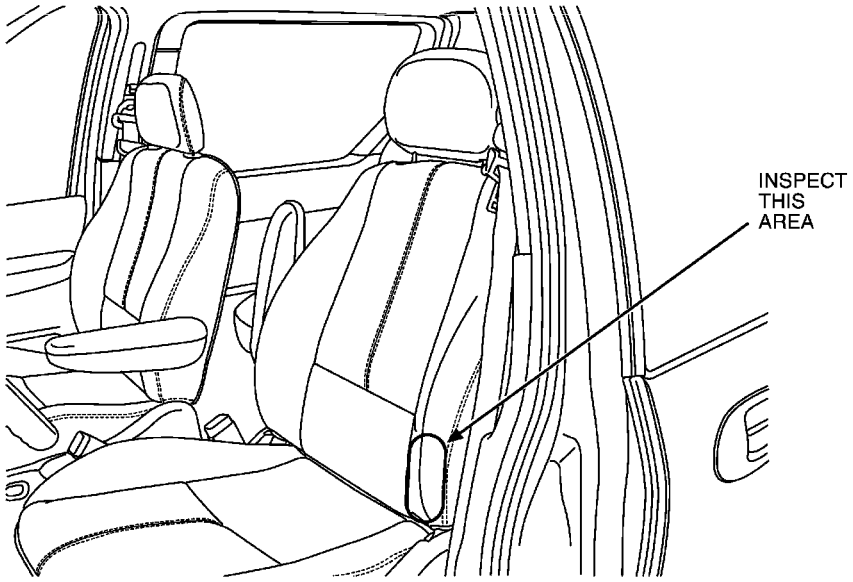

TB-6568-A

Figure 1 - Article 02-9-10

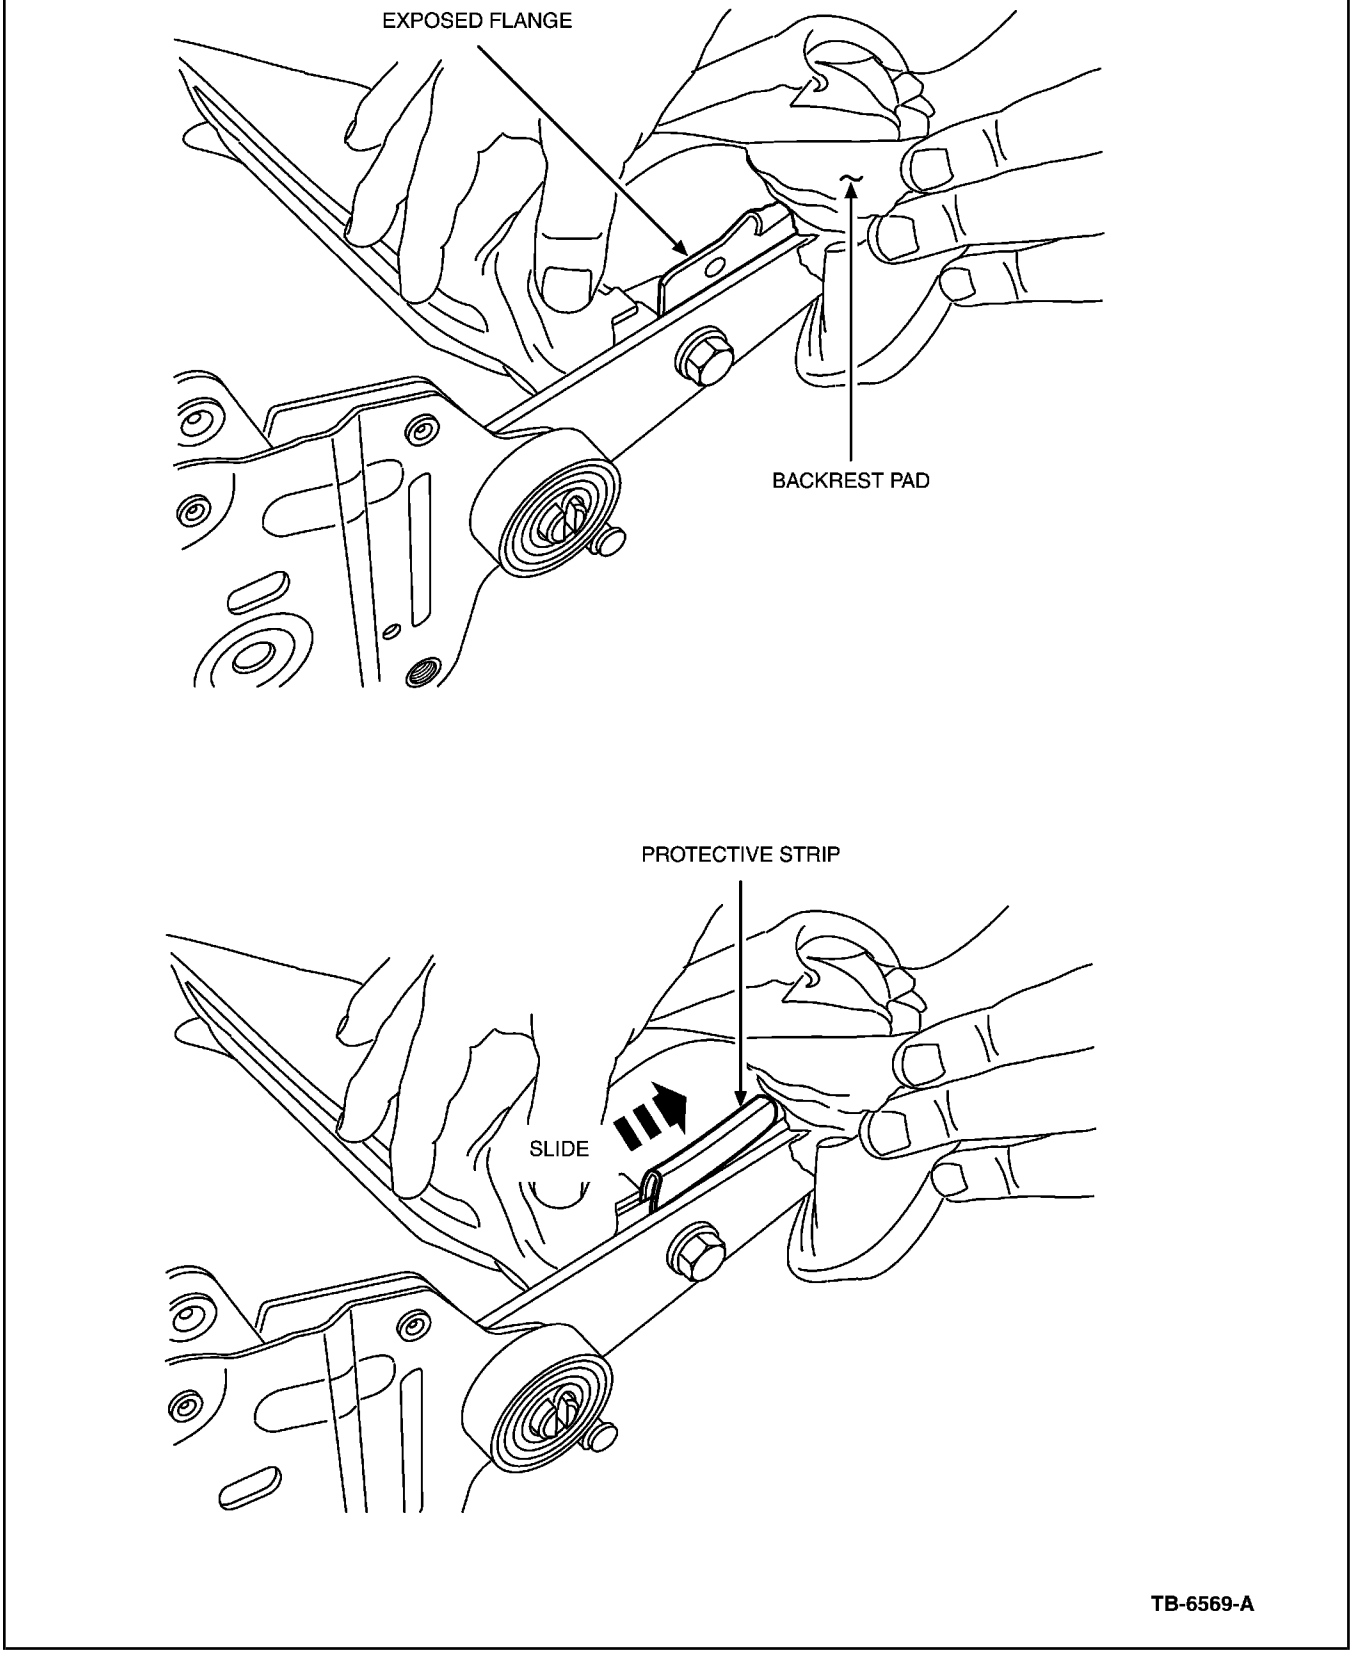


Figure 2 - Article 02-9-10