- **DRIVEABILITY—LACK OF POWER AFTER POWERTRAIN CONTROL MODULE (PCM) REPROGRAMMING—VEHICLES EQUIPPED WITH 3.0L OR 4.0L ENGINE**
- **ENGINE—LACK OF POWER AFTER POWERTRAIN CONTROL MODULE (PCM) REPROGRAMMING—VEHICLES EQUIPPED WITH 3.0L OR 4.0L ENGINE**

Article No. 01-5-1

FORD: 2001 RANGER

ISSUE

Some 2001 3.0L and 4.0L Rangers may exhibit a lack of power IF the Powertrain Control Module (PCM) has been reprogrammed in service. The lack of power may be caused by unintended spark retard.

ACTION

Verify the condition, and if present, reprogram the PCM to the latest level calibration. Refer to the following PCM Calibration Information Chart.

PCM CALIBRATION INFORMATION

Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
2001, 4.0L M/T, 4X2, with Regular Cab	1L5F-NB	ETFO	1L5Z-BCA	1R32A40505	1R32A40515	WDS B11_10 Or B12_1 Release
2001, 4.0L M/T, 4X2, with Super Cab	1L5F-PB	AYIO	1L5Z-BEA	1R32B40505	1R32B40515	WDS B11_10 Or B12_1 Release
2001, 4.0L M/T, 4X4, with 3.55 or 4.10 Axle	1L5F-PB	AYIO	1L5Z-BEA	1R32B40505	1R32B40515	WDS B11_10 Or B12_1 Release
2001, 4.0L, M/T, 4X4, with 3.73 Axle	1LFA-AGA	YBK0	1L5Z-BAA	1R32C40500	1R32C40515	WDS B11_10 Or B12_1 Release
2001, 3.0L, M/T	1L5F-JB	ERX2	1L5Z-JC	1R32A30505	1R32A30510	WDS B11_10 Or B12_1 Release
2001, 3.0L, M/T	1L5F-KB	FCC2	1L5Z-KC	1R32B30505	1R32B30510	WDS B11_10 Or B12_1 Release
2001, 3.0L, A/T	1L5F-GB	SRS2	1L5Z-GC	1R31A30505	1R31A30510	WDS B11_10 Or B12_1 Release
2001, 3.0L, A/T	1L5F-HB	JLB2	1L5Z-HC	1R31B30505	1R31B30510	WDS B11_10 Or B12_1 Release

Copyright © 2001 Ford Motor Company

Article No. 01-5-1 Cont'd.

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

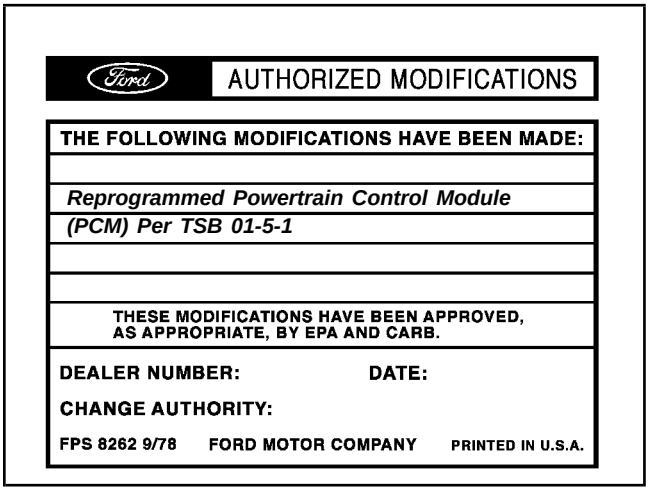

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 614000, 614500, 614600