DRIVEABILITY—HESITATION ON ACCELERATION—DIAGNOSTIC TROUBLE CODES (DTC) CODES P0172 AND P0175—VEHICLES EQUIPPED WITH 4.6L ENGINE AND M5OD 5 SPEED MANUAL TRANSMISSION

Article No. 01-16-1

FORD: 1999 F-250 LD
1999-2000 F-150

ISSUE

Some vehicles equipped with the 4.6L engine and 5 speed manual transmission may exhibit a slight hesitation on light tip-in and a check engine light with Diagnostic Trouble Codes (DTC) codes P0172 and P0175. This may be caused by the calibration of the Powertrain Control Module (PCM).

ACTION

Verify condition. If normal diagnostics cannot pinpoint the condition, reprogram the PCM with the latest level calibration. Refer to the following PCM Calibration Information Chart.


PCM CALIBRATION INFORMATION

Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
1999 F-150 4.6L	XL3F-AAD	PGC0	XU7Z-AHA	AC-FR10	AC-FR10	WDS Release B14.5 or Later
1999 F-150 4.6L	XL3F-ABD	VMP0	XU7Z-AJA	AD-FR10	AD-FR10	WDS Release B14.5 or Later
1999 F-150 4.6L	XL3F-ADD	TMC0	XU7Z-AKA	BC-FR10	BC-FR10	WDS Release B14.5 or Later
1999 F-150 4.6L	XL3F-AED	CTK0	XU7Z-ALA	BD-FR10	BD-FR10	WDS Release B14.5 or Later
1999 F-250 4.6L	XC3F-AHD	WSQ0	XU7Z-ANA	AB-FR10	AB-FR10	WDS Release B14.5 or Later
1999 F-250 4.6L	XC3F-AGD	HLW0	XU7Z-AMA	AA-FR10	AA-FR10	WDS Release B14.5 or Later
1999 F-250 4.6L	XC3F-AJD	CNJ0	XU7Z-APA	BA-FR10	BA-FR10	WDS Release B14.5 or Later
1999 F-250 4.6L	XC3F-AKD	WIR0	XU7Z-ARA	BB-FR10	BB-FR10	WDS Release B14.5 or Later
2000 F-150 4.6L	YU2F-AMA	MYW1	YU2Z-AMB	0F526I0A06	0F526I0A06	WDS Release B14.5 or Later
2000 F-150 4.6L	YU2F-ALA	ILR1	YU2Z-ALB	0F526H0A06	0F526H0A06	WDS Release B14.5 or Later
2000 F-150 4.6L	YL3F-AYB	DOU0	YU7Z-EGA	0F526P0A11	0F526P0A11	WDS Release B14.5 or Later
2000 F-150 4.6L	YL3F-AZB	TGZ0	YU7Z-EHA	0F526Q0A11	0F526Q0A11	WDS Release B14.5 or Later
2000 F-150 4.6L	YL3F-YE	ZKR0	YU7Z-EJA	0F526J0B11	0F526J0B11	WDS Release B14.5 or Later
2000 F-150 4.6L	YL3F-ZE	BOH0	YU7Z-EKA	0F526K0B11	0F526K0B11	WDS Release B14.5 or Later

Copyright © 2001 Ford Motor Company

Article No. 01-16-1 Cont'd.

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

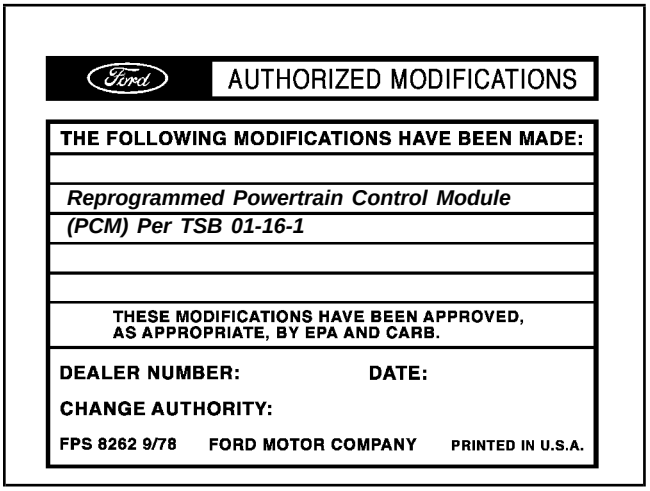

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 611000, 611500, 614000, 614500, 698298