- **LEAK—AUTOMATIC TRANSMISSION FLUID—CD4E TRANSAXLE—FLUID SEEPING FROM VENT, RESULTING IN FLUID COLLECTING ON MAIN CONTROL ASSEMBLY**
- **LEAK—AUTOMATIC TRANSMISSION FLUID—CD4E TRANSAXLE—FROM TRANSAXLE FLUID FILL TUBE**
- **TRANSAXLE—CD4E—TRANSMISSION FLUID LEAKING FROM TRANSAXLE FLUID FILL TUBE**
- **TRANSAXLE—CD4E—TRANSMISSION FLUID SEEPING FROM VENT, RESULTING IN FLUID COLLECTING ON MAIN CONTROL COVER**

Article No. 99-24-9

FORD: 1994-1997 PROBE
1995-2000 CONTOUR

MERCURY: 1995-2000 MYSTIQUE
1999-2000 COUGAR

This TSB article is being republished in its entirety to update the model year coverage, add a concern to the title, and revise the Service Procedure.

ISSUE

Automatic transmission fluid may be seeping from the grommet-style vent assembly and down the main control cover or may be leaking fluid from the fluid fill tube on some vehicles. The appearance of fluid on the main control cover may be misdiagnosed as a leak in the cooler line and/or main control cover gasket.

ACTION

Diagnose leak and repair by referring to the following Service Procedure for details.

NOTE

BEGINNING JANUARY 1997, ALL CD4E TRANSAXLES CONTAIN A REVISED MAIN CONTROL COVER (F7RZ-7G004-AA), FIGURE 1, AND VENT TUBE ASSEMBLY (F7RZ-7034-CA FOR PROBE AND F7RZ-7034-BA FOR CONTOUR/MYSTIQUE), FIGURE 2. THIS NEW DESIGN WILL PREVENT FLUID FROM SEEPING FROM THE VENT. IF THE VENT HOSE IS KINKED OR BLOCKED INTERNALLY, FLUID WILL LEAK FROM THE TRANSAXLE FILL TUBE.

For 1995-1997 Contour/Mystique Vehicles Built With Grommet-Style Vent Assembly Main Control Cover:

NOTE

BEFORE INSTALLING NEW VENT TUBE, PURGE ANY OBSTRUCTION FROM THE HOSE LINE USING LOW PRESSURE AIR SUPPLY. HIGH PRESSURE CAN BLOW PAST ANY OBSTRUCTION WITHOUT EVACUATING THE HOSE. WHEN INSTALLING THE HOSE, FOLLOW THE INSTRUCTION SHEET PROCEDURE WITH THE VENT TUBE KIT, ENSURING THE HOSE IS NOT KINKED.

If fluid is detected on the main control cover near the vent and the area around the grommet is damp, check the transmission fluid level. If the fluid level is **below** the crosshatched area, check for alternate leaks. If the fluid level is **between** the crosshatched area, service with Remote Vent Kit (F6RZ-7034-AA).

If replacement of a main control cover is required, replace with a new Main Control Cover (F7RZ-7G004-AA) and a Vent Tube Assembly (F7RZ-7034-BA).

For 1994-1997 Probe Vehicles:

NOTE
BEFORE INSTALLING NEW VENT TUBE, PURGE ANY OBSTRUCTION FROM THE HOSE LINE USING LOW PRESSURE AIR SUPPLY. HIGH PRESSURE CAN BLOW PAST ANY OBSTRUCTION WITHOUT EVACUATING THE HOSE. WHEN INSTALLING THE HOSE, FOLLOW THE INSTRUCTION SHEET PROCEDURE WITH THE VENT TUBE KIT, ENSURING THE HOSE IS NOT KINKED.

Transaxles built with grommet-style vent assembly main control cover CANNOT be serviced with the new main control cover. If cover replacement is required, service with the grommet-style vent assembly Main Control Cover (F4RZ-7G004-A).

If repairing a vent seeping problem on the grommet-style vent assembly main control cover, use the Remote Vent Kit (F6RZ-7034-BA).

For 1997 Probe, 1998-2000 Contour/Mystique, And 1999-2000 Cougar Vehicles:

NOTE
BEFORE INSTALLING NEW VENT TUBE, PURGE ANY OBSTRUCTION FROM THE HOSE LINE USING LOW PRESSURE AIR SUPPLY. HIGH PRESSURE CAN BLOW PAST ANY OBSTRUCTION WITHOUT EVACUATING THE HOSE. WHEN INSTALLING THE HOSE, FOLLOW THE INSTRUCTION SHEET PROCEDURE WITH THE VENT TUBE KIT, ENSURING THE HOSE IS NOT KINKED.

Vehicles built with the new designed main control cover must use the new Main Control Cover (F7RZ-7G004-AA) and/or new design Vent Tube Assembly (F7RZ-7034-CA for Probe, F7RZ-7034-BA for Contour/Mystique) if replacement is required.

NOTE
FOR PROBE APPLICATIONS ONLY, THE NEW DESIGN MAIN CONTROL COVER AND NEW DESIGN TUBE ASSEMBLY CANNOT BE INSTALLED ON PREVIOUS MODEL VEHICLES DUE TO A REVISED AIR CLEANER DESIGN.

SERVICE PROCEDURE

NOTE
USE THIS SERVICE PROCEDURE IF REPLACEMENT OF THE NEW DESIGN MAIN CONTROL COVER AND/OR NEW DESIGN TUBE ASSEMBLY IS REQUIRED.

NOTE
BEFORE INSTALLING NEW VENT TUBE, PURGE ANY OBSTRUCTION FROM THE HOSE LINE USING LOW PRESSURE AIR SUPPLY. HIGH PRESSURE CAN BLOW PAST ANY OBSTRUCTION WITHOUT EVACUATING THE HOSE. WHEN INSTALLING THE HOSE, FOLLOW THE INSTRUCTION SHEET PROCEDURE WITH THE VENT TUBE KIT, ENSURING THE HOSE IS NOT KINKED.

PROBE

1. Fully seat straight end of tube onto brazed fitting on main control cover. Mount clamp securely onto brazed fitting to secure tube assembly (Figure 3).
2. Route tube assembly toward rear of vehicle.

NOTE
BE SURE 90 DEGREE ELBOW IS FACING DOWNWARD.

3. Install tube assembly on air cleaner housing and align white dot with retaining bracket closest to front of vehicle. Insert 90 degree elbow end of tube assembly into air cleaner clamp. Allow approximately 25mm (1″) of free tube (Figure 4).

CONTOUR/MYSTIQUE, COUGAR

1. Fully seat straight end of tube onto brazed fitting on main control cover. Mount clamp securely onto brazed fitting to secure tube assembly (Figure 3).
2. Route tube assembly upward toward the rear of the battery (Figure 5).
3. Attach clip to battery hold-down bracket bolt (Figure 6).
4. Be sure 90 degree tube end is routed downward (Figure 7).

NOTE
USE SERVICE KITS FOR PREVIOUS DESIGN GROMMET-STYLE VENT ASSEMBLY MAIN CONTROL COVER.

The 1994-1997 2.0L CD4E Probe Remote Vent Kit (F6RZ-7034-BA) consists of the following parts:

- One (1) Vent Tube - 460mm (18.1″)
- One (1) Barbed Vent Body
- One (1) Clamp
- One (1) White Plastic Clip
- One (1) Black Steel Clip
- One (1) Instruction Sheet (I.S. 7142A)

The 1995-1997 Contour/Mystique Remote Vent Kit (F6RZ-7034-AA) consists of the following parts:

- One (1) Vent Tube - 640mm (25.2″)
- One (1) Barbed Vent Body
- One (1) Clamp
- One (1) White Plastic Clip
- One (1) Instruction Sheet (I.S. 7143A)

PART NUMBER	PART NAME
F6RZ-7034-BA	Remote Vent Kit (Probe)
F6RZ-7034-AA	Remote Vent Kit (Contour/Mystique)
F7RZ-7G004-AA	Main Control Cover
F4RZ-7G004-A	Main Control Cover (Probe)
F7RZ-7034-BA	Vent Tube Assembly (Contour/Mystique)
F7RZ-7034-CA	Vent Tube Assembly (Probe)

OTHER APPLICABLE ARTICLES: NONE
SUPERSEDES: 97-5-9
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
992409AB	Additional Time To Replace Main Control Cover, If Required - 1995-1997 Contour/Mystique	1.0 Hr.
992409AC	Additional Time For Vehicles Equipped With A/C - To Be Used Only With Operation AB - 1995-1997 Contour/Mystique	0.2 Hr.
992409A	Install Vent Tube Kit - 1995-1997 Contour/Mystique	0.5 Hr.
992409BB	Additional Time To Replace Main Control Cover, If Required - 1994-1996 Probe	1.2 Hrs.
992409B	Install Vent Tube Kit - 1994-1996 Probe	0.4 Hr.
992409CB	Additional Time To Replace Main Control Cover, If Required - 1997 Probe	1.2 Hrs.
992409C	Install Vent Tube Kit - 1997 Probe	0.3 Hr.
992409DB	Additional Time To Replace Main Control Cover, If Required - 1998-2000 Contour/Mystique	1.0 Hr.
992409DC	Additional Time For Vehicles Equipped With A/C - To Be Used Only With Operation DB - 1998-2000 Contour/Mystique	0.1 Hr.
992409D	Install Vent Tube - 1998-2000 Contour/Mystique	0.4 Hr.
992409EB	Additional Time To Replace Main Control Cover, If Required - 1999-2000 Cougar	1.9 Hrs.
992409EC	Additional Time For Vehicles Equipped With A/C - To Be Used Only With Operation EB - 1999-2000 Cougar	0.1 Hr.
992409E	Install Vent Tube - 1999 Cougar	0.4 Hr.

Article No. 99-24-9 Cont'd.

DEALER CODING

BASIC PART NO.	CONDITION CODE
7034	42

OASIS CODES: 501000, 502000, 503000, 504000, 510000

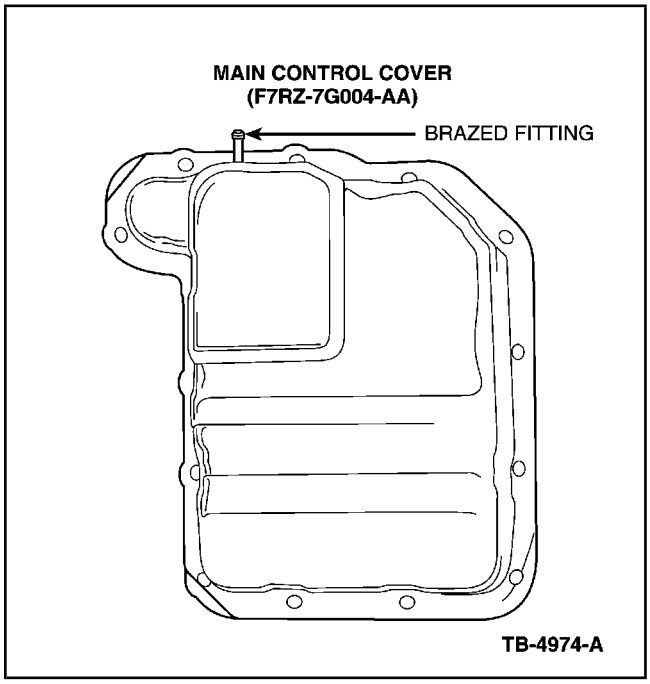


Figure 1 - Article 99-24-9

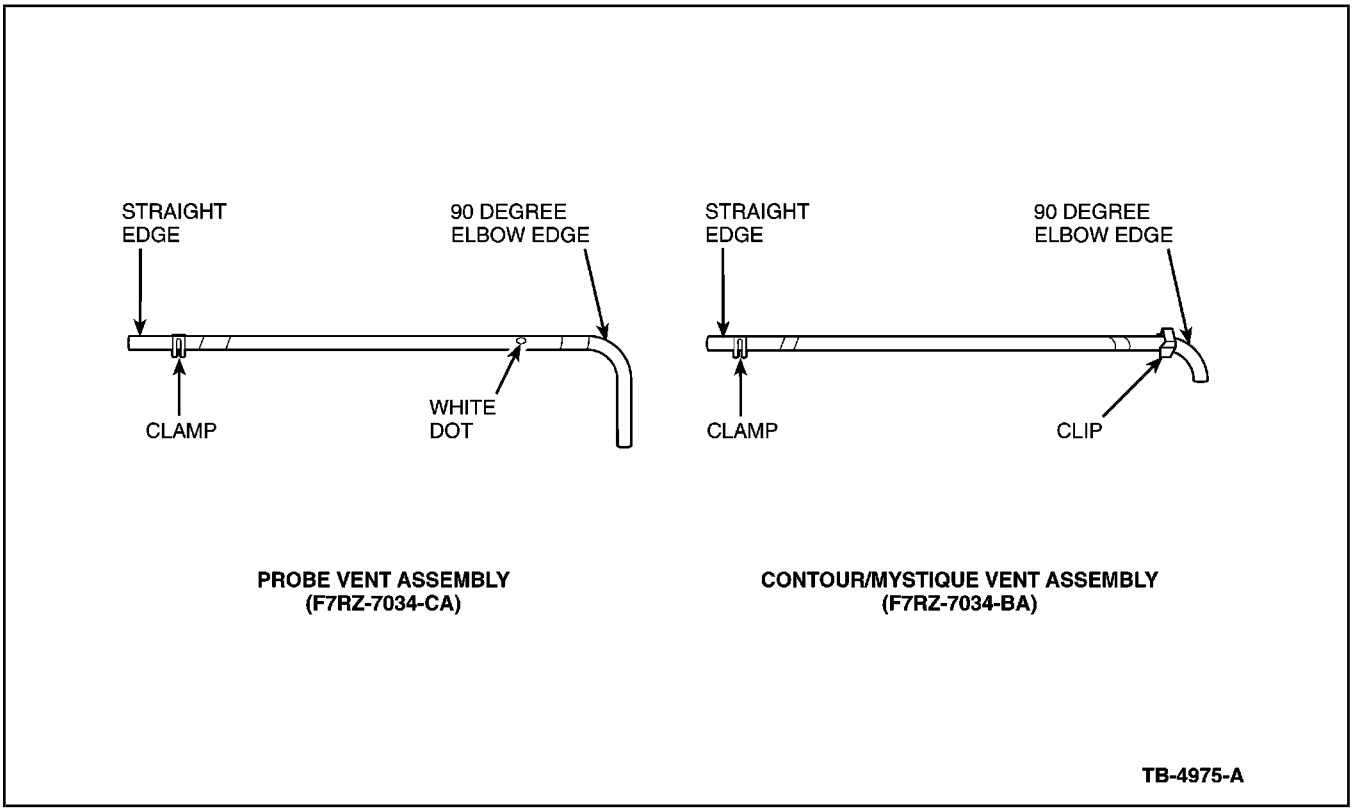


Figure 2 - Article 99-24-9

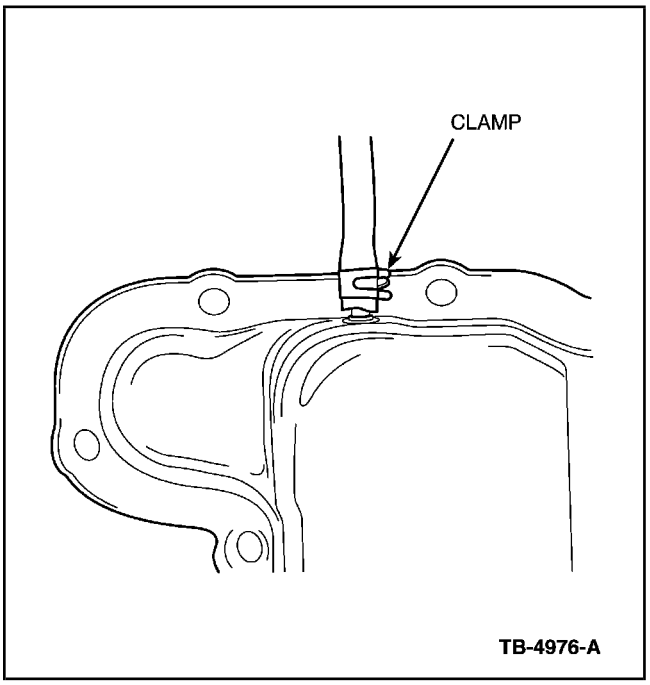


Figure 3 - Article 99-24-9

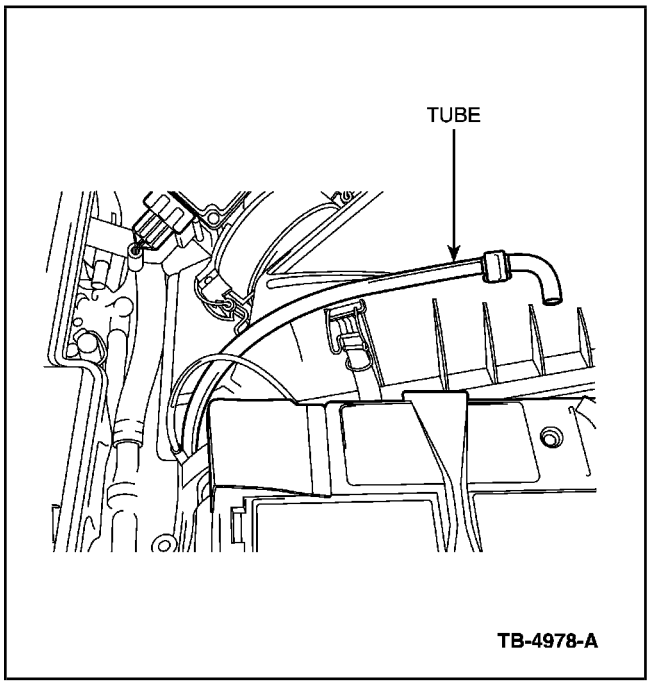


Figure 5 - Article 99-24-9

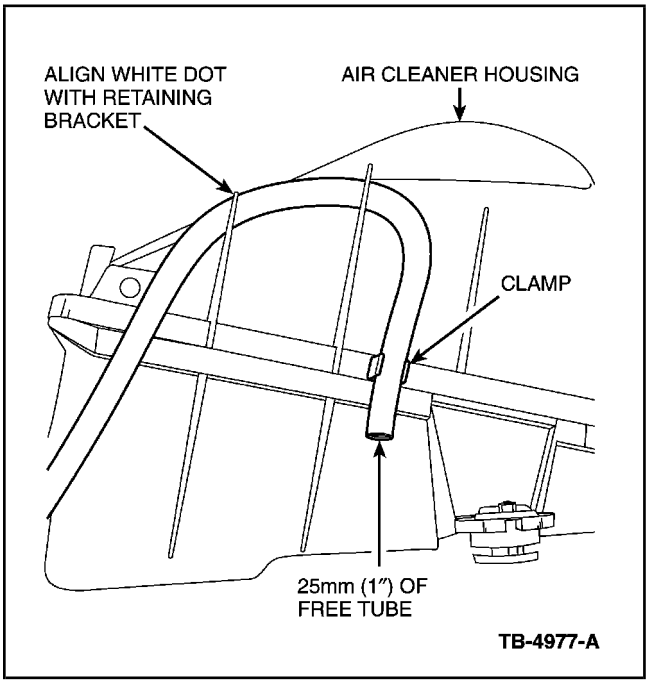


Figure 4 - Article 99-24-9

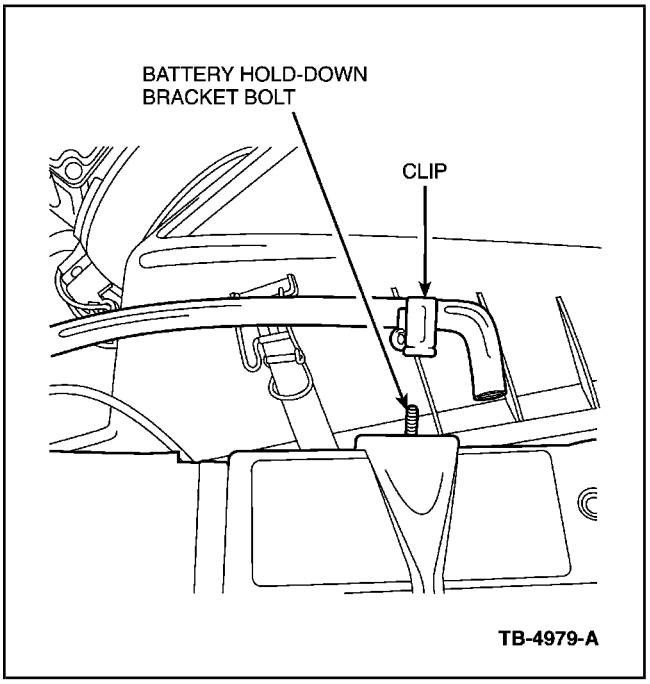


Figure 6 - Article 99-24-9

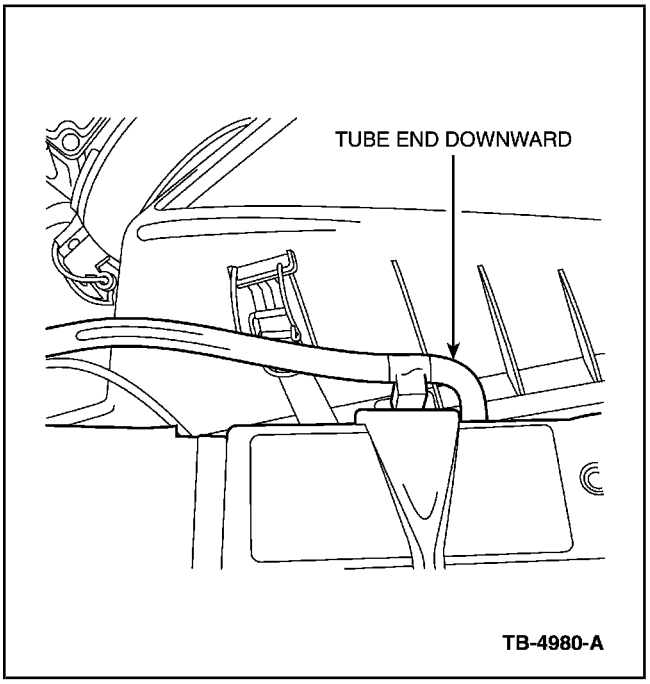


Figure 7 - Article 99-24-9