- **DRIVEABILITY—HESITATION/SURGE AT CRUISE OR LIGHT TIP-IN AT 72-96 KM/H (45-60 MPH)—VEHICLES EQUIPPED WITH 2.0L ZETEC ENGINE**
- **DRIVEABILITY—LONG CRANK AFTER HOT SOAK—VEHICLES EQUIPPED WITH 2.0L ZETEC ENGINE**
- **DRIVEABILITY—ROUGH IDLE WHEN COLD—VEHICLES EQUIPPED WITH 2.0L ZETEC ENGINE**

Article No. 01-16-3

FORD: 2000-2001 FOCUS

ISSUE

Some vehicles equipped with a 2.0L Zetec engine may exhibit a hesitation/surge at cruise or light tip-in at 72-96 km/h (45-60 mph) and/or a cold idle roughness, hesitation/surge and/or long crank times after a hot soak condition. This may be caused by the calibration of the Powertrain Control Module (PCM).

ACTION

Verify condition. If normal diagnostics cannot pinpoint the condition, reprogram the PCM with the latest level calibration. Refer to the following PCM Calibration Information chart for details.

SERVICE INFORMATION


PCM CALIBRATION INFORMATION

Application	Old Part Number (-12A650-)	Old Tear Tag	New Part Number (-12A650-)	New Tear Tag	Old Calibration	New Calibration	NGS/WDS Qualifier
2001 2.0L Zetec A/T	1S4F-MF	JFR5	1U7Z-ADA	NAI0	1AK1AZ0509	1AK1AZ0510	WDS Release B14.6 or Later
2001 2.0L Zetec A/T	1S4F-MG	NAI0	1U7Z-ADA	NAI0	1AK1AZ0510	1AK1AZ0510	WDS Release B14.6 or Later
2001 2.0L Zetec A/T	1M5F-PA	CJW0	1M5Z-PB	CJW1	1AK1AZ0515	1AK1AZ0516	WDS Release B14.6 or Later
2001 2.0L Zetec A/T	1S4F-ADF	SZR5	1U7Z-AEA	UIQ0	1AK1AZ0A09	1AK1AZ0A10	WDS Release B14.6 or Later
2001 2.0L Zetec A/T	1S4F-ADG	UIQ0	1U7Z-AEA	UIQ0	1AK1AZ0A10	1AK1AZ0A10	WDS Release B14.6 or Later
2001 2.0L Zetec A/T	1M5F-RA	XAU0	1M5Z-RB	XAU1	1AK1AZ0A15	1AK1AZ0A16	WDS Release B14.6 or Later
2000 2.0L Zetec A/T	98AB-AHH	LDC7	YU7Z-DSA	WRS0	0AK15Z0511	0AK15Z0512	WDS Release B14.6 or Later
2000 2.0L Zetec A/T	98AB-AHJ	LDC8	YU7Z-DSA	WRS0	0AK15Z0512	0AK15Z0512	WDS Release B14.6 or Later
2000 2.0L Zetec M/T	98AB-ZG	JFA6	YU7Z-DTA	DRP0	0AK25Z0510	0AK25Z0512	WDS Release B14.6 or Later
2000 2.0L Zetec M/T	98AB-ZH	JFA7	YU7Z-DTA	DRP0	0AK25Z0511	0AK25Z0512	WDS Release B14.6 or Later
2000 2.0L Zetec M/T	98AB-ZJ	JFA8	YU7Z-DTA	DRP0	0AK25Z0512	0AK25Z0512	WDS Release B14.6 or Later
2001 2.0L Zetec M/T	1S4F-KF	ZYF5	1U7Z-AJA	JGC0	1AK2AZ0509	1AK2AZ0509	WDS Release B14.6 or Later
2001 2.0L Zetec M/T	1M5F-SA	LFQ0	1M5Z-SB	LFQ1	1AK2AZ0515	1AK2AZ0516	WDS Release B14.6 or Later

Copyright © 2001 Ford Motor Company

Article No. 01-16-3 Cont'd.

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

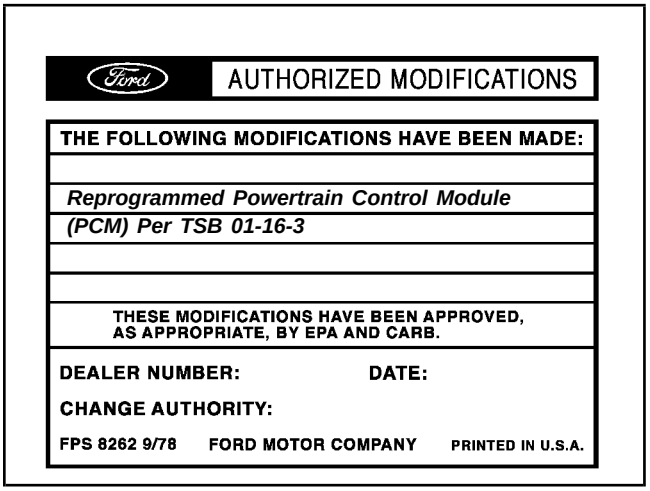

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 602300, 608000, 608400, 611000, 612000, 612600