• ELECTRICAL—REVISED COOLING FAN MOTOR AVAILABLE • COOLING—REVISED COOLING FAN MOTOR AVAILABLE	Article No. 03-1-1

FORD: 1998-2000 CROWN VICTORIA

MERCURY: 1998-2000 GRAND MARQUIS

ISSUE

When necessary to service the cooling fan assembly motor, service 1998-2000 model with later model cooling fan assembly motor and a wiring pigtail for compatibility.

ACTION

Use cooling fan assembly 1W7Z-8C607-AA to service Crown Victoria/Grand Marquis vehicles built 1998 Job 1 through April 4, 2000. Pigtail connector F8AZ-14370-AA is required for compatibility. Follow service procedure below.

SERVICE PROCEDURE

For 1998 - 2000 Model Year Vehicles Built Before April 4, 2000

1. Disconnect battery ground cable.
2. Disconnect fan motor electrical connector.
3. Position lower radiator hose off support bracket, and remove wire harness pushpin from fan shroud.
4. Remove the bolt and position aside degas bottle.

NOTE

THE REMOVAL AND INSTALLATION OF THE FAN AND SHROUD ASSEMBLY WILL REQUIRE A SECOND PERSON TO HOLD THE DEGAS BOTTLE OUT OF THE WAY.

5. Remove (2) bolts and remove fan and shroud assembly.
6. Install lower radiator hose support bracket onto new fan shroud.
7. Install new fan and shroud. Torque to 43.6 Lb-in (5.7 N•m).

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle.

Copyright © 2002 Ford Motor Company

8. Re-position the degas bottle and install bolt. Torque to 61.2 - 91.8 Lb-in (8-12 N•m).
9. Remove enough tape from the wire harness starting at fan connector to install fan connector pig tail, then remove wires from the convolute.
10. Cut the existing connector from the engine compartment wiring harness make each cut an inch and a half from the previous cut so that after splicing the wires can be reinstalled into the convolute.
11. Splice the three wires in the pigtail to the engine compartment harness as follows:
    a. Remove 0.75″ (19 mm) of insulation from the wires to be spliced (Figure 1).
    b. Insert a 2″ (50 mm) length of dual wall heat shrink tubing containing hot melt wax on the wire.
    c. Splay the strands of the cut wires (Figure 2).
    d. Twist/mesh the strands of the two wires together (Figure 3).
    e. Wrap a 4-5″ (100-125 mm) strand of wire tightly around the meshed ends (Figure 4).
    f. Repeat previous step.
    g. Solder the tightly wrapped meshed wires (Figure 5). Ensure the splice is thoroughly heated and solder flows completely into the strands. Use rosin core mildly activated (RMA) solder. DO NOT use acid core solder.
    h. Center the heat shrink tubing on the splice (Figure 6).
    i. Heat the entire length of the heat shrink tubing until the hot melt wax appears from both ends of the tubing (Figure 7).
12. Install and tape spliced wires back into convolute.
13. Connect fan motor, position back lower hose onto support bracket, and install wire harness pushpin onto new fan shroud using the lowest locating hole (Figure 8).
14. Connect battery ground cable. Torque to 68.5 Lb-in (9 N•m).
15. Verify fan operation with NGS/WDS.

PART NUMBER	PART NAME
1W7Z-8C607-AA	Cooling Fan Assembly
F8AZ-14370-AA	Pigtail Wiring Connector


OTHER APPLICABLE ARTICLES: 01-10-12
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage. Also Under the Provisions Of Emissions Warranty Coverage For 2000 Model Year Only

OPERATION	DESCRIPTION	TIME
030101A	Replace Engine Cooling Fan And Install New Wiring Connector	0.9 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
8C607	42

OASIS CODES: 402000

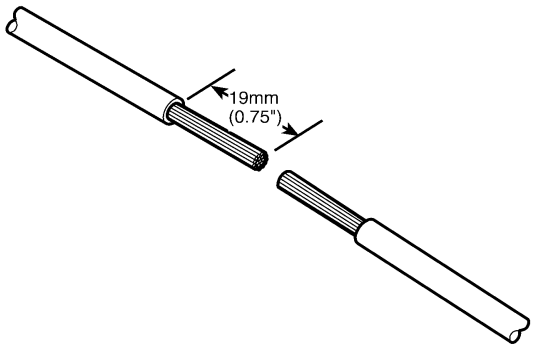

TB-6903-A

Figure 1 - Article 03-1-1

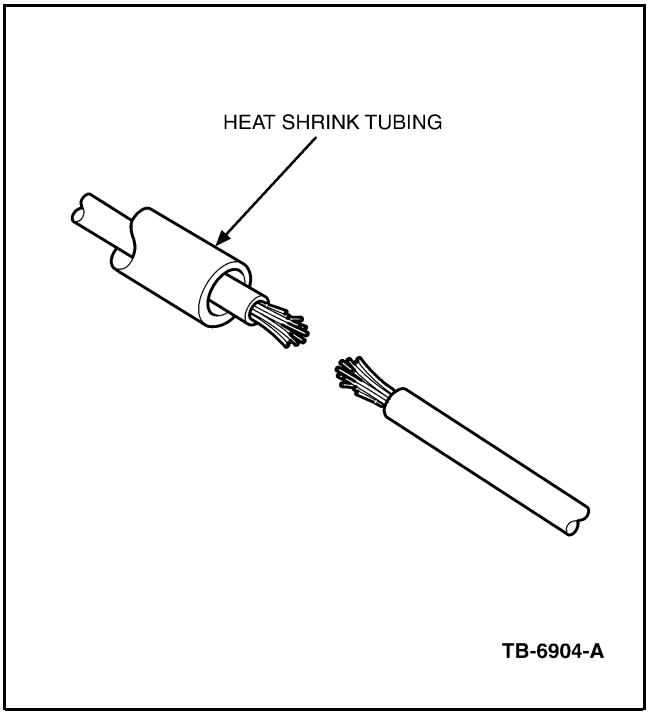


Figure 2 - Article 03-1-1

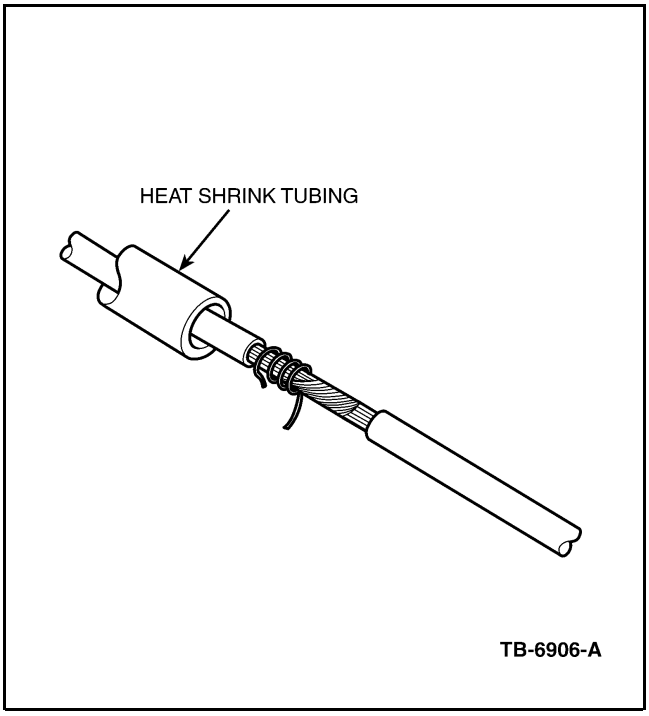


Figure 4 - Article 03-1-1

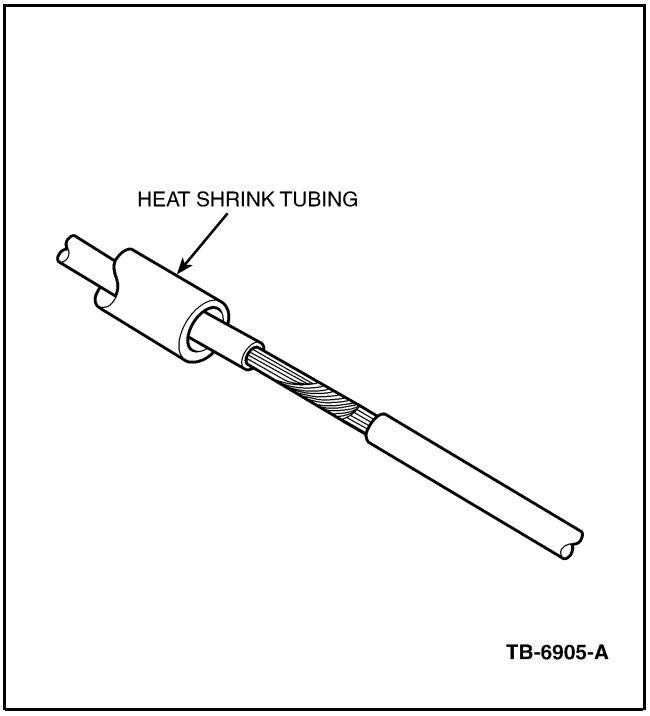


Figure 3 - Article 03-1-1

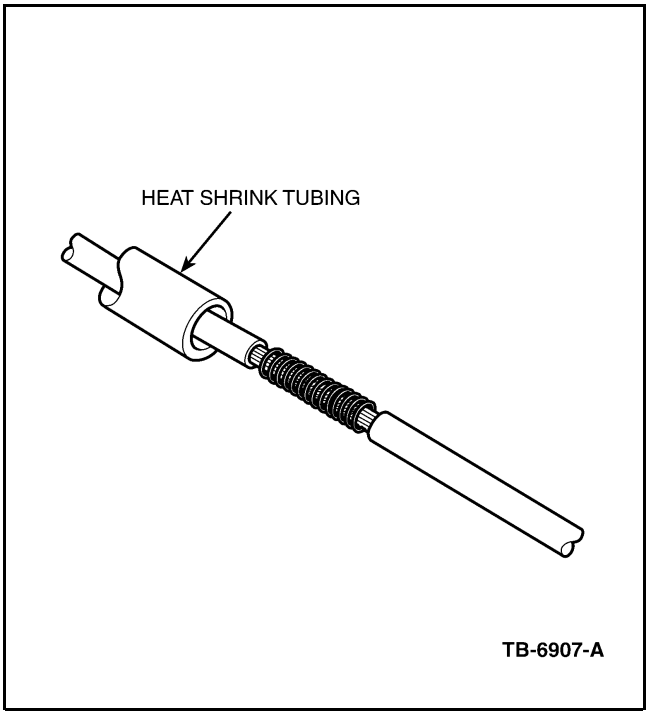


Figure 5 - Article 03-1-1

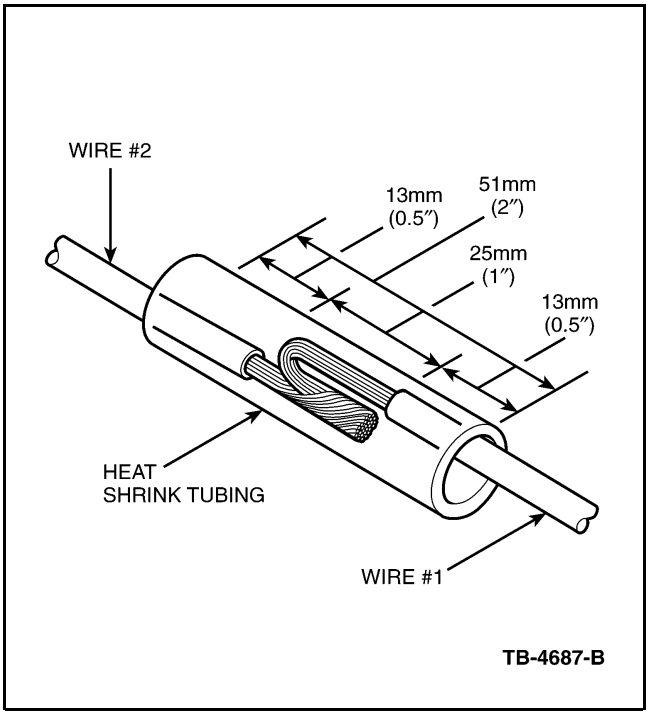


Figure 6 - Article 03-1-1

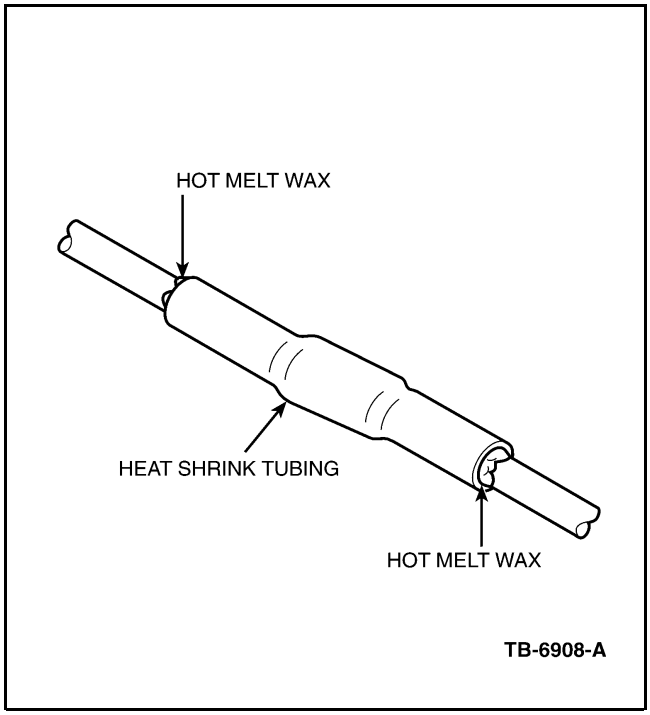


Figure 7 - Article 03-1-1

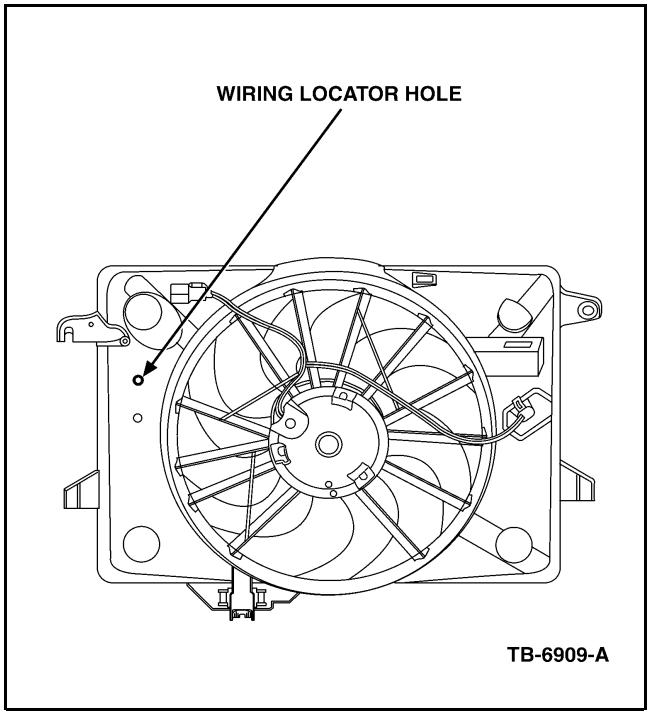


Figure 8 - Article 03-1-1