Modelling CS u: control input, y: plant output State variable CS is in state variable form if Inverse Laplace Transform Given F(s), its inverse LT is  $J(t) = \mathcal{L}^{-1}\{F(s)\} := \frac{1}{2\pi} \int_{c-j\infty}^{c+j\infty} F(s) e^{st} ds$   $= \lim_{w \to \infty} \frac{1}{2\pi} \int_{c-jw}^{c+jw} F(s) e^{st} ds, c \in \mathbb{C} \text{ is selected s.t. the line } L := \{s \in \mathbb{C} : s = c+j\omega, \omega \in \mathbb{R}\} \text{ is inside the ROC of } F(s).$ Zero:  $z \in \mathbb{C}$  is a zero of F(s) if F(z) = 0. **Pole:**  $p \in \mathbb{C}$  is a pole of F(s) if  $\frac{1}{F(p)} = 0$ .  $\mathcal{L}^{-1}\{F(s)\} = \textstyle\sum_{i=1}^{N} \operatorname{Res}\left[F(s)e^{st}, s = p_i\right]\mathbf{1}(t),$  $L^{-}(F(s)) = \sum_{i=1}^{s} \text{Res } F(s)e^{st}, s = p_i \text{ I(t)},$ \*Res $[F(s)e^{st} \text{ as } s = p_i]$ . Residue **Computation** Let G(s) be a complex analytic fcn w/ a pole at s = p, r be the multiplicity of the pole p. Then  $\text{Res}[G(s), s = p] = \frac{1}{(r-1)!} \lim_{s \to p} \frac{d^{r-1}}{ds^{r-1}} [G(s)(s-p)^r].$ Inv. LT Partial Frac.: 1. Factorize F(s) into partial fractions. 2. Find coefficients and use LT table to find inverse LT. \*\*Complete the square. where  $m \leq n$  (causality) IO to SS Model 1. Define x s.t. highest order derivative in  $\dot{x}$ 2. Write x=Ax+Bu=f(x,u) by isolating for components of x 3. Write y=Cx+Du=h(x,u) by setting measurement output y to component of x Find coefficients and any \*Complete the square.
 Inv. LT Residue: 1. Find poles of F(s) and their residues.
 Peridue THM to find inverse LT.
 Considues (use Et Transfer Function: Consider a CS in IO form. Assume zero initial conds.  $y(0) = \cdots = \frac{d(n-1)}{dt(n-1)}(0) = 0$  and Equilibria  $y_d$  (steady state) b/c if  $y(0) = y_d$  at t = 0, then  $y(t) = y_d \ \forall t \ge 0$ . **Equilibrium pair** Consider the system  $\dot{x} = f(x, u)$ . The pair Equilibrium pair Consider the system x = f(x, u). The pair  $(\bar{x}, \bar{u})$  is an equilibrium pair if  $f(\bar{x}, \bar{u}) = 0$ . Equilibrium point  $\bar{x}$  is an equilibrium point w/ control  $u = \bar{u}$ . If  $u = \bar{u}$  and  $x(0) = \bar{x}$  then  $x(t) = \bar{x} \ \forall t \geq 0$  (i.e. a system that starts at equilibrium remains at equilibrium). Find Equilibrium Pair/Point 1. Set f(x, u) = 0. Solve f(x, u) = 0 to find  $(x, u) = (\bar{x}, \bar{u})$ . 3. If specific  $u = \bar{u}$ , then find  $x = \bar{x}$  by solving  $f(x, \bar{u}) = 0$ .  $u(0) = \cdots = \frac{d^{(m-1)}u}{dt^{(m-1)}}(0) = 0.$  Then the TF from u to y is ...  $\begin{array}{l} atv^{m-1} \\ G(s) := \frac{y(s)}{U(s)} = \frac{b_{ms}m + \cdots + b_0}{s^n + a_{n-1}s^{n-1} + \cdots + a_0} \\ *0 \text{ Ini. Conds.: } y_0(s) = G(s)u(s) \end{array}$ **Linearization of Nonlinear System** Consider system  $\dot{x} = f(x, u)$  w/ equ. pair  $(\bar{x}, \bar{u})$ , then error coordinates around equ. pair \*Ø Ini. Conds.:  $y_0(s) = G(s)u(s)$ \*Ø Ini. Conds.:  $y_0(s) = y_0(s) + \frac{\text{poly. based on initial conds.}}{s^n + a_{n-1}s^{n-1} + \dots + a_0}$  $\begin{array}{l} \delta x = x - \bar{x}, \, \delta u = u - \bar{u}, \, \delta y = y - h(\bar{x}, \bar{u}) \, \, \delta x = x - f(\bar{x}, \bar{u}) \, \, w/\\ \delta x = A \delta x + B \delta u, \, A = \frac{\partial f(\bar{x}, \bar{u})}{\partial \underline{x}} \in \mathbb{R}^{n_1 \times n_1}, \, B = \frac{\partial f(\bar{x}, \bar{u})}{\partial u} \in \mathbb{R}^{n_1}, \end{array}$  $\delta y = C\delta x + D\delta u, \ C = \frac{\partial h}{\partial \underline{x}}(\bar{x}, \bar{u}) \in \mathbb{R}^{1 \times n_1}, \ D = \frac{\partial h(\bar{x}, \bar{u})}{\partial u} \in \mathbb{R}$ \*Only valid at equ. pairs. Impulse Response: Given CS modeled by TF G(s), its IR is  $g(t) := \mathcal{L}^{-1}\{G(s)\}$ . \*\* $\mathcal{L}\{\delta(t)\} = 1$ , then if  $u(t) = \delta(t)$ , then Y(s) = U(s)G(s) = G(s). SS to TF:  $G(s) = C(sI - A)^{-1}B + D$  s.t. y(s) = G(s)U(s). \*Assume  $x(0) = 0 \in \mathbb{R}^n$  (zero initial conds.). \*\*LTI: G(s) of an LTI system is always a rational fcn. \*Not Invertible: Values of s s.t. sI - A not invertible can correspond to poles of G(s). **Linear Approx.** Given a diff. fcn.  $f: \mathbb{R} \to \mathbb{R}$ , its linear approx. at  $\bar{x}$  is  $f_{lin} = f(\bar{x}) + f'(\bar{x})(x - \bar{x})$ . \*Remainder Thm:  $f(x) = f_{lin} + r(x)$  where  $\lim_{x \to \bar{x}} \frac{r(x)}{x - \bar{x}} = 0$ . \* $A_{(i,j)}$ : A w/ row i and col. j removed. 3. Find  $A^{-1} = \frac{1}{\det(A)}\operatorname{adj}(A) = \frac{1}{\det(A)}[\operatorname{cof}(A)]^T$ . \*2 × 2 :  $A^{-1} = \frac{1}{\det(A)} \begin{bmatrix} d & -b \\ -c & a \end{bmatrix}$ TF (SS to TF): 1. Given SS form, assume zero initial conds. \*Note: Can provide a good approx. near  $\bar{x}$  but not globally. \*Gen.  $f: \mathbb{R}^{n_1} \to \mathbb{R}^{n_2}, \ f(x) = f(\bar{x}) + \frac{\partial f}{\partial x}(\bar{x})(x - \bar{x}) + R(x)$ \*Jacobian:  $\frac{\partial f}{\partial x}(\bar{x}) = \begin{bmatrix} \frac{\partial f}{\partial x_1}(\bar{x}) & \cdots & \frac{\partial f}{\partial x_{n_1}}(\bar{x}) \end{bmatrix} \in \mathbb{R}^{n_2 \times n_1}$ 2. Solve  $G(s) = C(sI - A)^{-1}B + D$ . Linearization Steps 1. Find equ. pair  $(\bar{x}, \bar{u})$ 2. Derive A, B, C, D and then evaluate at  $(\bar{x}, \bar{u})$ & jth col. of  $\operatorname{adj}(sI-A)$  s.t.  $G(s) = \frac{[\operatorname{adj}(sI-A)]_{(i,j)}}{\det(sI-A)} + D$ . 3. Write  $\delta \dot{x} = A\delta x + B\delta u$  and  $\delta y = C\delta x + D\delta u$ \*Multiple i, j non-zero entries: Work it out using MM.

TF to SS: Consider  $G(s) = \frac{b_m s^m + \dots + b_0}{s^n + a_{n-1} s^{n-1} + \dots + a_0}$  $_{1}^{0}$ 0  $\begin{bmatrix} 0 \\ -a_2 \end{bmatrix}$ 

**Laplace Transform** Given a fcn  $f : \mathbb{R}_{+} = [0, \infty) \rightarrow \mathbb{R}^{n}$ , its Laplace transform is  $F(s) = \mathcal{L}\{f(t)\} := \int_{0^{-}}^{\infty} f(t)e^{-st} dt$ ,  $s \in \mathbb{C}$ .  $*\mathcal{L}: f(t) \mapsto F(s), t \in \mathbb{R}_+ \text{ (time dom.) } \& s \in \mathbb{C} \text{ (Laplace dom.)}.$ P.W. CTS: A fcn  $f: \mathbb{R}_+ \to \mathbb{R}^n$  is p.w. cts if on every finite interval of  $\mathbb{R}$ , f(t) has at most a finite # of discontinuity points  $(t_i)$  and the limits  $\lim_{t \to t_i^+} f(t)$ ,  $\lim_{t \to t_i^-} f(t)$  are finite.

Exp. Order A function  $f: \mathbb{R}_+ \to \mathbb{R}^n$  is of exp. order if  $\exists$ constants  $K, \rho, T > 0$  s.t.  $\|f(t)\| \le Ke^{\rho t}, \ \forall t \ge T$ . Existence of LT Thm If f(t) is p.w. cts and of exp. order w/ constants  $K, \rho, T > 0$ , then  $F(\cdot)$  exists and is defined  $\forall s \in D := \{s \in \mathbb{C} : \operatorname{Re}(s) > \rho\}$  and  $F(\cdot)$  is analytic on D. \*Analytic fen iff differentiable fcn. \*D: Region of convergence (ROC), open half plane.

Unit Step  $\mathbf{1}(t) := \begin{cases} 1, & \text{if } t \geq 0 \\ 0, & \text{otherwise} \end{cases}$ 

Table of Common Laplace Transforms:  $f(t) \mid F(s)$  $\mathbf{1}(t)\mapsto \frac{1}{s} \quad t\mathbf{1}(t)\mapsto \frac{1}{s^2} \quad t^k \mathbf{1}(t)\mapsto \frac{k!}{s^{k+1}} \quad e^{at} \mathbf{1}(t)\mapsto \frac{1}{s-1}$  $t^n e^{at} \ \mathbf{1}(t) \mapsto \frac{n!}{(s-a)^{n+1}} \quad \sin(at) \ \mathbf{1}(t) \mapsto \frac{a}{s^2 + a^2}$ 

 $\cos(at)\,\mathbf{1}(t)\mapsto \frac{s}{s^2+a^2} - \frac{1}{2\omega^3}[\sin(\omega t) - \omega t\cos(\omega t)]\,\mathbf{1}(t)\mapsto \frac{1}{(s^2+\omega^2)^2}$ 

Prop. of Laplace Transform Linearity:  $\mathcal{L}\{cf(t) + g(t)\} = c\mathcal{L}\{f(t)\} + \mathcal{L}\{g(t)\}, c \sim \text{constant.}$ 

**Differentiation:** If the Laplace transform of f'(t) exists, then  $\mathcal{L}\{f'(t)\} = s\mathcal{L}\{f(t)\} - f(0^{-}).$ 

If the Laplace transform of  $f^{(n)}(t) := \frac{d^n f}{dt^n}(t)$  exists, then  $\mathcal{L}\{f^{(n)}(t)\} = s^n \mathcal{L}\{f(t)\} - \sum_{i=1}^n s^{n-i} f^{(i-1)}(0^-).$ 

Integration:  $\mathcal{L}\left\{\int_0^t f(\tau)d\tau\right\} = \frac{1}{s}\mathcal{L}\{f(t)\}.$ 

The probability of the probabil

Shift in s:  $\mathcal{L}\lbrace e^{at}f(t)\rbrace = \mathcal{L}\lbrace f(t)\rbrace \Big|_{s\to s-a}^{-1} = F(s-a)$ , where

 $F(s) = \mathcal{L}\{f(t)\} \& a \text{ const.}$ 

**Trig. Id.**  $2\sin(2t) = 2\sin(t)\cos(t)$ ,  $\sin(a-b) = \sin(a)\cos(b) - \cos(a)\sin(b)$ ,  $\cos(a-b) = \cos(a)\cos(b) + \sin(a)\sin(b)$ 

Complete the Square:  $ax^{2} + bx + c = a(x + \frac{b}{2a})^{2} - \frac{b^{2}}{4a} + c$ LT Steps: 1. Write f(t) as a sum and use linearity \*Trig. id. may be useful.

\*Trig. id. may be useful. 2. Use prop. of LT and common LT to find F(s)Transient Performance Sat.: Given performance spec.  $T_r \leq T_r^d$ ,  $T_s \leq T_s^d$ , OS  $\leq$  OS  $^d$ , find loc. of poles of G(s).
\*Admissible region for the poles of G(s) s.t. the step response

Inverse Laplace Transform Given F(s), its inverse LT is f(t) =

Cauchy's Residue THM If F(s) is analytic (complex diff.) everywhere except at isolated poles  $\{p_1,\ldots,p_N\}$ , then

TF Steps (IO to TF): 1. Given IO form of CS, assume zero

\*Careful: Y(s)/U(s) = G(s) not U(s)/Y(s) = G(s).

Impulse Response: Given CS modeled by TF G(s), its IR is

Inverse: 1. For  $A \in \mathbb{R}^{n \times n}$ , find  $[\operatorname{cof}(A)]_{(i,j)} = (-1)^{i+j} \det(A_{(i,j)})$ .

2. Assemble cof(A) and find  $det(A) = \sum_{j=1}^{n} a_{ij} [cof(A)]_{(i,j)}$ 

w/ fixed i or  $\det(A) = \sum_{i=1}^n a_{ij} [\operatorname{cof}(A)]_{(i,j)}^{\bullet}$  w/ fixed j

\*If  $C = \begin{bmatrix} 0 & 1_i & 0 \end{bmatrix}$  &  $B = \begin{bmatrix} 0 & 1_j & 0 \end{bmatrix}$ , then only need ith row

< n (i.e. G(s) is strictly proper). Then the SS form is

0

 $C = \begin{bmatrix} b_0 & \cdots & b_m & | & 0 & \cdots & 0 \end{bmatrix}, I$ \*Unique: State space of a TF is not unique 0], D = 0.



Block Diagram Types of Blocks

Cascade:  $y_2 = (G_1(s)G_2(s))U \stackrel{\text{SISO}}{=} y_2 = (G_2(s)G_1(s))U$ 

$$\cup \to \boxed{G_1} \xrightarrow{\mathcal{Y}_1} \boxed{G_2} \longrightarrow \mathcal{Y}_2 \quad \equiv \quad \cup \to \boxed{G_1} \boxed{G_2} \longrightarrow \mathcal{Y}_2$$

Parallel  $y = (G_1(s) + G_2(s))U$ 

$$= \cup \longrightarrow \underbrace{G_1}_{G_2} \longrightarrow \forall$$

Feedback  $y = \left(\frac{G_1(s)}{1 + G_1(s)G_2(s)}\right)R$ 

$$R \xrightarrow{\circ} 0 \xrightarrow{\circ} G_{1} \xrightarrow{\circ} 1$$

$$\equiv R \xrightarrow{\circ} G_{1} \xrightarrow{\circ} 1$$

\*SC: Unity Feedback Loop (UFL) if  $G_2(s) = 1$ . Manipulations: 1.  $y = G(U_1 - U_2) = GU_1 + GU_2$  2.  $y_1 = GU$   $y_2 = U$  |  $y_1 = GU$   $y_2 = G \frac{1}{G}U$ 

3. From feedback loop to UFL.

U, -SO - TG - Y U. → T67-30-34

o Tal y = U > a - in y.  $R \rightarrow \begin{bmatrix} \frac{1}{6} \\ \frac{1}{6} \end{bmatrix} \rightarrow 0 \rightarrow \begin{bmatrix} \frac{1}{6} \\ \frac{1}{6} \end{bmatrix} \rightarrow$ 

Find TF from Block Diagram: 1. Start from in  $\rightarrow$  out, making simplifications using block diagram rules.

2. Simplify until you get the form  $U(s) \to G(s) \to Y(s)$ . Time Response of Elementary Terms:  $1(t) \leftarrow \text{pole } @ 0$ The first constant of the first pole @ 0 w/ mult.  $n \mid e^{at}\mathbf{1}(t) \leftarrow \text{pole}$  @  $a \sin(\omega t + \phi)\mathbf{1}(t) \leftarrow \text{pole}$  @  $a \pm j\omega \mid \cos(\omega t + \phi)\mathbf{1}(t) \leftarrow \text{pole}$  @  $a \pm j\omega$  Real Pole:  $y(s) = \frac{1}{s+a}$ , real pole at s = -a, then  $y(t) = e^{-at} \mathbf{1}(t)$ 1.  $a>0 \implies \lim_{t\to\infty} y(t)=0 \mid 2. \ a<0 \implies \lim_{t\to\infty} y(t)=\infty$ 3.  $a=0 \implies y(t)=\mathbf{1}(t)$  is constant.



Time Constant: 
$$\tau = \frac{1}{a}$$
 of the pole  $s = -a$  for  $a > 0$  Pair of Comp. Conj. Poles: 
$$y(s) = \frac{\omega_n^2}{s^2 + 2\zeta\omega_n s + \omega_n^2} = \frac{\omega_n^2}{(s + \sigma)^2 + \omega_d^2}, \ |\zeta| < 1, \ \text{then}$$
 
$$y(t) = \frac{\omega_n}{\sqrt{1 - \zeta^2}} e^{-\sigma t} \sin(\omega_d t) \mathbf{1}(t)$$

\*Poles:  $s_{1,2} = -\zeta \omega_n \pm j\omega_n \sqrt{1-\zeta^2} = -\sigma \pm j\omega_d$ \* $\zeta = \frac{\sigma}{\omega_n}$ : Damping ratio (or damping coefficient)


 $\sigma^* = \zeta \omega_n$ : Decay/growth rate |  $\omega_d$ : Freq. of oscillation

 $*\omega_n = \sqrt{\sigma^2 + \omega_d^2} \left[ \frac{\text{radians}}{\text{seconds}} \right]$ : Undamped natural freq.

 $*\omega_d = \omega_n \sqrt{1-\zeta^2} \left[ \frac{\text{radians}}{\text{seconds}} \right]$ : Damped natural freq.

 $*|s_{1,2}|^2 = \omega_n^2$ : Mag. of poles is  $\omega_n$ .

 $*\cos^{-1}(\zeta)$ : Angle of  $s_1$  on complex plane CW from -ve Re axis

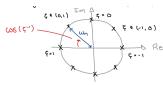

Damping Ratio Effect:  $0 < \zeta_1 < \zeta_2 < 1$ , then



 $-1 < \zeta_4 < \zeta_3 < 0$ , then  $\sigma = \zeta \omega_n < 0$ , (exp. envelop  $\uparrow$ )



Class. of 2nd Order Sys.: y(s) =

Loc. of Poles and Behavior:



Control Spec. of 2nd Order Sys.: Step Response: Given a TF G(s), its SR is y(t) resulting from applying the input  $u(t) = \mathbf{1}(t)$ .

i.e.  $\mathcal{L}^{-1}\left\{G(s)\frac{1}{s}\right\}$ . Control Spec. A control spec. is a criterion specifiying how we would like a CS to behave.  $\omega_n^2 \qquad \qquad \omega_n^2 \qquad \qquad \omega_n^2 \qquad \qquad \omega_n^2 = \frac{1}{2}$ 

2nd Order Sys. Metrics:  $G(s) = \frac{\omega_n^2}{s^2 + 2\zeta\omega_n s + \omega_n^2}$  w/  $U(s) = \frac{1}{s}$ \*0 <  $\zeta$  < 1 (i.e. 2 comp. conj. poles w/ Re(pole) < 0).

Rise Time (RT):  $T_r$  is the time it takes y(t) to go from 10% to 90% of its steady-state value.

RT: 1. Find  $t_1 > 0$  s.t.  $y(t_1) = 0.1$ ,  $t_2 > 0$  s.t.  $y(t_2) = 0.9$ .

3. Compute 
$$T_r = t_2 - t_1$$
.  $T_r \approx \frac{1.8}{\omega_n}$ 

Settling Time (ST):  $T_s$  is the time required to reach and stay w/in 2% of the steady-state value.

ST: 1. Find when it's first that  $|y(t) - 1| \le 0.02$ .

Peak Time:  $T_p$  is time req'd to reach the max (peak) value.

Peak Time: 1. Find the first time when 
$$\dot{y}(t)=0$$
. 
$$* T_p = \frac{\pi}{\omega_d} = \frac{\pi}{\omega_n \sqrt{1-\zeta^2}}.$$

 $\% \text{ Overshoot: } \%OS = \frac{\text{[peak value]} - \text{[steady-state value]}}{\text{[steady-state value]}} \times 100\%$ \*%  $OS = OS \times 100\%$ 

\* 
$$\exp\left(-\frac{\pi\zeta}{\sqrt{1-\zeta^2}}\right) \iff \zeta = \frac{-\ln(OS)}{\sqrt{\pi^2 + (\ln(OS))^2}}$$

meets all three spec. is the intersection of the above three regions. Rise Time:  $T_r \approx \frac{1.8}{\omega_n} \le T_r^d \stackrel{\text{app.}}{\Longrightarrow} \omega_n \ge \frac{1.8}{T_r^d} \equiv \omega_n^d$ 



Settling Time:  $T_s \approx \frac{4}{\zeta \omega_n} = \frac{4}{\sigma} \leq T_s^d \stackrel{\text{app.}}{\Longleftrightarrow} \sigma \geq \frac{4}{T_s^d} \equiv \sigma^d$ 



OS: 
$$\exp\left(\frac{-\pi\zeta}{\sqrt{1-\zeta^2}}\right) \le OS^d \stackrel{\text{app.}}{\Longleftrightarrow} \zeta \ge \frac{-\ln(OS^d)}{\sqrt{\pi^2 + (\ln(OS^d))^2}} \equiv \zeta^d$$

$$\frac{1}{\sqrt{\pi^2 + (\ln(\operatorname{OS}^d))^2}} = \sqrt{\frac{\pi^2 + (\ln(\operatorname{OS}^d))^2}{\sqrt{\pi^2 + (\ln(\operatorname{OS}^d))^2}}}$$

 ${\bf Add.\ Poles\ \&\ Zeros:}$  The analysis remains approx. correct under the following assumptions: 1. Any add. poles of G(s) have much more -ve real part (5-10 times) than the real part of the dom. comp. conjugate poles.



\*dominant poles, additional poles.

2. Real part of zeros are -ve & very diff. from the real part of the two dom. poles.

- Internal Stablity: x=Ax is 1. Stable if  $\forall x(0) \in \mathbb{R}^n$ , the soln. x(t) is bdd; that is,  $\exists M>0$  s.t.  $\|x(t)\| \leq M \ \forall t \geq 0$ . 2. Asymp. Stable if it's stable &  $\forall x(0) \in \mathbb{R}^n$ , the soln. x(t) converges to the origin; that is,  $\lim_{t\to\infty} x(t)=0$ . 3. Unstable if it's not stable; that is,  $\exists x(0) \in \mathbb{R}^n$  s.t. x(t) is not ...

Asymptotic Stablity Thm.  $\overset{\cdot}{x}=Ax$  is A.S. iff  $\operatorname{eig}(A)\subseteq\mathbb{C}^-\equiv\{s\in\mathbb{C}\mid\operatorname{Re}(s)<0\},$  i.e. open left half plane (OLHP). Instability Thm. If  $\exists$  an eigenvalue  $\lambda$  of A w/  $\operatorname{Re}(\lambda)>0$ , then

- x=Ax is unstable. Fact: Zeros of  $s^2+a_1s+a_0$  are in  $\mathbb{C}^-$  iff  $a_1,a_0>0$ . Internal Stability 1. Linearize around  $(\bar{x},\bar{u})$  w/  $\bar{u}=0$ . 2. Find A and determine  $\operatorname{eig}(A)=\lambda$  s.t.  $\det(sI-A)=0$ .

2. Find A and determine  $\operatorname{eig}(A) = \lambda$  s.t.  $\operatorname{det}(sI - A) = 0$ . 3. Check if  $\operatorname{eig}(A) \subseteq \mathbb{C}^- \mid \operatorname{Re}(\operatorname{eig}(A)) > 0$ . BIBO Stability: An LTI system w/ 0 i.c. is Bounded Input Bounded Output (BIBO) stable if for any bdd input u(t), the output y(t) is also bdd. BIBO Unstable: An LTI system w/ 0 i.c. is BIBO unstable if it's not BIBO stable; that is,  $\exists$  a bdd u(t) s.t. y(t) is not bdd. BIBO Stable Thm. A system y(s) = G(s)U(s) is BIBO stable iff  $\operatorname{poles}(G(s)) \subset \mathbb{C}^-$ 

 $\begin{array}{l} \text{iff poles}(G(s))\subseteq\mathbb{C}^-.\\ \textbf{Lemma:} \ \text{If} \ p \ \text{is a pole of} \ G(s), \ \text{then} \ p \ \text{is an eig}(A). \ \text{I.e.} \ \text{poles}(G(s)):=\\ \{p\in\mathbb{C}\mid p \ \text{is a pole of} \ G(s)\}\subseteq \text{eig}(A). \end{array}$  \*Pole-0 Cancellation: eige(\$A\$) need not be a pole of \$G(s)\$.

Thm. If  $\operatorname{eig}(A) \subseteq \mathbb{C}^-$ , then  $\forall B, C, D$  the TF G(s) is BIBO stable. That is, internal asymptotic stability  $\Rightarrow$  BIBO stability. BIBO Stability 1. Find G(s) from SS form and determine poles.

2. Check if  $poles(G(s)) \subseteq \mathbb{C}^-$ .

\*s<sup>n</sup> | 1 
$$a_{n-1}$$
  $a_{n-4}$   $a_{n-6}$   $\cdots$  0 \*s<sup>n-1</sup> |  $a_{n-1}$   $a_{n-3}$   $a_{n-5}$   $a_{n-7}$   $\cdots$  0 \*s<sup>n-2</sup> |  $a_{n-1}$   $a_{n-3}$   $a_{n-5}$   $a_{n-7}$   $\cdots$  0 \*s<sup>n-2</sup> |  $a_{n-1}$   $a_{n-3}$   $a_{n-5}$   $a_{n-7}$   $\cdots$  0 \*s<sup>n-3</sup> |  $a_{n-1}$   $a_{n-3}$   $a_{n-5}$   $a_{n-7}$   $\cdots$  0 \*s<sup>n-3</sup> |  $a_{n-1}$   $a_{n-3}$   $a_{n-5}$   $a_{n-7}$   $\cdots$  0

 $\mathbb{C}^-$  iff the 1st col of Routh array has no sign changes. The # of sign changes is equal to the # of roots of  $a(s) \in \mathbb{C}^+ := \{s \in \mathbb{C} : \text{Re}(s) > 0\}.$ \*If 1st element of a row is 0, Rooth array cannot be completed.

FVT v1: Suppose  $Y(s) = \mathcal{L}\{y(t)\}$  is a proper rational fcn. If  $y(\infty) := \lim_{t \to \infty} y(t)$  exists and is finite, then  $y(\infty) = \lim_{s \to 0} sY(s)$  FVT v2: Suppose  $Y(s) = \mathcal{L}\{y(t)\}$  is a proper rational fcn. Moreover, suppose either:

1.  $\operatorname{poles}(Y(s)) \subseteq \mathbb{C}^-$ 


2. Y(s) has only one pole at s=0 and all other poles are in  $\mathbb{C}^-$ . Then  $y(\infty):=\lim_{t\to\infty}y(t)$  exists and is finite and satisfies  $y(\infty):=\lim_{s\to 0}sY(s)$ .

FVT 1. Does  $y(\infty)$  exist? Check if pole at s=0, then compute

Rooth Array to see if poles are in  $\mathbb{C}^{-}$ . 2. Compute  $\lim_{s\to 0} sY(s)$  if it exists.

## MIDTERM CUTOFF

## Standard Feedback Control Loop

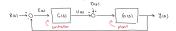

R(s): Ref., E(s) = R(s) - y(s): Err., C(s): Controller, U(s): Control input, D(s): Dist., G(s): Plant, y(s): Plant output. \*Assume: R(s) and D(s) are strictly proper rational fcns w/a fixed set of poles but arbitrary zeros & gain. \* $\mathcal{R}$ ,  $\mathcal{D}$ : Classes of ref. and dist. satisfying the above assumption. Basic Control Prob: Design C(s) s.t. 3 spec. are met: 1. Stability:  $\forall$  bdd r(t), d(t), we have u(t), e(t) bdd. 2. Asymptotic Tracking: When  $d(t) = 0 \ \forall t \geq 0$ , then  $\forall r(t) \in \mathcal{R}$ ,  $\lim_{t \to \infty} e(t) = \lim_{t \to \infty} r(t) - y(t) = 0$ . 3. Disturbance Rejection: When  $r(t) = 0 \ \forall t \geq 0$ , then  $\forall d(t) \in \mathcal{D}$ ,  $\lim_{t \to \infty} y(t) = 0$ .

R,  $\lim_{t\to\infty} e(t) = \lim_{t\to\infty} r(t) - y(t) = 0$ .

3. Disturbance Rejection: When  $r(t) = 0 \ \forall t \geq 0$ , then  $\forall d(t) \in \mathcal{D}$ ,  $\lim_{t\to\infty} y(t) = 0$ .

Open-Loop Control: 1. Design u(t) s.t. y(t) tracks ref.  $y_r \in \mathbb{R}$ , i.e.  $\lim_{t\to\infty} y(t) = y_r$ .

2. Set  $u(t) = \gamma y_r 1(t) \ \text{w} / \gamma \in \mathbb{R}$  (const. scaling factor)

3. Apply FVT to find  $\gamma$  s.t.  $\lim_{t\to\infty} y(t) = y_r$ . 4. Determine  $\lim_{t\to\infty} e(t) = \lim_{t\to\infty} y_r - y(t)$ Limitations: 1. Req. perfect knowledge of plant paramters.

2. Not robust against parameter var./(unknown) dist.

3. Does not allow us to speed up convergence.

Feedback Control: 1. Design u(t) s.t. y(t) tracks ref.  $y_r \in \mathbb{R}$ , i.e.  $\lim_{t\to\infty} y(t) = y_r$ .

2. Set  $u(t) = Ke(t) = K(y_r - y(t)) \ \text{w} / K > 0$  (const. gain).

3. Use block mani. to find y(s) in terms of input and G(s).

4. Apply FVT to find K s.t.  $\lim_{t\to\infty} y(t) = y_r$ .

5. Determine  $\lim_{t\to\infty} \infty e(t) = \lim_{t\to\infty} y_r - y(t)$ Advantages: 1. Doesn't req. perfect knowledge of plant param.

2. Robust against param. var./dist. by  $\uparrow K$ .

3. Allows us to speed up the rate of convergence by  $\uparrow K$ .
Disadvantages: 1. Feedback can introduce instability.

2. High-gain amplifies noise.

2. High-gain amplifies noise.

3. Asymptotic tracking doesn't occur.

Integral Control: 1. Design u(t) s.t. y(t) tracks ref.  $y_r \in \mathbb{R}$ , i.e.  $\lim_{t\to\infty} y(t) = y_r$ .

The  $\liminf_{t\to\infty} y(t) = yT$ . 2. Set  $u(t) = \mathcal{L}^{-1}\{C(s)E(s)\} = Ke(t) + KT_I\int_0^t e(\tau)d\tau$  (prop. int. (PI) controller) w/ K,  $T_I > 0$  (const. gains).  $*C(s) = K\left(1 + \frac{T_I}{s}\right)$ 

\*\*
$$C(s) = K$$
  $\left(1 + \frac{s}{s}\right)$ 
3. Use block mani. to find  $y(s)$  in terms of input and  $G(s)$ .

4. Apply FVT to find  $\lim_{t \to \infty} y(t) = y_r$  as desired.

BIBO Stability of Closed-Loop System: Gang of 4 TF:
$$\begin{bmatrix} E(s) \\ U(s) \end{bmatrix} = \begin{bmatrix} \frac{1}{1 + C(s)G(s)} & \frac{-G(s)}{1 + C(s)G(s)} \\ \frac{C(s)}{1 + C(s)G(s)} & \frac{-C(s)G(s)}{1 + C(s)G(s)} \end{bmatrix} \begin{bmatrix} R(s) \\ D(s) \end{bmatrix}$$

BIBO Stable of CLS: The std. feedback control loop (CLS) is BIBO stable if all the Gang of 4 TFs are BIBO stable.

Thm: The CLS is BIBO stable iff 1. Poles of  $\frac{1}{1 + C(s)G(s)} \in \mathbb{C}^-$ 

2.  $C(s)G(s)$  has no polesyere cause. In  $\tilde{E}^+ - t = S \in \mathbb{C}^+$ ,  $Rg(s) \geq 0$ .

2. C(s)G(s) has no pole-zero cancel. in  $\bar{\mathbb{C}}^+ = \{s \in \mathbb{C} : \text{Re}(s) \geq 0\}$ .

1. Don't cancel an unstable 0 of G(s) w/ an unstable pole in C(s). 2. Don't cancel an unstable pole of G(s) w/ an unstable 0 in C(s).