

Figure 5-73. Clamps on top of canopy.

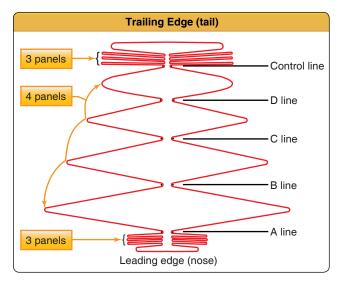


Figure 5-74. Drawing of canopy stack.

1. Pull tension on the "A" lines. Split the leading edge in half. [Figure 5-75]



Figure 5-75. Split the leading edge.

- 2. Fold half under "A" lines. [Figures 5-76 and 5-77]
- 3. Pick up the "B" lines by the clamp and hold vertically over the "A" clamp. [Figure 5-78] Note the spread of the leading edge panels.
- 4. Lower the "B" clamp and material down to the "A" clamp. *[Figure 5-79]* Spread the cells equally to both sides. Keep the center cell in the middle.



Figure 5-76. Fold half under "A" lines.



Figure 5-77. Smooth panels under "A" lines.



Figure 5-78. Hold "B" clamp vertically over "A" clamp.

5. Repeat this step with the "C" and the "D" line groups. [Figures 5-80 and 5-81]