

# Seat Belt Tongue Plate Stopper Replacement

**Service Category** Vehicle Interior

**Section** Seat Belt

**Market** USA

Toyota Supports  
ASE Certification 

## Applicability

| YEAR(S)     | MODEL(S)     | ADDITIONAL INFORMATION |
|-------------|--------------|------------------------|
| 1992 – 2008 | 4Runner      |                        |
| 1995 – 2008 | Avalon       |                        |
| 1983 – 2008 | Camry        |                        |
| 1980 – 2005 | Celica       |                        |
| 1980 – 2008 | Corolla      |                        |
| 2000 – 2005 | Echo         |                        |
| 1991 – 2008 | Land Cruiser |                        |
| 2001 – 2008 | Prius        |                        |
| 1997 – 2008 | RAV4         |                        |
| 1998 – 2008 | Sienna       |                        |
| 1999 – 2008 | Solara       |                        |
| 1997 – 2008 | Tacoma       |                        |
| 1981 – 1999 | Tercel       |                        |
| 2000 – 2008 | Tundra       |                        |

### TSB SUPERSESSION NOTICE

The information contained in this TSB supersedes TSB No. BO017-07.

- Applicability has been updated to include 2008 model year vehicles.

TSB No. BO017-07 is Obsolete and any printed versions should be discarded. Be sure to review the entire content of this service bulletin before proceeding.

## Seat Belt Tongue Plate Stopper Replacement

### Introduction

For situations where only the seat belt stopper is broken, a new service part has been developed to eliminate the need to replace the entire seat belt assembly. Follow the installation procedure below to utilize this new part.

### Warranty Information

| OP CODE | DESCRIPTION                            | TIME | OFP         | T1 | T2 |
|---------|----------------------------------------|------|-------------|----|----|
| BD0047  | Install Seat Belt Tongue Plate Stopper | 0.1  | 73219-020#0 | 62 | 12 |

#### APPLICABLE WARRANTY

- This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to correction of a problem based upon a customer's specific complaint.

### Parts Information

| PREVIOUS PART NUMBER | CURRENT PART NUMBER | COLOR | PART NAME             |
|----------------------|---------------------|-------|-----------------------|
| N/A                  | 73219-02010         | Black | Stopper, Tongue Plate |
|                      | 73219-02020         | Gray  | Stopper, Tongue Plate |
|                      | 73219-02030         | Beige | Stopper, Tongue Plate |
|                      | 73219-33020         | Gray  | Stopper, Tongue Plate |
|                      | 73219-AE010         | Black | Stopper, Tongue Plate |
|                      | 73219-AE020         | Gray  | Stopper, Tongue Plate |
|                      | 73219-AE030         | Beige | Stopper, Tongue Plate |


Use a stopper color that is closest to the seat belt webbing color. Part numbers AE0# are larger in size than 020##, and correspond to larger vehicles. Confirm correct size and color when ordering parts.

## Seat Belt Tongue Plate Stopper Replacement

### Repair Procedure

1. Shift the tongue plate to the upper portion of the tongue plate stopper, and temporarily hold it with a clip or tape.

**Figure 1.**

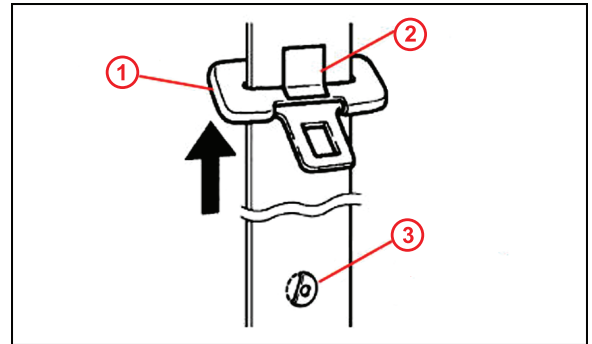

|          |                                        |
|----------|----------------------------------------|
| <b>1</b> | Tongue Plate                           |
| <b>2</b> | Tape                                   |
| <b>3</b> | Example of Broken Tongue Plate Stopper |

2. Remove any pieces of the original tongue plate stopper in the webbing, with a pair of diagonal pliers.

#### **NOTE**

Be careful not to damage the webbing, since this may compromise the safety of this seatbelt.

#### **CAUTION**

Damaged or weakened seat belts may break in an accident and injure the occupant. The seat belt assembly **MUST** be replaced if:

- The webbing is cut, frayed, worn, or damaged.
- It has been used during a severe impact (inspect the label to ensure no impact damage has occurred)

Inspect the entire length of webbing for damage and replace the assembly if needed. Be careful **NOT** to damage the webbing during repair.

# Seat Belt Tongue Plate Stopper Replacement

## Repair Procedure (Continued)


### 3. Install the NEW tongue plate stopper

- A. Install a NEW tongue plate stopper in the hole of the webbing.

#### NOTE

Be sure to install the stopper in the correct direction as shown in the illustration.

Figure 2.

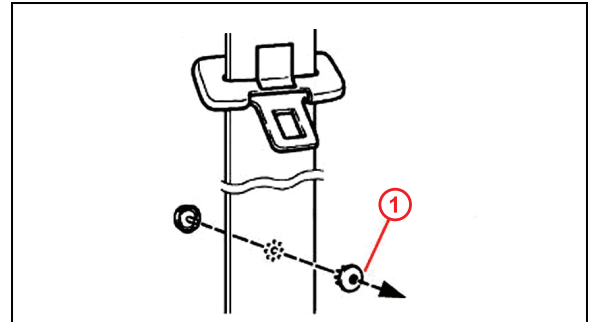


1 Tongue Plate Stopper

- B. Pinch the tongue plate stopper into the webbing using the tool shown in Figure 3 or use a small "C" clamp.

#### NOTE

To prevent damage to the plastic tongue plate stopper when using a "C" clamp device, use light to moderate clamping force when crimping the two halves of the tongue plate stopper together.


Figure 3.

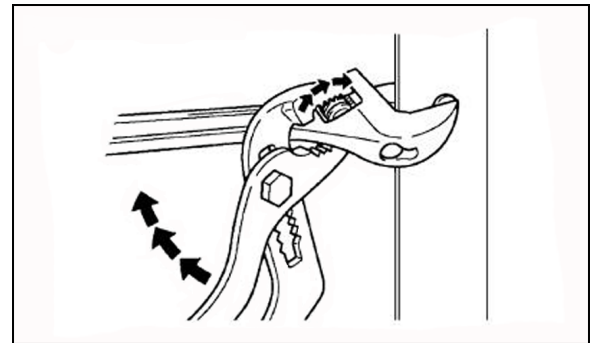

#### HINT

Press the adjustment screw locating the male and female parts of the tongue plate stopper parallel to each other.

Figure 4.

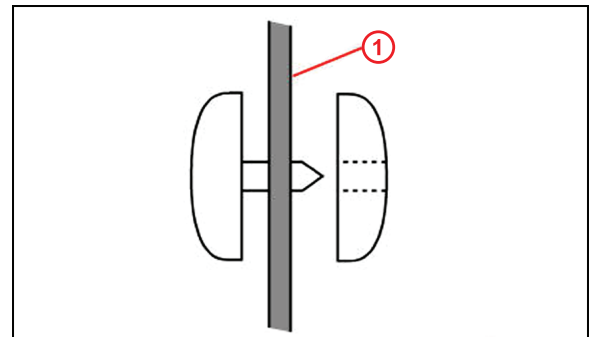

1 Webbing

#### CAUTION

For this procedure, do not use pliers. They may damage the webbing.

## Seat Belt Tongue Plate Stopper Replacement

### Repair Procedure (Continued)

- C. Tighten the c-clamp until the space between its jaws are 4.5 – 5.0 mm (0.18 in. – 0.20 in.)  
Figures 5 & 6

Figure 5.


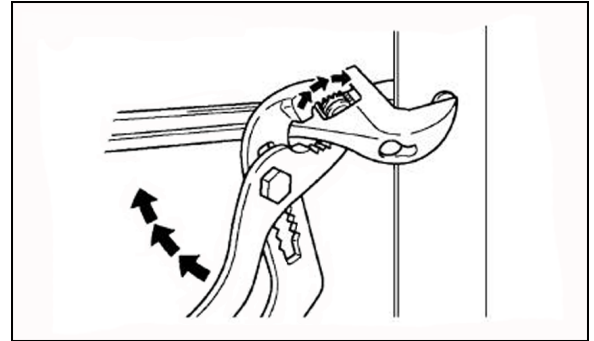


Figure 6.

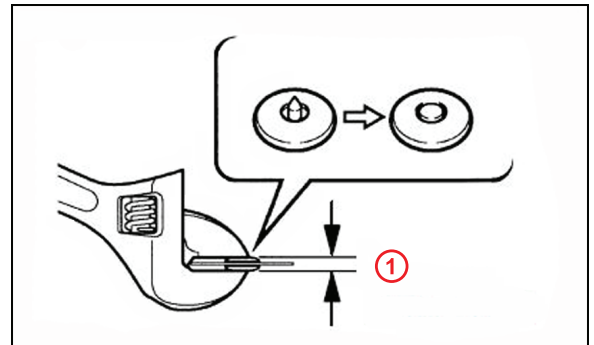


|          |                                  |
|----------|----------------------------------|
| <b>1</b> | 4.5-5.0 mm (0.18 in. - 0.20 in.) |
|----------|----------------------------------|

## Seat Belt Tongue Plate Stopper Replacement

### Repair Procedure (Continued)

- D. Verify the male pin of the tongue plate stopper has deformed evenly in the hole of the female part and is firmly held to the belt webbing.

**Figure 7.**

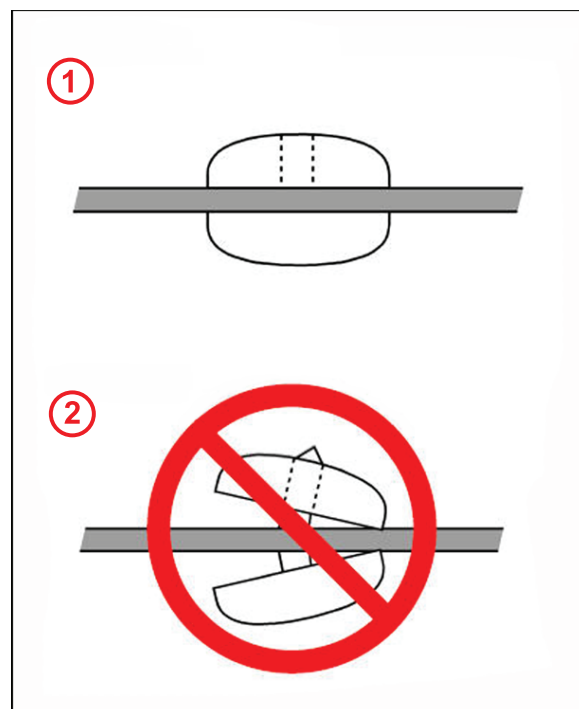

|          |           |
|----------|-----------|
| <b>1</b> | Correct   |
| <b>2</b> | Incorrect |