

Collision Repair Information Bulletin

FOR THE COLLISION REPAIR PROFESSIONAL

TITLE:	Front/Rear Door Outer Panel Installation Substitution	Bulletin #199
SECTION:	Vehicle Exterior	
APPLICABLE VEHICLES:	All Toyota, Lexus and Scion Vehicles	
DATE:	December 2021	Page 1 of 2

Background:

Toyota, Lexus, and Scion vehicles have mainly three different methods for front/rear door outer panel hemming installation depending on model and model year.

[Method 1] Body Sealer + Spot MIG Weld (Fig. 1)

[Method 2] Adhesive (3M™ Automix™ Panel Bonding Adhesive #8115) + Spot MIG Weld (Fig. 2)

[Method 3] Adhesive (3M™ Automix™ Panel Bonding Adhesive #8115) (Fig. 3)

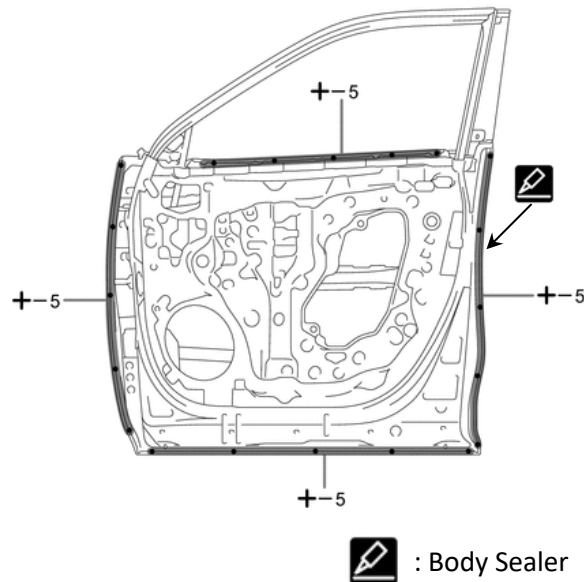


Fig. 1 Body Sealer + Spot MIG Weld

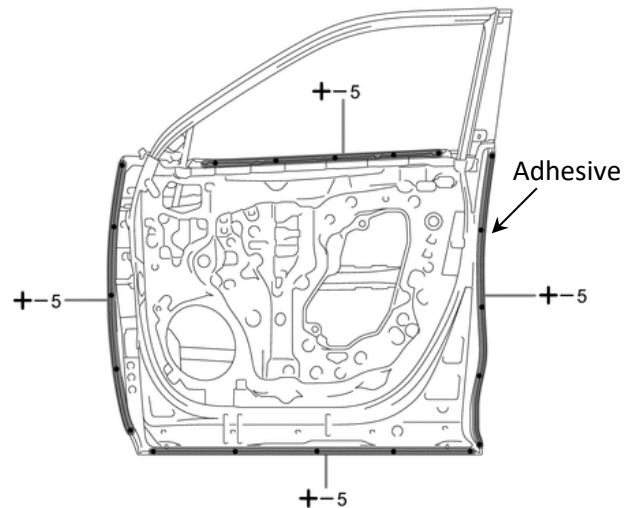


Fig. 2 Adhesive + Spot MIG Weld

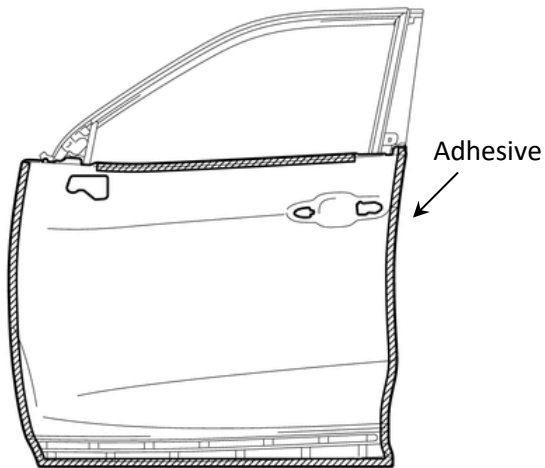


Fig. 3 Adhesive

Repair:

Models and model years with installation method #1 and #2 can be substituted to installation method #3.

Hemming thickness must be within 0.2mm of the original door hemming thickness.

NOTE: This applies only to hemming area. Other areas of repair procedures have to be followed per Collision Repair Manual. (e.g. body sealer to door reinforcement, plug weld)

For more information on this and other important collision repair topics visit the Toyota Technical Information System (TIS)