Main-level plywood marking sheets


Every point to mark on each 4 x 8 sheet, measured in from the LEFT and TOP factory edges, in the cut plan's orientation.

- How to use: lay the sheet good face up with the same edge at the top as the cut-plan sheet. Measure each mark along the top edge (from left) and down (from top) with a square or a story stick; tick it, then join the marks.
- Straight edges: join the two corner marks with a straightedge or a snapped line.
- Arcs: the table gives the radius and the centre. If the centre is on the sheet, mark it and swing a trammel (or the router on a trammel arm) from the arc start to the next mark; the mid-arc check should fall on the line. If the centre is off the sheet, spring a batten through the check points instead.
- Free curves (eased edges, the board's S-curve, the turnback): mark the points every 3 in and spring a thin batten through them.
- Marks on the sheet edge need no measuring in that direction. Points are to the nearest 1/16 in, and an edge is read as an arc when it stays within 1/16 in of one; cut on the waste side of the line. Pieces drawn flipped in the cut plan are marked as drawn.
- Check before cutting: measure one long diagonal of each rectangle-like piece against the drawing, and confirm the piece sizes in the cut plan (the bounding sizes are listed there).

Sheets: A (3/4): N1 · N2 · F3 B (3/4): W2 · W3 C (3/4): W1 · B3 · B1 D (3/4): G2 · G3 · B2 · G4 · G1 E (1/2): H1 · L9
F (1/2): S4 · L3 G (1/2): S2 · L1 H (1/2): L7 · L2 · H2 I (1/2): L5 · S1 · L4

Sheet A (3/4 in): N1 · N2 · F3

Orange dots = corners / arc and curve starts (numbered); grey = check points along arcs and curves; orange cross = trammel centre on the sheet.

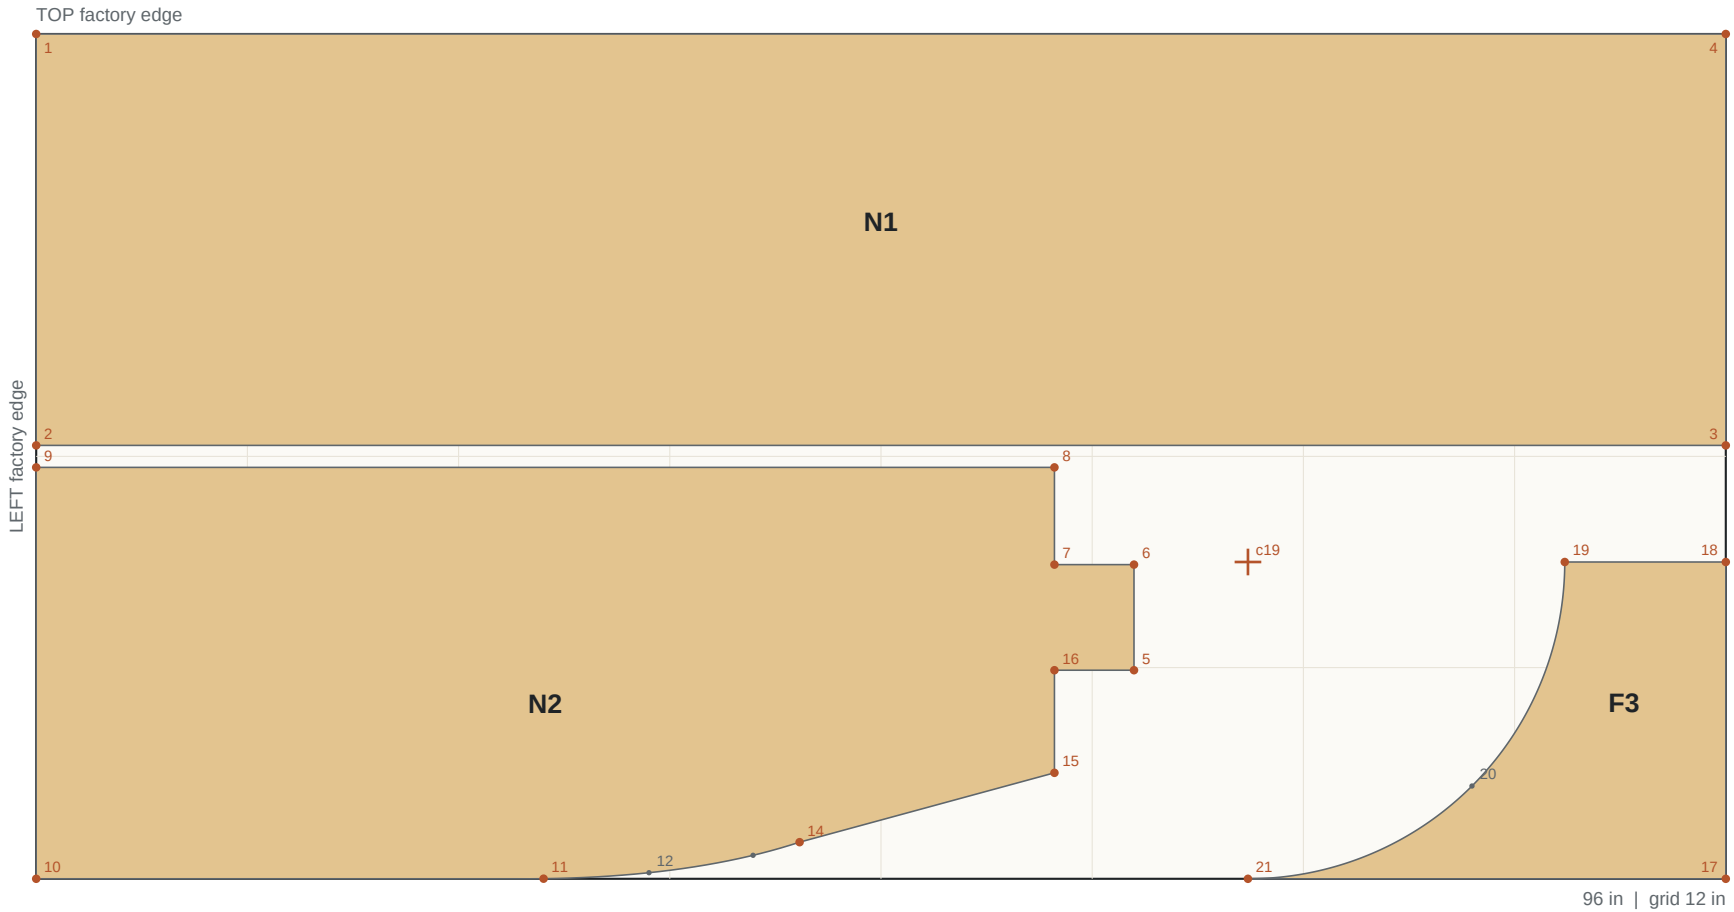


96 in | grid 12 in

#	piece	from left	from top	
1	N1	edge	edge	
2	N1	edge	23-3/8	
3	N1	96	23-3/8	
4	N1	96	edge	
5	N2	62-3/8	36-1/8	
6	N2	62-3/8	30-1/8	
7	N2	57-7/8	30-1/8	
8	N2	57-7/8	24-5/8	
9	N2	edge	24-5/8	
10	N2	edge	48	
11	N2	28-13/16	48	arc R 49-1/2 · ctr off sheet
12	N2	34-13/16	47-5/8	arc check
13	N2	40-3/4	46-11/16	arc check

#	piece	from left	from top	
14	N2	43-3/8	45-15/16	
15	N2	57-7/8	42	
16	N2	57-7/8	36-1/8	
17	F3	96	48	
18	F3	96	30	
19	F3	86-7/8	30	arc R 18 · ctr 68-7/8, 30
20	F3	81-9/16	42-3/4	mid-arc check
21	F3	68-7/8	48	

Sheet B (3/4 in): W2 · W3

Orange dots = corners / arc and curve starts (numbered); grey = check points along arcs and curves; orange cross = trammel centre on the sheet.

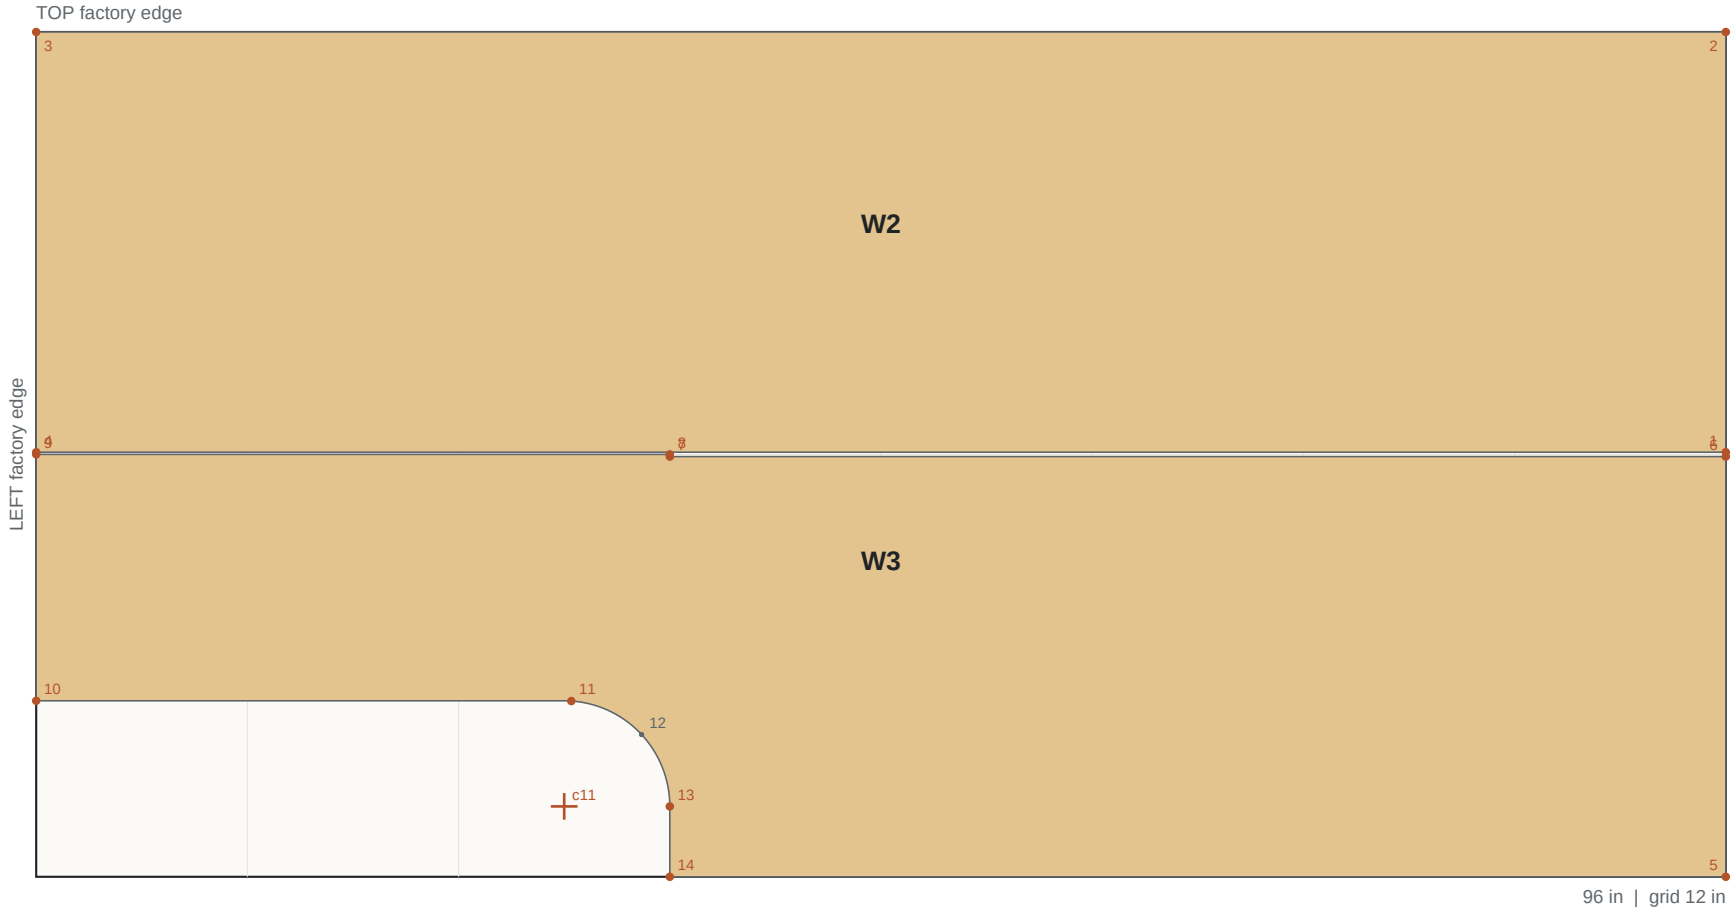


96 in | grid 12 in

#	piece	from left	from top	
1	W2	96	23-7/8	
2	W2	96	edge	
3	W2	edge	edge	
4	W2	edge	23-7/8	
5	W3	96	48	
6	W3	96	24-1/8	
7	W3	36	24-1/8	
8	W3	36	24	
9	W3	edge	24	
10	W3	edge	38	
11	W3	30-3/8	38	arc R 6 · ctr 30, 44
12	W3	34-3/8	39-15/16	mid-arc check
13	W3	36	44	

#	piece	from left	from top
14	W3	36	48

Sheet C (3/4 in): W1 · B3 · B1


Orange dots = corners / arc and curve starts (numbered); grey = check points along arcs and curves; orange cross = trammel centre on the sheet.

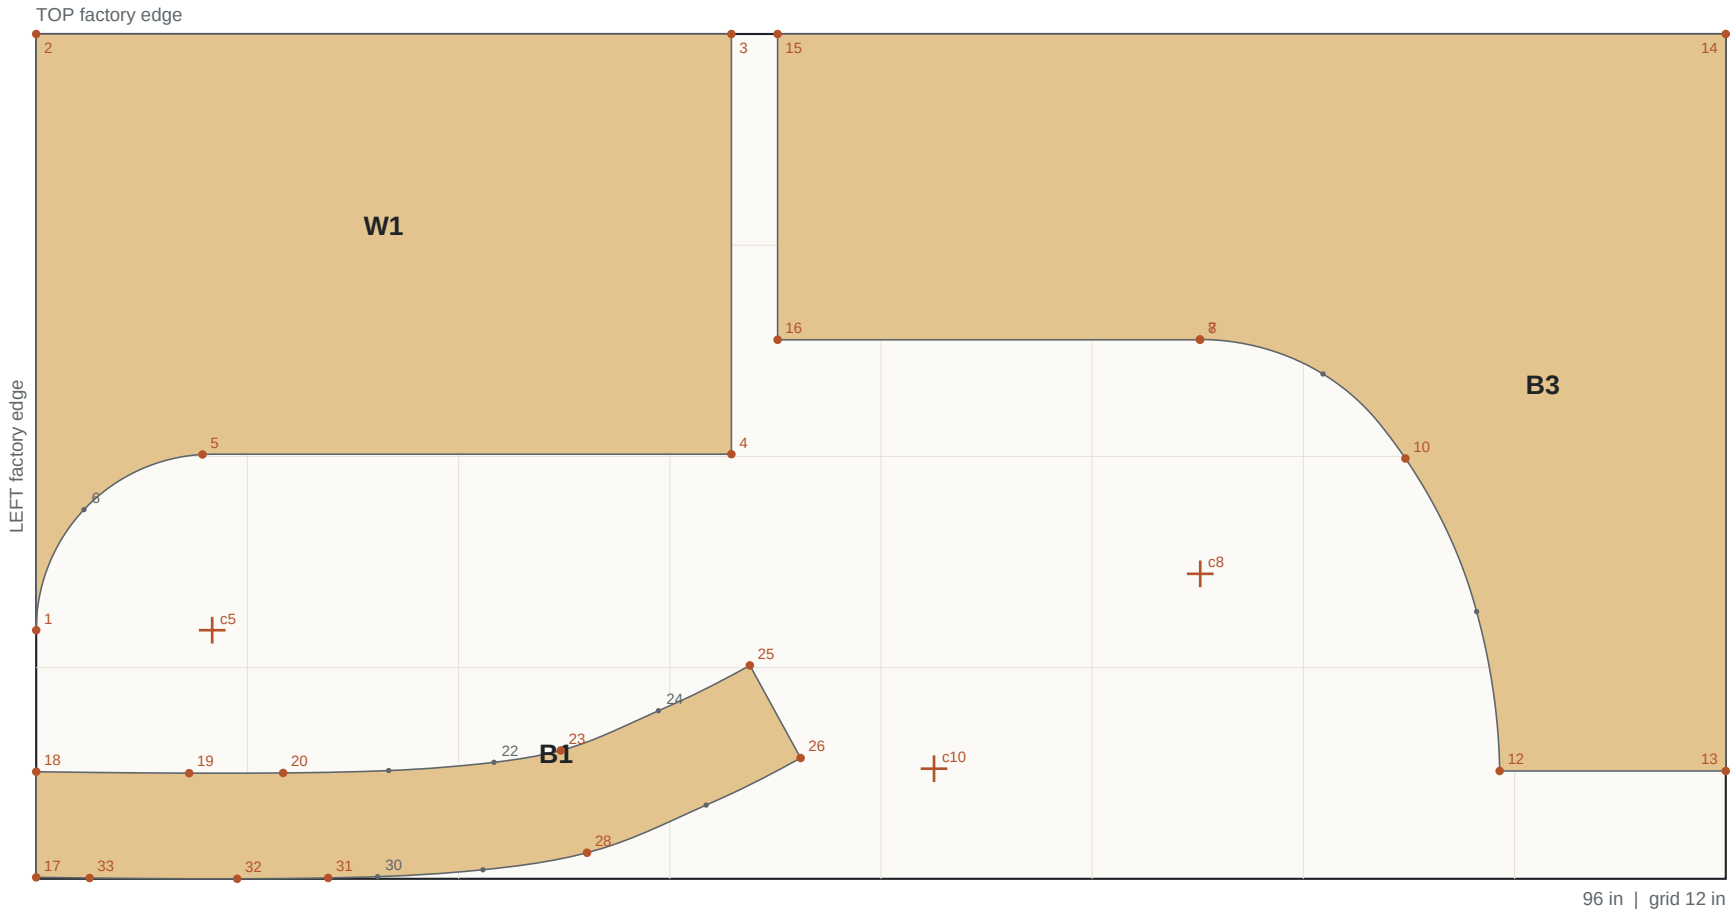

#	piece	from left	from top	
1	W1	edge	33-7/8	
2	W1	edge	edge	
3	W1	39-1/2	edge	
4	W1	39-1/2	23-7/8	
5	W1	9-7/16	23-7/8	arc R 10 · ctr 10, 33-7/8
6	W1	2-11/16	27	mid-arc check
7	B3	66-1/8	17-3/8	
8	B3	66-1/8	17-3/8	arc R 13-5/16 · ctr 66-1/8, 30-11/16
9	B3	73-1/8	19-5/16	mid-arc check
10	B3	77-13/16	24-1/8	arc R 32-1/8 · ctr 51, 41-3/4
11	B3	81-13/16	32-13/16	mid-arc check
12	B3	83-1/8	41-7/8	
13	B3	96	41-7/8	
14	B3	96	edge	
15	B3	42-1/8	edge	
16	B3	42-1/8	17-3/8	
17	B1	edge	47-15/16	
18	B1	edge	41-15/16	
19	B1	8-11/16	42	
20	B1	14	42	arc R 73-5/16 · ctr off sheet
21	B1	20	41-7/8	arc check
22	B1	26	41-3/8	arc check
23	B1	29-13/16	40-11/16	arc R 74-1/2 · ctr off sheet
24	B1	35-3/8	38-7/16	arc check
25	B1	40-9/16	35-7/8	
26	B1	43-7/16	41-1/8	arc R 71-5/8 · ctr off sheet
27	B1	38-1/16	43-13/16	arc check
28	B1	31-5/16	46-1/2	arc R 70-1/2 · ctr off sheet
29	B1	25-3/8	47-1/2	arc check
30	B1	19-3/8	47-7/8	arc check
31	B1	16-9/16	47-15/16	
32	B1	11-7/16	48	
33	B1	3-1/16	47-15/16	

Sheet D (3/4 in): G2 · G3 · B2 · G4 · G1

Orange dots = corners / arc and curve starts (numbered); grey = check points along arcs and curves; orange cross = trammel centre on the sheet.

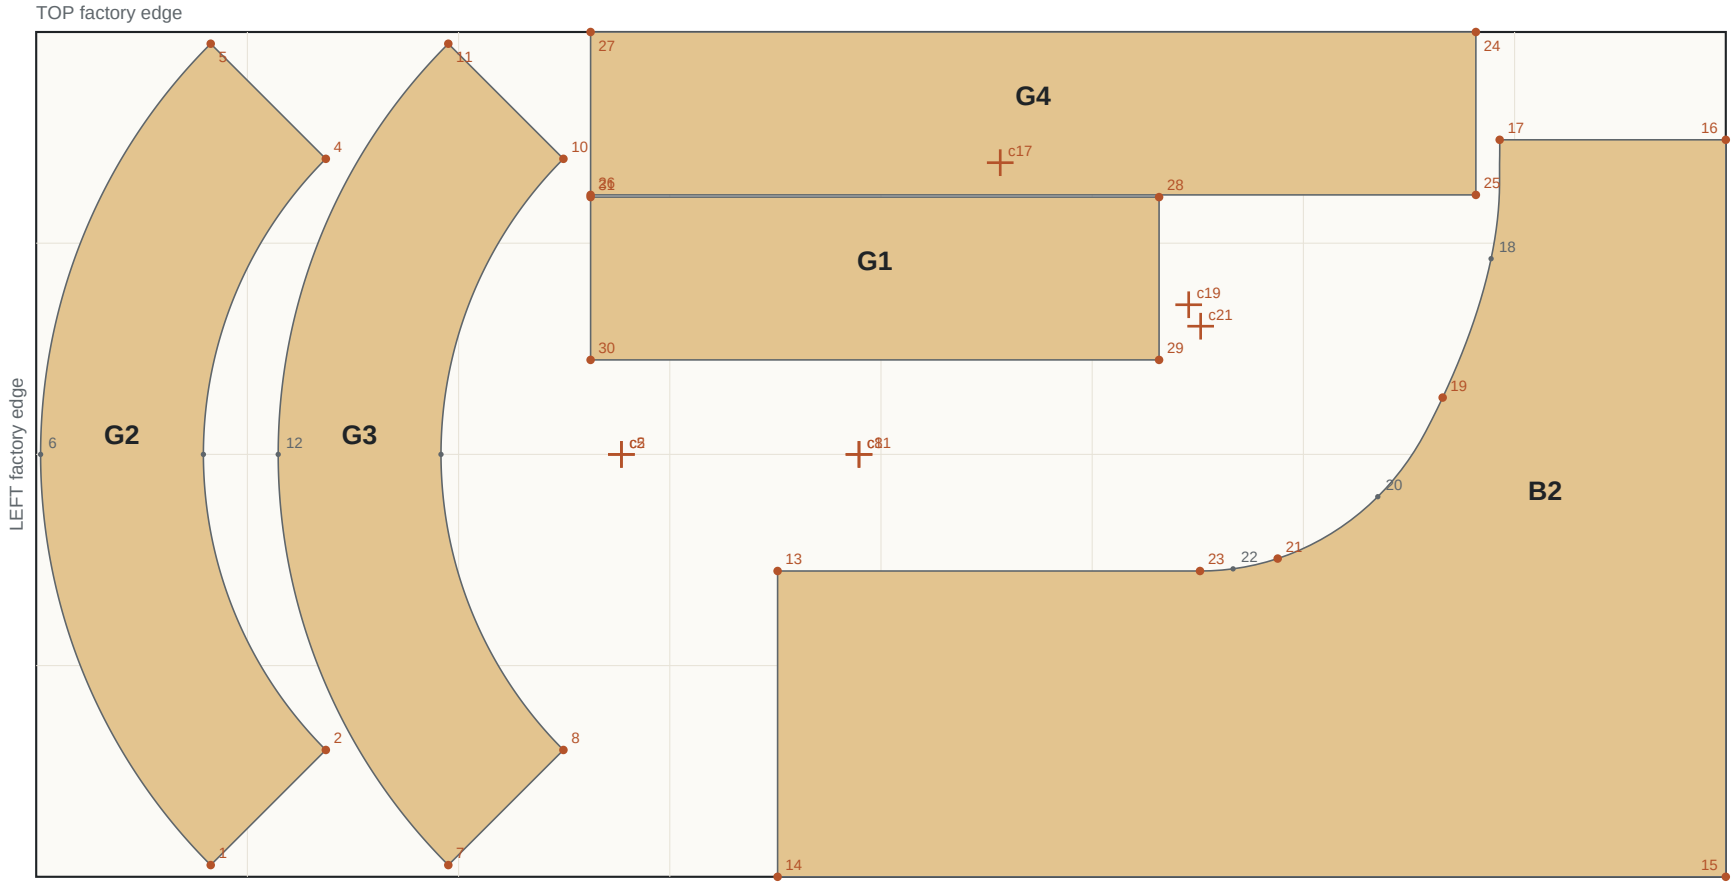


#	piece	from left	from top	
1	G2	9-15/16	47-5/16	
2	G2	16-7/16	40-13/16	arc R 23-3/4 · ctr 33-1/4, 24
3	G2	9-1/2	24	mid-arc check
4	G2	16-7/16	7-3/16	
5	G2	9-15/16	11/16	arc R 33 · ctr 33-1/4, 24
6	G2	1/4	24	mid-arc check
7	G3	23-7/16	47-5/16	
8	G3	29-15/16	40-13/16	arc R 23-3/4 · ctr 46-3/4, 24
9	G3	23	24	mid-arc check
10	G3	29-15/16	7-3/16	
11	G3	23-7/16	11/16	arc R 33 · ctr 46-3/4, 24
12	G3	13-3/4	24	mid-arc check
13	B2	42-1/8	30-5/8	

#	piece	from left	from top	
14	B2	42-1/8	48	
15	B2	96	48	
16	B2	96	6-1/8	
17	B2	83-1/8	6-1/8	arc R 28-3/8 · ctr 54-3/4, 7-7/16
18	B2	82-11/16	12-7/8	mid-arc check
19	B2	79-15/16	20-3/4	arc R 15-5/16 · ctr 65-1/2, 15-1/2
20	B2	76-1/4	26-3/8	mid-arc check
21	B2	70-9/16	29-15/16	arc R 13-15/16 · ctr 66-3/16, 16-11/16
22	B2	68	30-1/2	mid-arc check
23	B2	66-1/8	30-5/8	
24	G4	81-13/16	edge	
25	G4	81-13/16	9-1/4	
26	G4	31-1/2	9-1/4	

#	piece	from left	from top
27	G4	31-1/2	edge
28	G1	63-13/16	9-3/8
29	G1	63-13/16	18-5/8
30	G1	31-1/2	18-5/8
31	G1	31-1/2	9-3/8

Sheet E (1/2 in): H1 · L9

Orange dots = corners / arc and curve starts (numbered); grey = check points along arcs and curves; orange cross = trammel centre on the sheet.

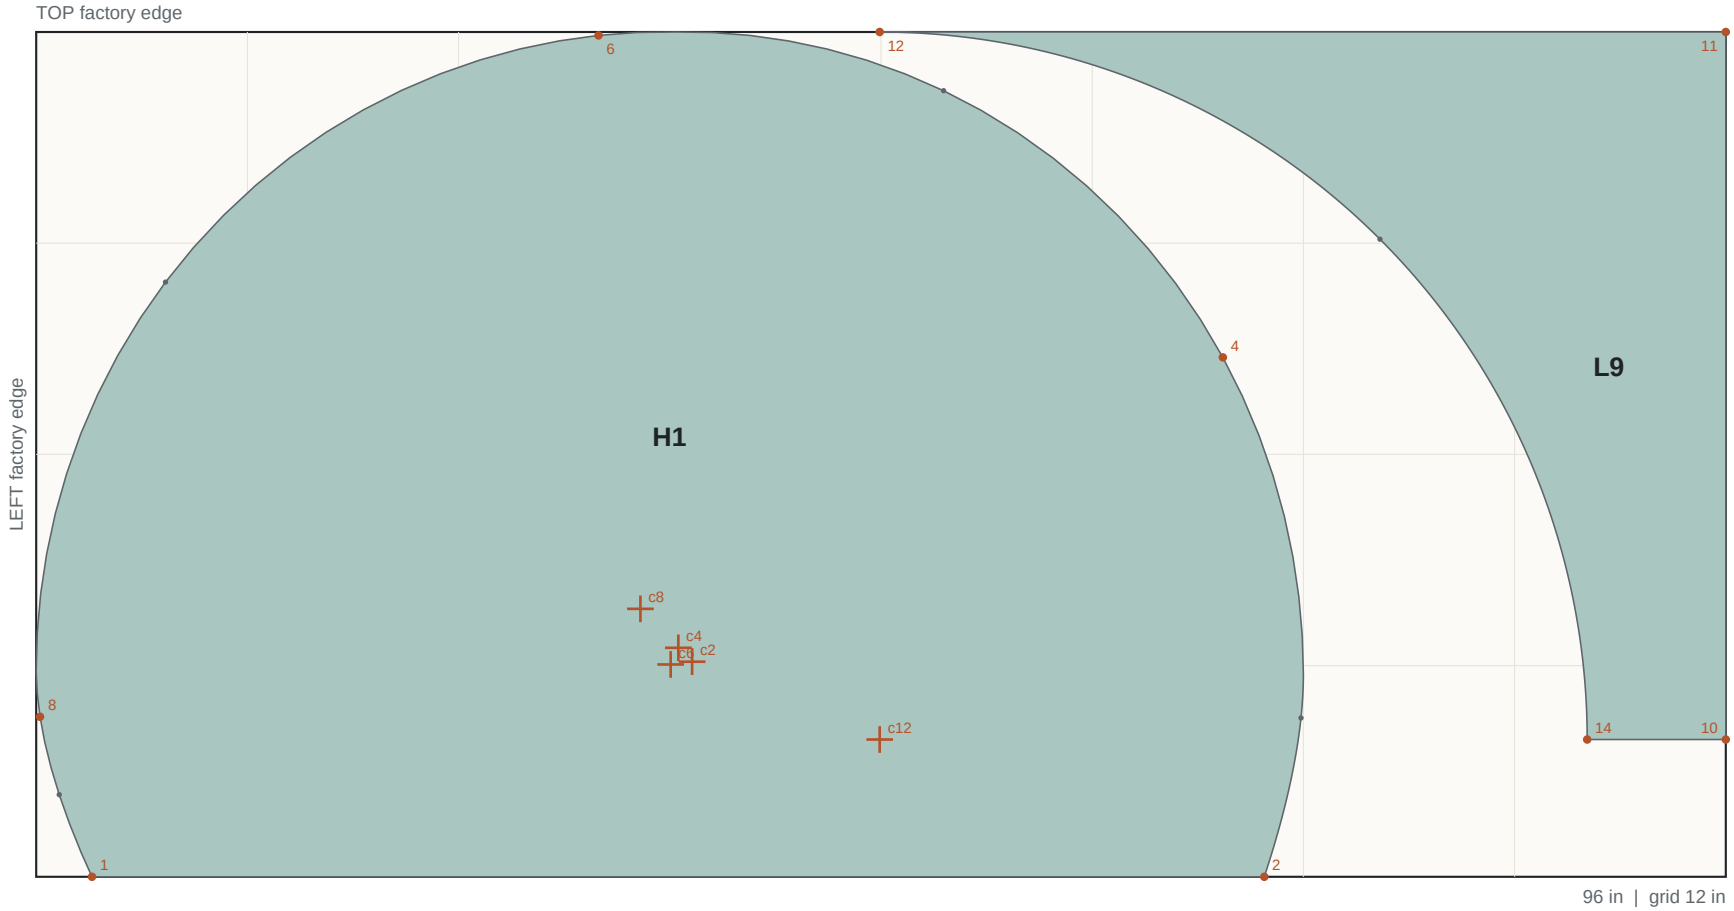


#	piece	from left	from top	
1	H1	3-3/16	48	
2	H1	69-3/4	48	arc R 34-11/16 · ctr 37-1/4, 35-3/4
3	H1	71-7/8	39	mid-arc check
4	H1	67-7/16	18-1/2	arc R 35-1/16 · ctr 36-1/2, 35
5	H1	51-9/16	3-5/16	mid-arc check
6	H1	31-15/16	3/16	arc R 36 · ctr 36-1/16, 35-15/16
7	H1	7-3/8	14-3/16	mid-arc check
8	H1	3/16	38-15/16	arc R 34-11/16 · ctr 34-5/16, 32-3/4
9	H1	1-5/16	43-5/16	mid-arc check
10	L9	96	40-3/16	
11	L9	96	edge	
12	L9	47-15/16	edge	arc R 40-3/16 · ctr 47-15/16, 40-3/16
13	L9	76-3/8	11-3/4	mid-arc check

#	piece	from left	from top
14	L9	88-1/8	40-3/16

Sheet F (1/2 in): S4 · L3

Orange dots = corners / arc and curve starts (numbered); grey = check points along arcs and curves; orange cross = trammel centre on the sheet.

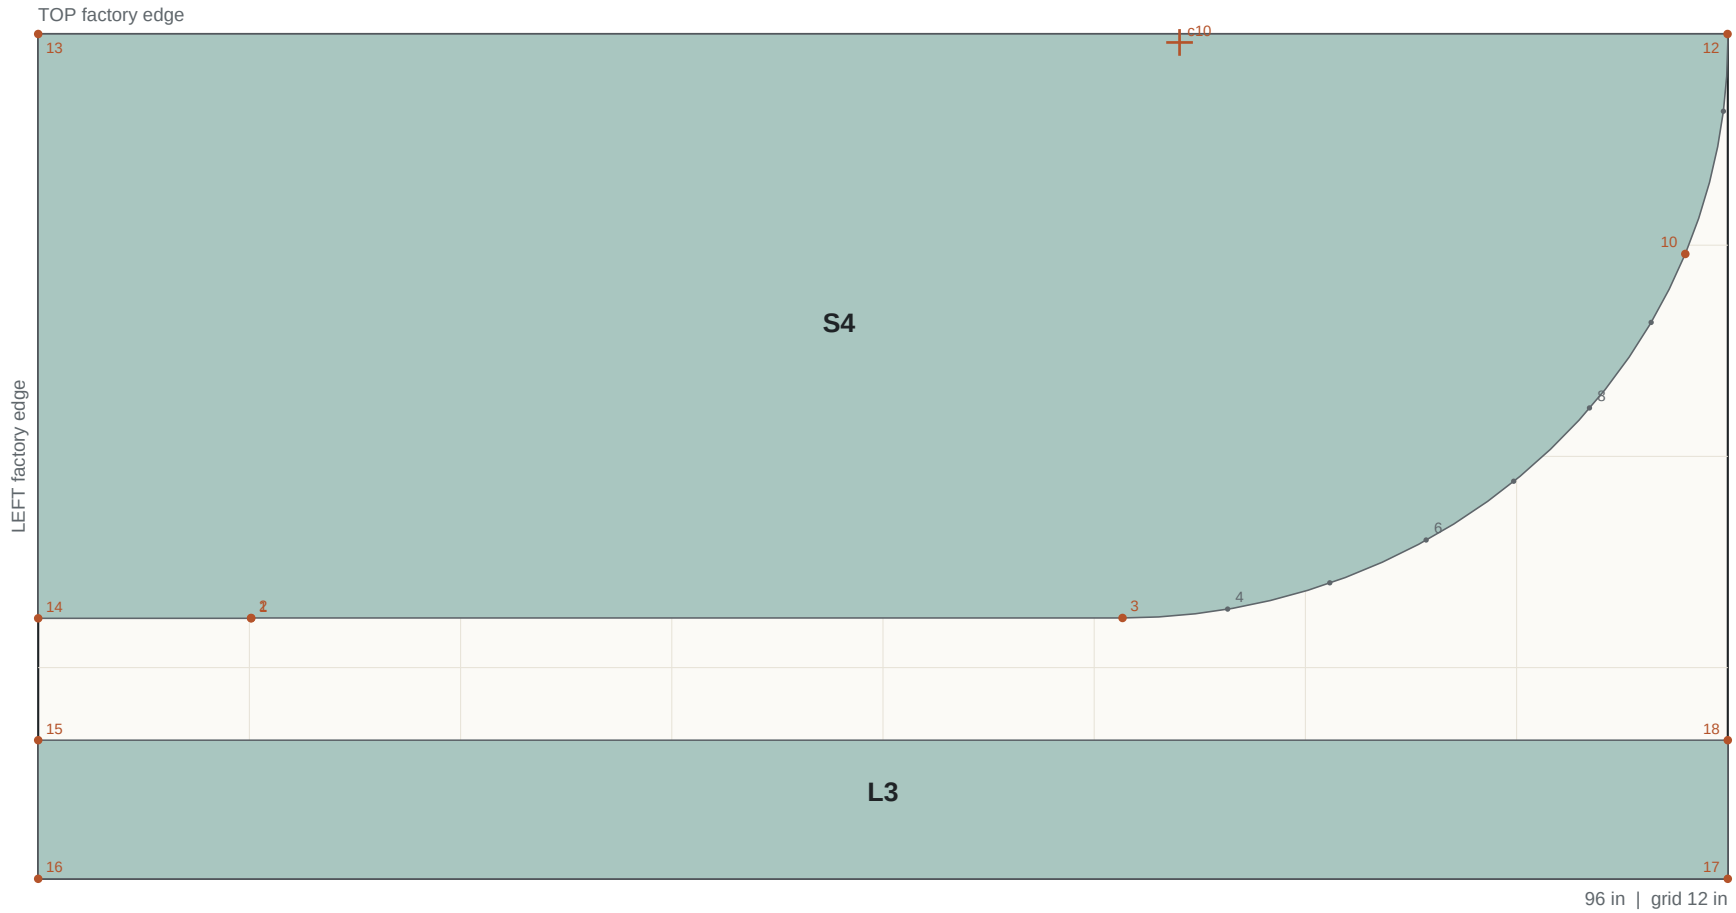


#	piece	from left	from top	
1	S4	12-1/8	33-3/16	
2	S4	12-1/8	33-3/16	
3	S4	61-5/8	33-3/16	arc R 34-7/16 · ctr off sheet
4	S4	67-9/16	32-11/16	arc check
5	S4	73-3/8	31-3/16	arc check
6	S4	78-7/8	28-3/4	arc check
7	S4	83-13/16	25-7/16	arc check
8	S4	88-1/8	21-1/4	arc check
9	S4	91-5/8	16-3/8	arc check
10	S4	93-9/16	12-1/2	arc R 31-1/8 · ctr 64-7/8, 1/2
11	S4	95-3/4	4-3/8	mid-arc check
12	S4	96	edge	
13	S4	edge	edge	

#	piece	from left	from top
14	S4	edge	33-3/16
15	L3	edge	40-1/8
16	L3	edge	48
17	L3	96	48
18	L3	96	40-1/8

Sheet G (1/2 in): S2 · L1

Orange dots = corners / arc and curve starts (numbered); grey = check points along arcs and curves; orange cross = trammel centre on the sheet.

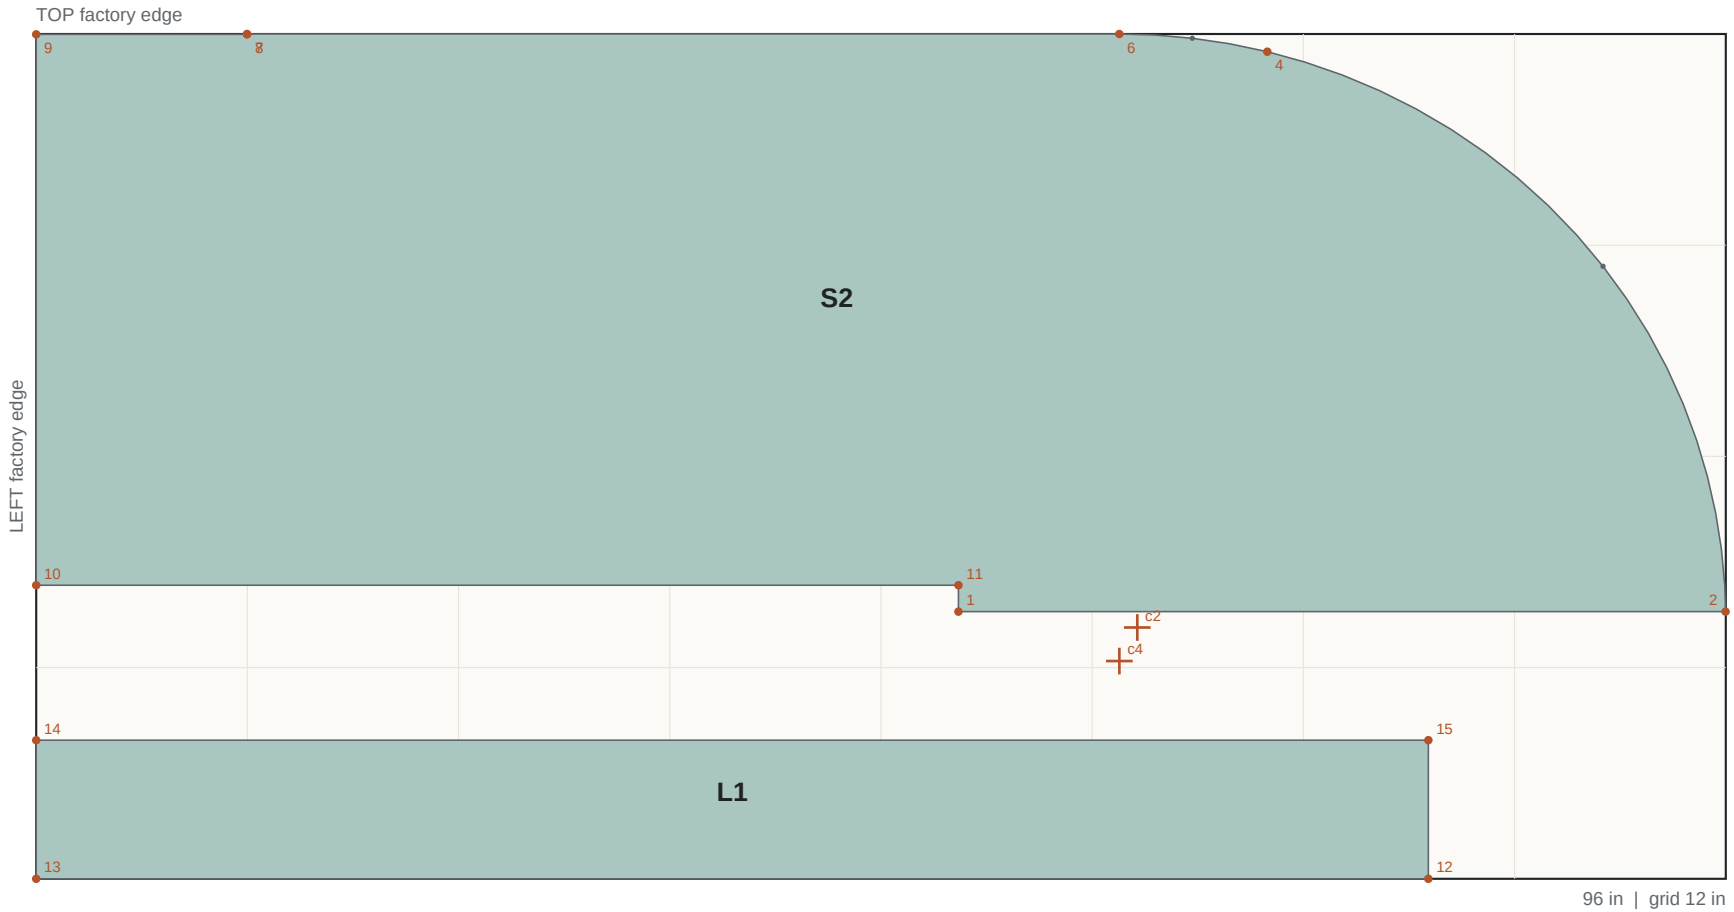


#	piece	from left	from top	
1	S2	52-3/8	32-13/16	
2	S2	96	32-13/16	arc R 33-1/2 · ctr 62-9/16, 33-3/4
3	S2	89	13-3/16	mid-arc check
4	S2	69-15/16	1	arc R 35-5/8 · ctr 61-9/16, 35-5/8
5	S2	65-11/16	1/4	mid-arc check
6	S2	61-9/16	edge	
7	S2	12	edge	
8	S2	12	0	
9	S2	edge	0	
10	S2	edge	31-5/16	
11	S2	52-3/8	31-5/16	
12	L1	79-1/8	48	
13	L1	edge	48	

#	piece	from left	from top
14	L1	edge	40-1/8
15	L1	79-1/8	40-1/8

Sheet H (1/2 in): L7 · L2 · H2

Orange dots = corners / arc and curve starts (numbered); grey = check points along arcs and curves; orange cross = trammel centre on the sheet.

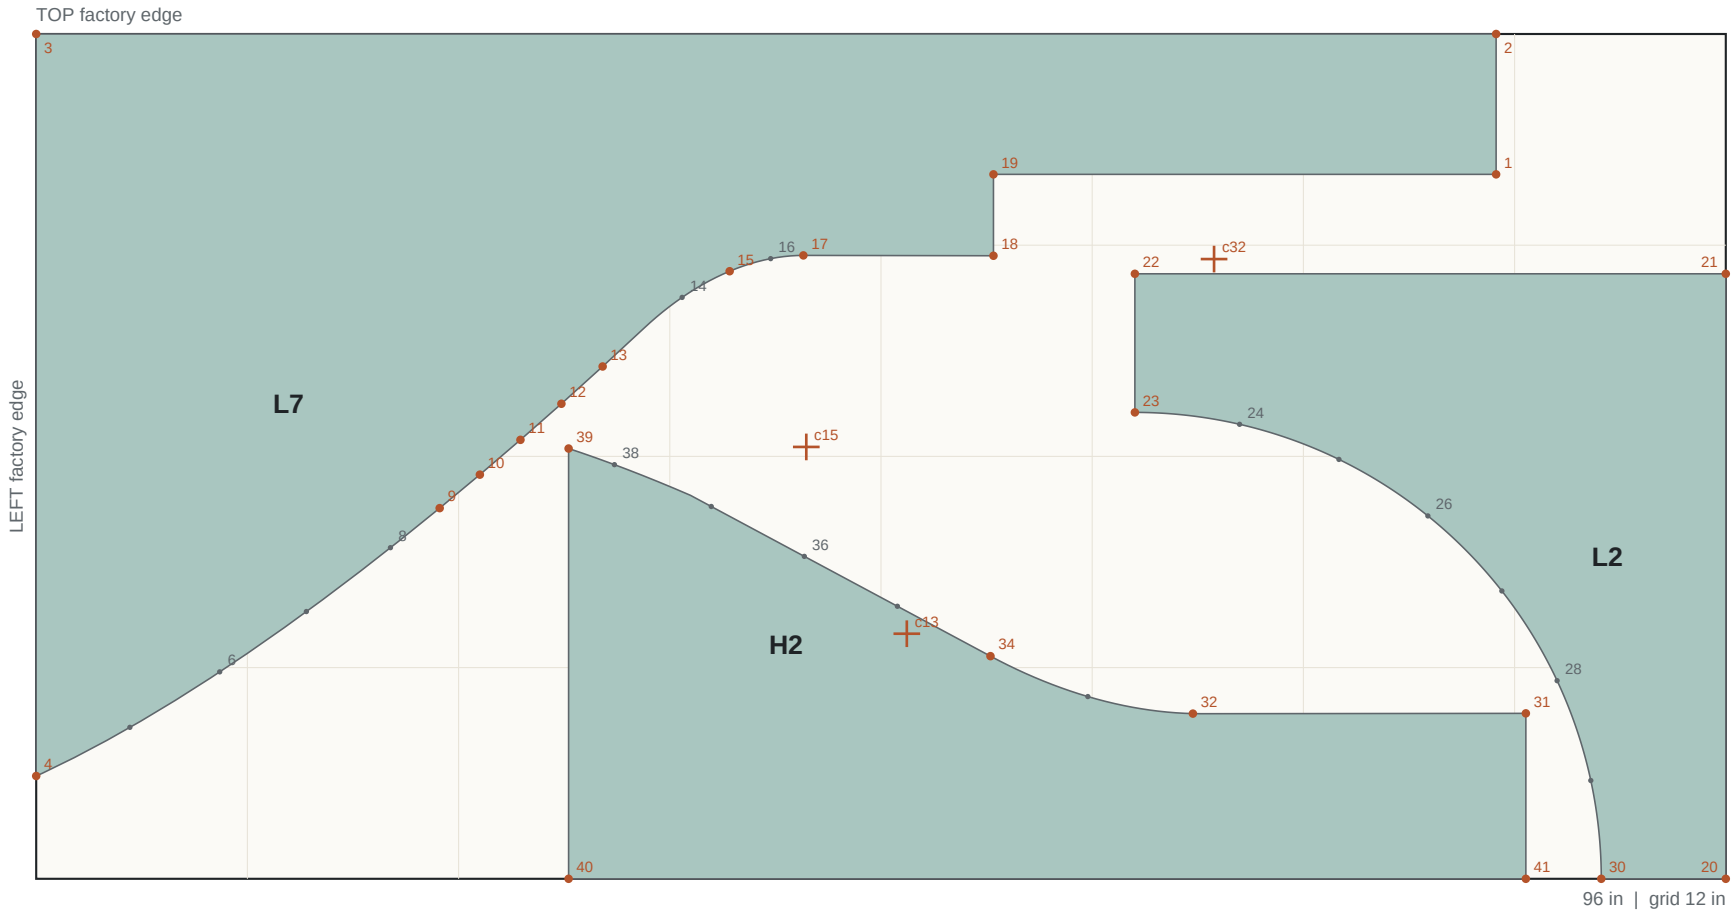

#	piece	from left	from top	
1	L7	82-15/16	8	
2	L7	82-15/16	edge	
3	L7	edge	edge	
4	L7	edge	42-3/16	arc R 111 · ctr off sheet
5	L7	5-5/16	39-3/8	arc check
6	L7	10-7/16	36-1/4	arc check
7	L7	15-3/8	32-13/16	arc check
8	L7	20-1/8	29-3/16	arc check
9	L7	22-15/16	26-15/16	
10	L7	25-3/16	25-1/16	
11	L7	27-1/2	23-1/16	
12	L7	29-13/16	21	
13	L7	32-3/16	18-7/8	arc R 22-15/16 · ctr 49-7/16, 34-1/16
14	L7	36-11/16	14-15/16	mid-arc check
15	L7	39-3/8	13-1/2	arc R 10-7/8 · ctr 43-3/4, 23-7/16
16	L7	41-3/4	12-3/4	mid-arc check
17	L7	43-9/16	12-9/16	
18	L7	54-3/8	12-5/8	
19	L7	54-3/8	8	
20	L2	96	48	
21	L2	96	13-5/8	
22	L2	62-7/16	13-5/8	
23	L2	62-7/16	21-1/2	arc R 26-1/2 · ctr off sheet
24	L2	68-3/8	22-3/16	arc check
25	L2	74	24-3/16	arc check
26	L2	79-1/16	27-3/8	arc check
27	L2	83-1/4	31-5/8	arc check
28	L2	86-7/16	36-3/4	arc check
29	L2	88-5/16	42-7/16	arc check
30	L2	88-15/16	48	
31	H2	84-5/8	38-5/8	
32	H2	65-3/4	38-5/8	arc R 25-7/8 · ctr 66-15/16, 12-13/16
33	H2	59-3/4	37-5/8	mid-arc check
34	H2	54-1/4	35-3/8	arc R 106-3/8 · ctr off sheet
35	H2	48-15/16	32-1/2	arc check
36	H2	43-5/8	29-11/16	arc check
37	H2	38-3/8	26-7/8	arc check
38	H2	32-7/8	24-1/2	arc check
39	H2	30-1/4	23-9/16	


Sheet H (1/2 in): marks, continued

From left = along the top edge; from top = down from the top edge. Inches, nearest 1/16.

#	piece	from left	from top
40	H2	30-1/4	48
41	H2	84-5/8	48

Sheet I (1/2 in): L5 · S1 · L4

Orange dots = corners / arc and curve starts (numbered); grey = check points along arcs and curves; orange cross = trammel centre on the sheet.

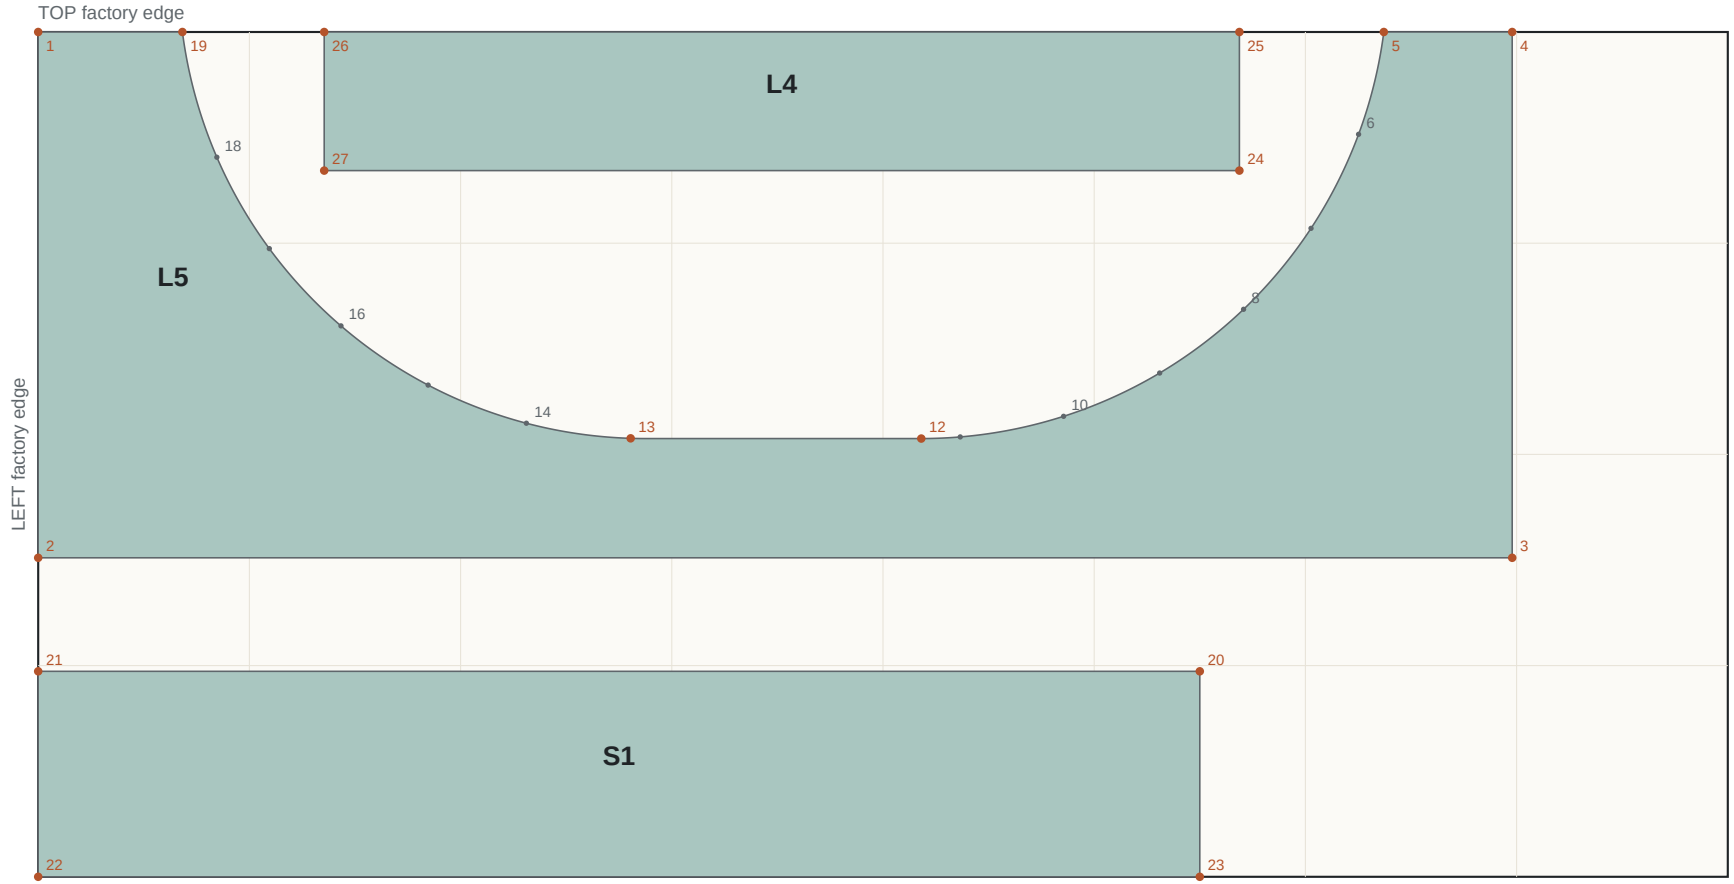

96 in | grid 12 in

#	piece	from left	from top	
1	L5	edge	edge	
2	L5	edge	29-7/8	
3	L5	83-3/4	29-7/8	
4	L5	83-3/4	edge	
5	L5	76-7/16	edge	arc R 26-1/2 · ctr off sheet
6	L5	75	5-13/16	arc check
7	L5	72-5/16	11-1/8	arc check
8	L5	68-1/2	15-3/4	arc check
9	L5	63-3/4	19-3/8	arc check
10	L5	58-1/4	21-13/16	arc check
11	L5	52-3/8	23	arc check
12	L5	50-3/16	23-1/8	
13	L5	33-11/16	23-1/16	arc R 26-1/2 · ctr off sheet
14	L5	27-3/4	22-1/4	arc check
15	L5	22-1/8	20-1/16	arc check
16	L5	17-3/16	16-11/16	arc check
17	L5	13-1/8	12-5/16	arc check
18	L5	10-1/8	7-1/8	arc check
19	L5	8-3/16	edge	
20	S1	66	36-5/16	
21	S1	edge	36-5/16	
22	S1	edge	48	
23	S1	66	48	
24	L4	68-1/4	7-7/8	
25	L4	68-1/4	edge	
26	L4	16-1/4	edge	
27	L4	16-1/4	7-7/8	