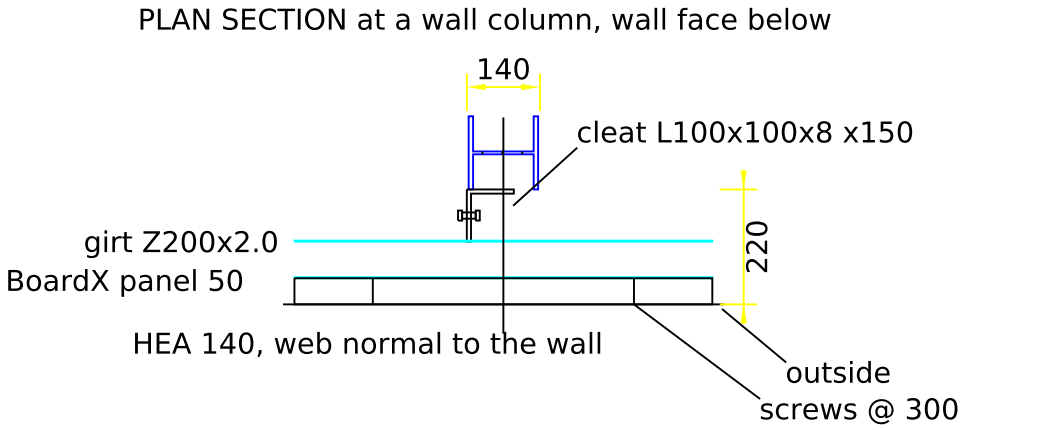
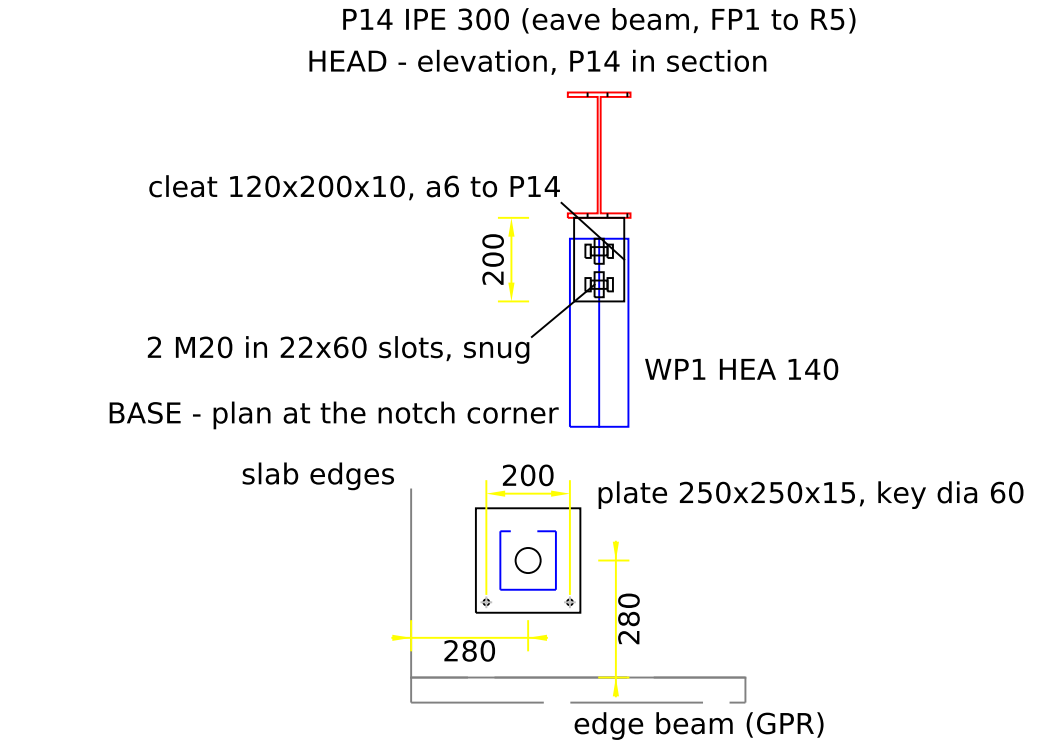
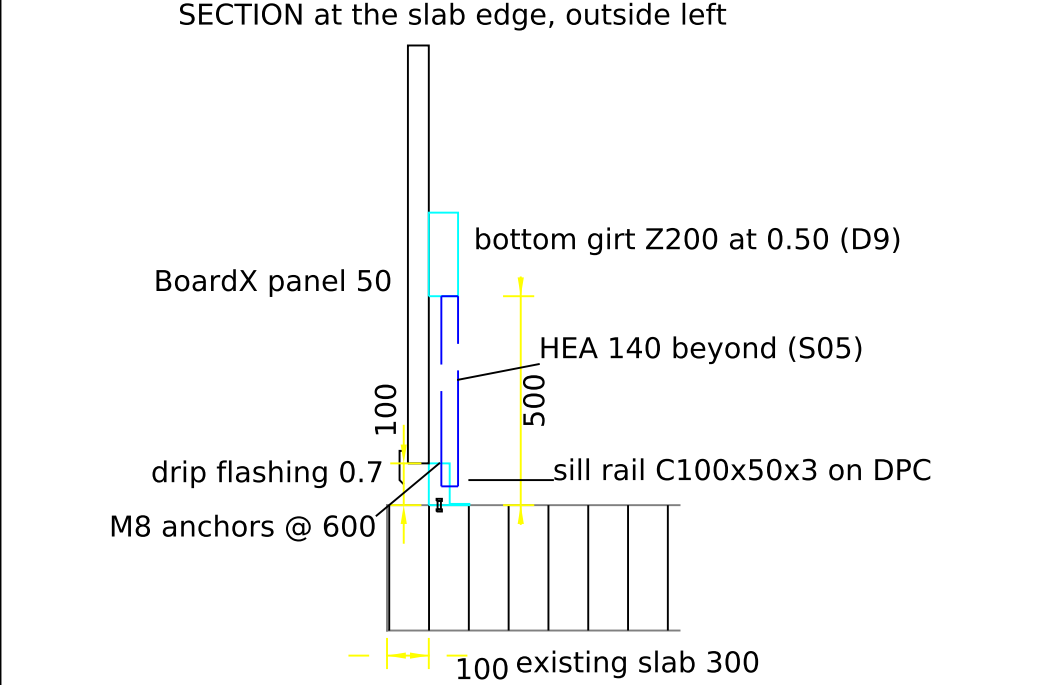


PLAN SECTION at a wall column, wall face below  GIRTSpan column to column (sleeved on the 1.0 / 1.2 m rows K5-K7, K25-K19, K8-K6, K21-K22, K22-K23, K14-K4); rows 1.5 m elsewhere; bottom row 0.50 above the slab (sill D11), top row 150 below the eave beam; corner columns cleats on both flanges. Cleat bolts M12 8.8. D9 S04 GIRT, PANEL Z200x2.0 girt on an L100x100x8 x 150 cleat to the column flange (2 M12); BoardX panel on the girt outer flange, screws @ 300 scale 5x	P14 IPE 300 (eave beam, FP1 to R5) HEAD - elevation, P14 in section  Post centre 280 mm inboard of both slab edges: single dia 60 key with c1 = 250 both ways (41.9 kN vs 11.4 / 8.5 kN, 0.27); 2 M12 for location only; corner girts cantilever 280 to the wall line. Notch edge beam by GPR (else two Key B). D10 S04 WIND POST HEA 140 at (77.61, 20.25), 280 inboard of the notch corner: slotted head to eave beam P14 (2 M20 in 22x60 slots); base 250x250x15, one dia 60 key, 2 M12 scale 4x	SECTION at the slab edge, outside left  Wall base line 100 mm inside the slab face on all faces; panel bottom 100 above the slab; the sill carries the panel weight to the slab and closes the wall against water (drip outside). Hall-side well walls: blockwork on the existing well walls, by the architect. D11 S04 WALL SILL BoardX wall base at the slab edge: C100x50x3 sill rail on the slab, M8 anchors @ 600, drip flashing; bottom girt 0.50 above; well walls hall-side: blockwork (architect) scale 4x	Steel S275 J0; bolts 8.8 hot-dip galvanised, snug tight (no preload relied upon); M20 in 22 holes, M16 in 18, M12 in 14, M24 rods in 26; all holes round (no slots). Shop fillet welds a5-a8 as noted (E42 / S275 consumables). NO site welding on galvanised steel: rod gussets shop-welded to the primaries and bolted to the rafters (D5). Thermal: +/-30 K service, +45/-25 K erection; the E-W path B2 - RT-N-W - row F chord - RT-N-E - B1 carries 15 kN (wind) / 37 kN (erection) locked-in; designed for, no slotted holes. Rafter ends plumb-cut, no copes; primaries level on level cap plates (primary top TOS + 30, rafter top TOS); slope 6 % in the rafters only. Precamber 10-15 mm on the 9.2 m rafters R7-R10 (south spans) per design report Rev 6a; none on P13 (IPE 330). Fly braces at mid-span (L <= 6.6 m) and third points (7.5 / 9.2 m); anti-sag row at mid-span of every purlin span; purlin cleats 2 M12 8.8 (uplift ~11 kN, zone F). Erection: temporary plan bracing (crossed wire ropes or angles) in one rafter cell of each south band until the panels and purlin bridging are complete (S00 section 8). GN S04 NOTES General notes for D1-D11; see S00 for materials, bolts, welding, galvanising and tolerances scale 5x
--	--	---	--

DETAIL INDEX
D1 fin plates FP1 / FP2 (S04) - D2 cap plate - D3 chord tie - D4 bracing gusset - D5 roof rod gusset, RG-C combined gusset, R2 / R10 web clip - D6 well upstand (T2, R5 / R6, P8) - D7 eave and gutter - D8 purlin cleat and fly brace (S04); D9 girt cleat and wall panel - D10 wind post WP1 head and base - D11 wall sill / base rail (this sheet). Base details type E / P / WP1: S05.

PROJECT	SHEET TITLE	REVISIONS	CURRENT REVISION	DRAWING No.
Steel roof - Administration Building, Regatta Tourist Village, Tripoli	CONNECTION DETAILS D9 - D11, NOTES	32026-09-29Rev 6a (IPE 300/240, HEA 140), bases Rev 8, bracing Rev 5a	Rev 6a superstructure Rev 8 bases / bracing Rev 5a	RTV-ST-S04a
ALTERNATIVE C - POST-AND-BEAM BRACED STEEL ROOF, SANDWICH PANELS	Details drawn 4x or 5x in model space (scale in each frame); DIMENSION text = true mm (dimlfac 250 / 200)	22026-09-28Design Rev 3 / bases Rev 4b (critique C1-C15)	DATE 2026-09-29	S04a
Client: Regatta Tourist Village, Tripoli Issued by: Eng. MALEK ABOZRAIG (malek.abozraig@gmail.com) Units: m	Status: ISSUED FOR CONSTRUCTION subject to the site verification of S00 section 9	12026-09-27First issue: design Rev 2, bases Rev 3	Drawn: Designed: Checked: Approved:	