

AIR POLLUTION CONTROL - FIELD INSPECTION WORK SHEET

Key Punch Data:	County			Source			Emission			Ac. m			Date			Agency/		
	Number			Number			Point #			Type			Mo Day Yr			Indiv. ID		
Line 1	01101	02201	00003	003	997	113	1129282	111	11	11	11	11	11	11	11	11	11	
	1	3	4	7	8	12	13	15	16	18	52	54	59	66	68	80		

Compliance Status

Line 2 (Dup. cols. 1-15 from Line 1)

00151 01 11
16 16 78 80

(NOTE: Columns not shown must be left blank)
(Do not punch Line 2 if column 78 is blank)

Company: Martin-Marietta Cement

SIC: _____

Address: P.O. Box 529 Lyons

County: Boulder

Person Contacted: _____

Phone: _____

Inspected by: George Mathews

Time: _____ AM/PM

Notes on Emissions Testing Program for Limestone Dryer
C-12,444 (1).

1. Are 40 traverse points valid? My observations note that the port was 15' above the fan, rather than the 20' noted in the report.
2. Are points 7 and 20 valid since they are <1" from wall?
3. No fuel is indicated at time of SO₂ test.
4. I have checked some of my data data w/ Yorks data sheets and they concur.

049 58 12 x 1 17 2
14449 12

Key Punch Data:	County Number	Source Number	Emission Point #	Location	Date	Agency/Indiv. ID
					Mo Day Yr	
Line 1	0101	0220	000013	00131	199171	1421
	1 3 4	7 8	12	13 15	16 18	52
						54
						59
						66
						68
						80

Compliance Status

Line 2 (Dup. cols. 1-15 from Line 1)

00151
16 1801
7801
80

(NOTE: Columns not shown must be left blank)

(Do not punch Line 2 if column 78 is blank)

Company: Martin Marietta Cement - Western Div.

SIC: _____

Address: P.O. Box 529 Lyons CO 80540County: BoulderPerson Contacted: Gerald Anderson, Joe Zuzolo et al

Phone: _____

Inspected by: George Matthews, Jan BrowerTime: 12:30 - 3:45 AM/PM

1. Final approval and stack test observations of C-12,444-1, limestone dryer with baghouse control.
2. Pretest meeting, 9/20/82, 2:30 - 3:15 pm. Pretest report did not include much specific information on process data or testing protocol, but only broad outlines of EPA RM's 5 and 6. If these were followed and all quality assurances adhered to, testing could be expected to be accurate. Tester is York Research Consultants.
3. Test observations. Preliminary runs had been scheduled for Tuesday, 9/21/82; however, interruptions in processes cancelled this work. Testing on Wednesday, 9/22/82, was supposed to begin at 0900, but team did not arrive until late morning. Two BCHD personnel waited from 0845 until 1015 for the no-show. We were called at 1330 to observe testing which we did from 1400 to 1600. Preliminary runs, we were told, had been done. This first run was interrupted by process problems. On Friday, 9/24/82, 3 runs of RM 5 and RM 6 were performed. One BCHD observer inspected tests in afternoon, latter half of Run 2 and first part

of Run 3 of RM 5. Two runs of RM 6 were conducted simultaneously in other attack post. Major observation of problems were verifying the accurate placement of probe in attack and the team displayed considerable or Oroat analysis. Although a definite familiarity with methodology. Although a definite placeness in quality assurance (eg, previous testing the pitit take at end of Run 2 only after reminder by observer! cleaning probe on platform w/ only 2, not 6, strokes) was noted, the overall performance of the testing seemed adequate to this observer.

4. Recommend final approval of C-12,444-1 if attack testing report show compliance of measurements.

5. Time spent: 14.25 hours.


ACTION TYPE - DESCRIPTION

- 12 - Inspection
- 22 - Source Test
- 23 - Opacity Observation
- 24 - Odor Observation

COMPLIANCE STATUS CODES

- 0 - Unknown
- 1 - Not in Compliance
- 2 - In Compliance by Source Test
- 3 - In Compliance by Inspection
- 4 - In Compliance by Certification
- 5 - In Compliance with Increments of Progress
- 6 - Not in Compliance with Increments of Progress
- 7 - Unknown Compliance with Increments of Progress
- 8 - No Applicable Stat. Regulation
- 9 - In Compliance -- Closed Down

8/4/82

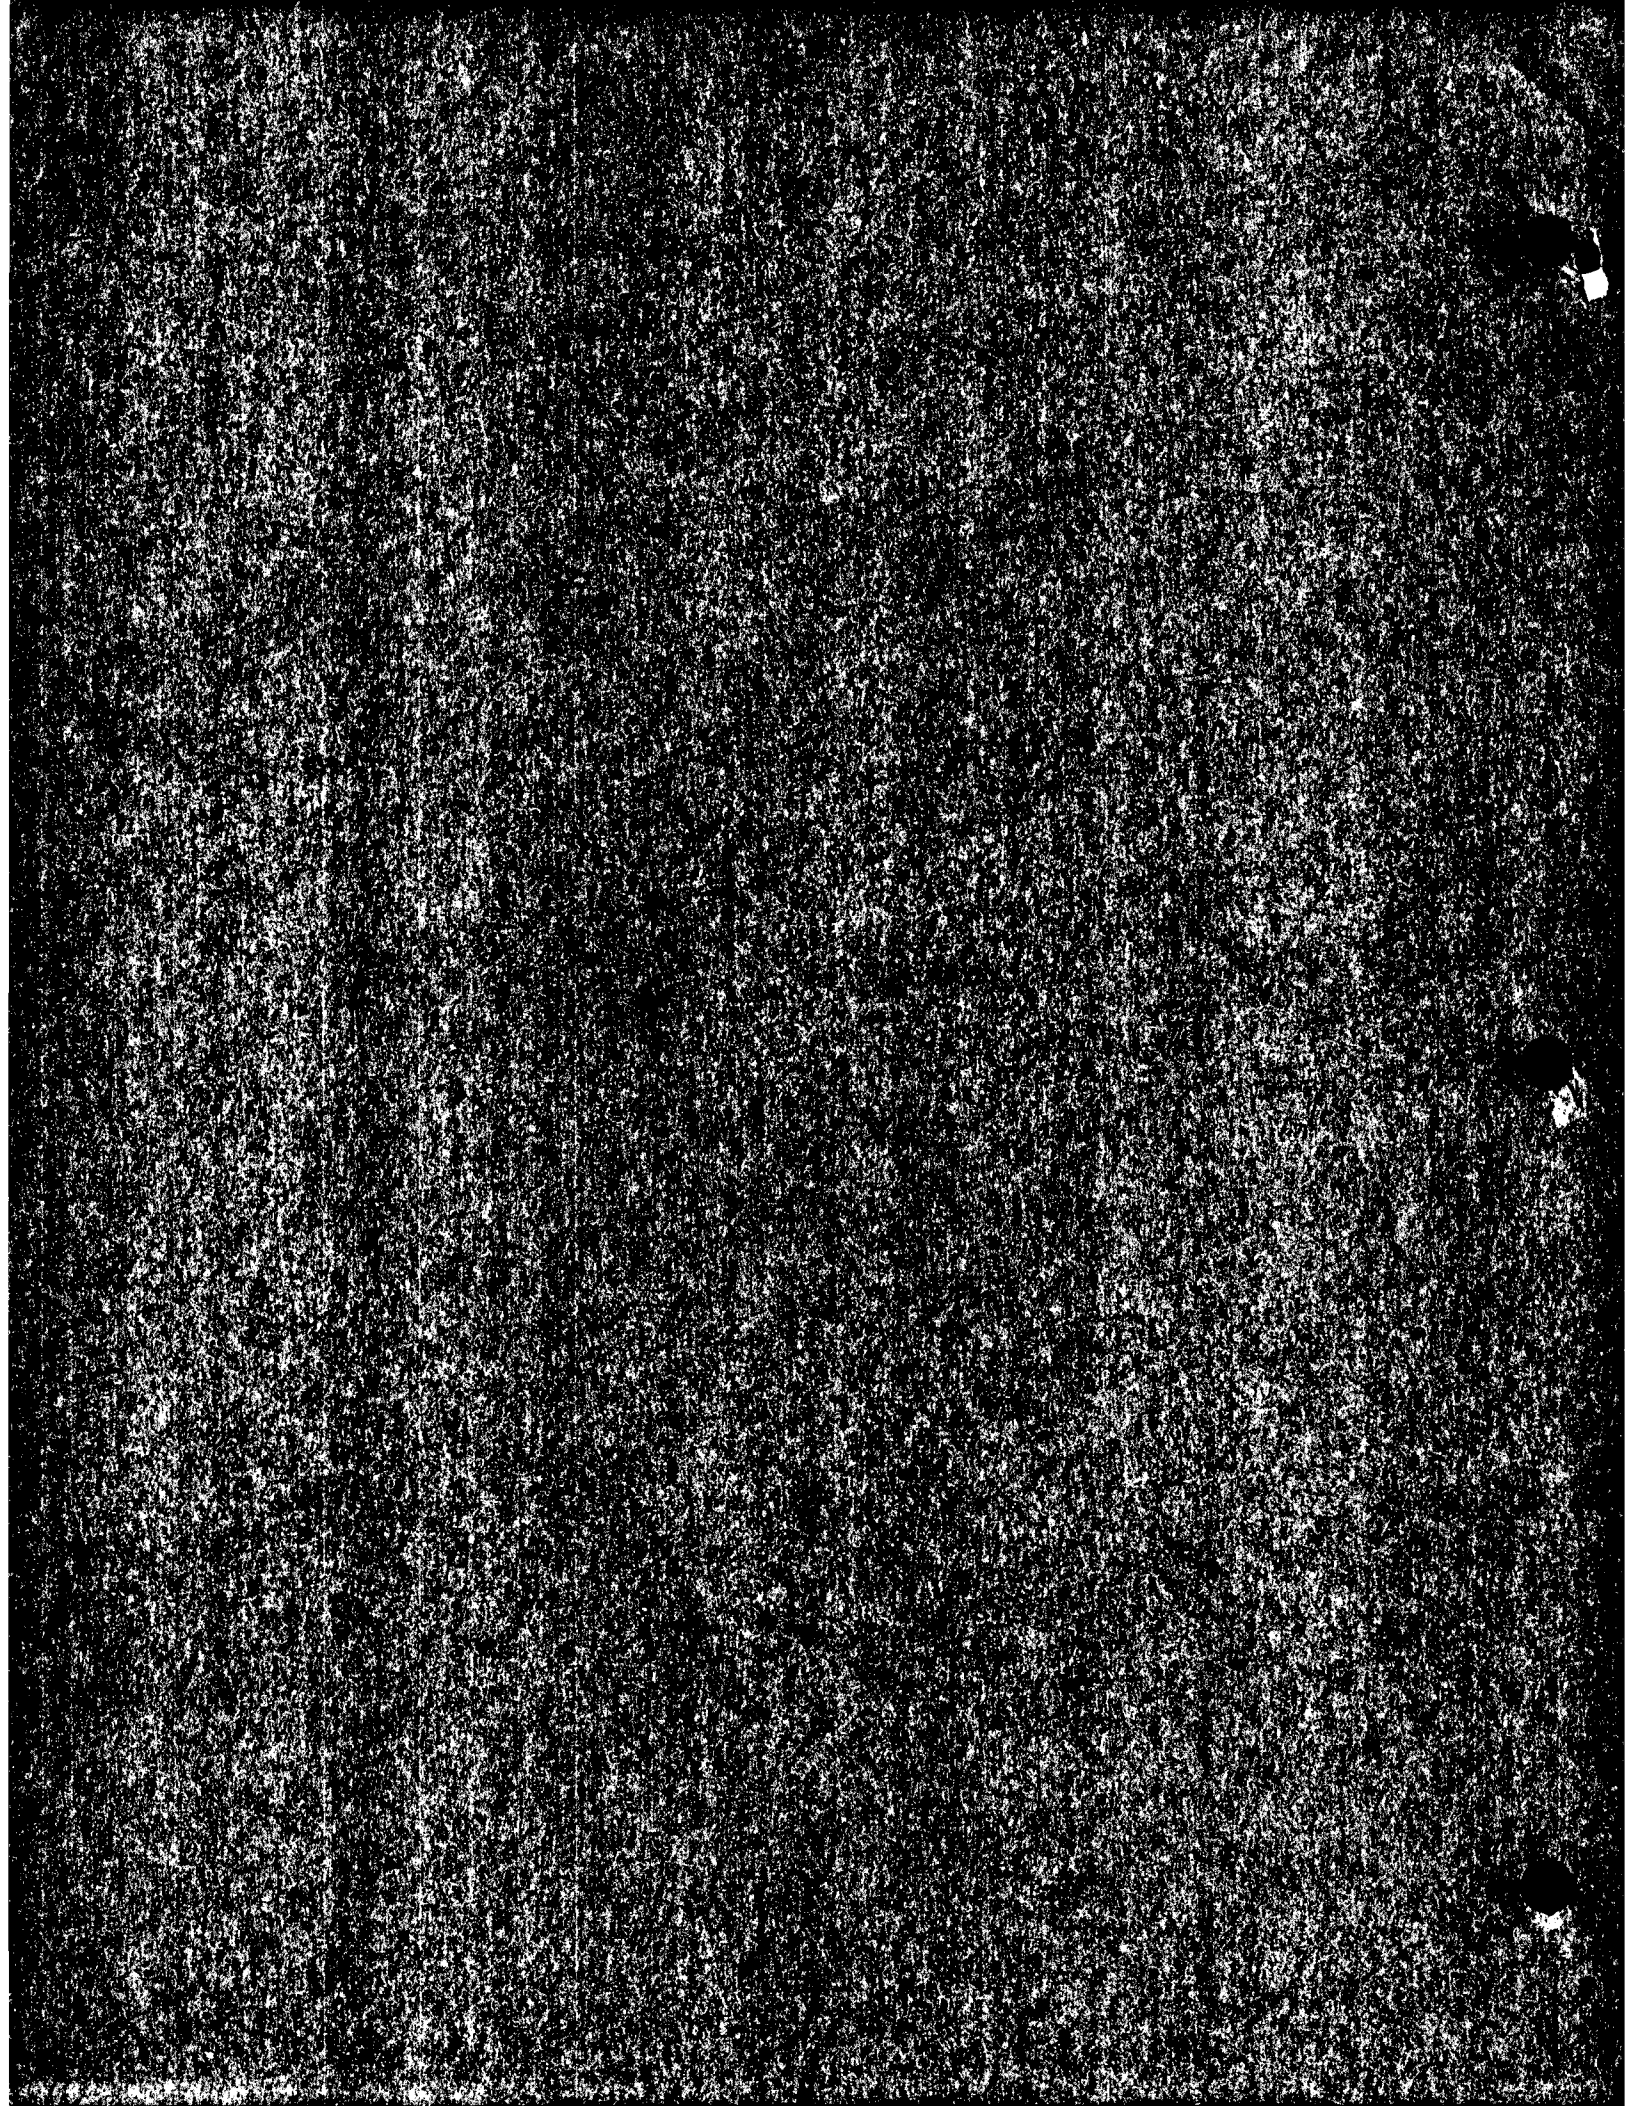

Line	Punch Data:			County	Area	Emission	Location	Date	Agency/							
	Number	Number	Number	Point #	Type	Mo	Day	Yr	Indiv. ID							
Line 1	01101	02201	00003	003	19917	1/12	02/04/82	1600								
	1	3	4	7	8	12	13	15	16	18	52	54	59	66	68	60

Compliance Status

Line 2 (Dup. cols. 1-15 from Line 1)

010151

16 18

1/1

78

101

80

(NOTE: Columns not shown must be left blank)

(Do not punch Line 2 if column 78 is blank)

Company: Martin-Marietta Cement, Western Division SIC: 3241Address: PO Box 529, Lyons County: BoulderPerson Contacted: NA

Phone: _____


Inspected by: George Mathew

Time: _____

AM/PM

C-12,444-2 (kin modifications permit) was recommended
for final approval 2/6/81 by Mark Parsons

Final approval on C-12,444-1 is ~~pending~~ on hold,
pending performance test results. See attached
copy of letter sent to Martin-Marietta.

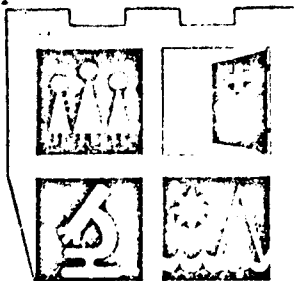

BOULDER COUNTY HEALTH DEPARTMENT

3450 BROADWAY

BOULDER, COLORADO 80302

JOHN H. DONNELLY, M.D., MPH
HEALTH OFFICER/DIRECTOR

August 5, 1982

Mr. Gerald Anderson, Operations Manager
Martin-Marietta Cement, Western Division
P.O. Box 529
Lyons, Colorado 80540

Re: Emission Permit C-12,444-1: Limestone Dryer

Dear Mr. Anderson:

This letter is to remind you that final approval for Emission Permit C-12,444-1 (limestone dryer vented to Mikro Pulsaire size 80G6 bagfilter) has not been issued pending a stack emission test.

Please submit the test protocol to the Colorado Department of Health, Air Pollution Control Division as soon as possible.

Sincerely,

George M. Mathews, Jr., Coordinator
Environmental Health Division

cc: Air Pollution Control Division, Colorado Department of Health

GM:hb

RECEIVED

AUG 15 1982

AIR POLLUTION
CONTROL DIVISION