



MOUNTAIN
CEMENT COMPANY

MOUNTAIN CEMENT COMPANY

16
February 27, 2011



Lowell Spackman
Department of Environmental Quality
Land Quality Division
Herschler Building, 3-W
122 West 25th Street
Cheyenne, WY 82002

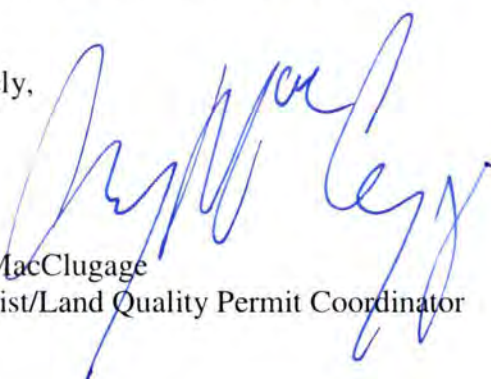
RE: Weaver Limestone Quarry, Permit #658, 2010-2011 Annual Report

Dear Mr. Spackman:

Enclosed is Mountain Cement Company's Annual Report for the Weaver Limestone Quarry, permit no. 658. Please find 2 copies of the report.

If you have any questions, please contact me by phone at Mountain Cement at (307) 745-2687 or Jeff Brasher at (307) 745-2685.

Sincerely,


Andy MacClugage
Geologist/Land Quality Permit Coordinator

Enclosures

MOUNTAIN CEMENT COMPANY
PERMIT #658 WEAVER LIMESTONE QUARRY

ANNUAL REPORT
AND MINE AND RECLAMATION PLANS

FEBRUARY 28, 2010 to FEBRUARY 27, 2011

SUBMITTED TO:
WYOMING DEPARTMENT OF ENVIRONMENTAL QUALITY
LAND QUALITY DIVISION
HERSCHLER BUILDING
CHEYENNE, WYOMING

REPORT PREPARED:
FEBRUARY 28, 2010

PREPARED BY:
MOUNTAIN CEMENT COMPANY
5 SAND CREEK ROAD
LARAMIE, WY
(307)745-2687

658



TABLE OF CONTENTS

<u>Section</u>	<u>Page</u>
ANNUAL REPORT FORM 2/28/2010 TO 2/27/2011	1-6
MINE AND RECLAMATION PLAN SUMMARY	7
Introduction	7
Mine Plan	7
Past Mining Activities	7
Projected Mining Activities	7
Reclamation Plan	8
Past Reclamation Activities	8
Projected Reclamation Activities	8
Estimated Reclamation Costs	8

TABLES

TABLE 1 - Description of Weaver Quarry Lands	9
TABLE 2 - Estimated Reclamation Costs Summary Table for Disturbances through February 28, 2011 and Projected Disturbances for the 2011-2012 Report Period, Weaver Quarry, LQD Permit No. 658	10
TABLE 3 - Current Stockpile Summary Table	11
TABLE 4 - Groundwater characteristics summary table for the <i>upgradient</i> monitoring well (SEO Permit #P151433W). (Installed October 1, 2003)	12
TABLE 5 - Groundwater characteristics summary table for the <i>downgradient</i> monitoring well (SEO Permit #P151434W). (Installed October 1, 2003)	12
TABLE 6 - Blind Duplicate Locations	12

MAPS

- ANNUAL REPORT MAP AR-1 Mining History

ATTACHMENTS

Water Quality Analysis for each Quarter



Land Quality Division
Districts I, II & III
Required Annual Report Information

FOR LARGE MINING OPERATIONS

RE: Wyoming Environmental Quality as Amended §35-11-411, Annual Report

1.
 - (a) Name of Permittee Mountain Cement Company
 - (b) Address: 5 Sand Creek Road
 - (c) Mining Permit Number: Permit No. 658
 - (d) Date of Permit Issuance (and any Amendment): February 29, 1996
 - (e) Commodity Mined: **Limestone**
 - (f) State and Federal Mineral Lease: **None**
2. Time period covered by the report: February 28, 2010 to February 27, 2011
3. Mining:
 - (a) Tabulate acreage disturbed (by pits, roads, facilities, etc.) during the report period and illustrate on map.
~20 acres
 - (b) Tabulate acreage affected to date by years and illustrate on map.
2.6 acres disturbed during 1996-1997 (entrance road)
2.6 acres disturbed during 1997-1998 (remaining haulroad)
14.0 acres disturbed during 1997-1998 (initial mining area)
17.1 acres disturbed during 2000-2001
23.4 acres disturbed during 2002-2003
2.2 acres disturbed during 2003-2004
8.1 acres affected on north side of pit for topsoil and spoil storage
3.9 acres affected during mining activity (total discrepancy affected acres)
20.4 acres disturbed during 2004-2005
0.0 acres disturbed during 2005-2006
11.4 acres disturbed during 2006-2007
10 acres disturbed during 2007-2008
10 acres disturbance 2008-2009 reporting period
10 acres disturbed 2009-2010
20 acres for 2010-2011
155.7 Total Since Mine Start Up
0 acres Projected Disturbance 2011-2012
155.7 acres Total Affected and Projected for 2011-2012
 - (c) Tabulate all topsoil stockpile volumes, date of stockpiling and illustrate on map.
230 CY stockpiled during 1996-1997 (TS-1 entrance road)
970 CY stockpiled during 1997-1998 (TS-2 entrance road)
10,500 CY stockpiled during 1997-1998 (TS-3)
3,900 CY stockpiled during 2000-2001 (TS-4)
6,910 CY stockpiled during 2001-2002 (TS-5)
14,700 CY stockpiled during 2003-2004, 2004-2005 (TS-6)



2,300 CY stockpiled during 2004-2005 (TS-7)
 21,300 CY stockpiled during 2004-2005 (TS-8)
 1,051 CY stockpiled during 2004-2005 (TS-9)
 4,350 CY stockpiled during 2005-2006 (TS-10)
 5,050 CY stockpiled during 2006-2007 (TS-11)
 3,290 CY stockpiled about 2003-2004 (TS-15)
 3,700 CY stockpiled during 2007-2008 (TS-12)
 990 CY stockpiled during 2007-2008 (TS 13)
 11,000 CY stockpiled during 2008-2009 (TS-14)
11,000 CY stockpiled during 2010-2011 (TS-16)
101,240 CY of topsoil are currently stockpiled for reclamation use.

- (d) Tabulate all out-of-pit spoil volumes, dates of placement and illustrate on map.
 620 CY stockpiled by Harney Creek Crossing (OB-1)
 31,000 CY stockpiled during 1997-1998, 2002-2003 (OB-2)
 27,570 CY stockpiled during 2005-2006 (OB-3)
 17,000 CY stockpiled during 2002-2003 (OB-4)
 0.0 CY stockpiled during 2004-2005 (all over overburden was returned to the northern active mining pit for reclamation preparation)
 0.0 CY stockpiled during 2006-2007 & 2007-2008
 13,000 CY stockpiled during 2007-2008 (OB-5)
89,190 CY of overburden are currently stockpiled for mine reclamation.

- (e) Tabulate quantity of commodity mined by years.
 0 tons 1996-1997
 124,376 tons of limestone mined during 1997-1998
 100,500 tons of limestone mined during 1998-1998
 148,520 tons of limestone mined during 1999-2000
 361,150 tons of limestone mined during 2000-2001
 530,950 tons of limestone mined during 2001-2002
 595,530 tons of limestone mined during 2002-2003
 405,027 tons of limestone mined during 2003-2004
 723,215 tons of limestone mined during 2004-2005
 256,238 tons of limestone mined during 2005-2006
 518,584 tons of limestone mined during 2006-2007
 482,000 tons of limestone mined during 2007-2008
 400,000 tons of limestone mined during 2008-2009
 427,000 tons of limestone mined during 2009-2010
247,130 tons mined during 2010-2011
5,328,502 tons of limestone mined since mine start-up.

- (f) Describe any new construction during the report period and illustrate on map; include:
- | | |
|--|------|
| 1. Shop facilities, erection sites. | None |
| 2. Roads | None |
| 3. Culverts | None |
| 4. Diversion ditches, collector ditches, interceptor ditches, etc. | None |



5. Sediment ponds, containment ponds. None
6. Monitoring sites. None

- (g) Describe any environmental problem areas and a proposed plan for mitigating them. Illustrate on map; include:
1. Pit stability problems. None
 2. Subsidence. None
 3. Accidental water discharge, dam failure, etc. None
 4. Slumping or sliding. None
 5. Revegetation problem areas. None

4. Reclamation:

- (a) Tabulate the acreage completed during the report period and illustrate on map. Distinguish between:
1. Backfilled, graded, and contoured. Including date of approval for coal permits. None
 2. Topsoiled. None
 3. Seeded. None
 4. Reseeded. None
 5. Indicate where special construction or reclamation practices were used such as for sand bodies or alluvial material.
- (b) Submit a map showing the reconstructed contours. The map must be the same scale and contour interval as the PMT map in the approved permit.
None Completed.
- (c) Tabulate acreage reclaimed (seeded with permanent seed mix) to date by years and illustrate on map.
No seeding was performed during the 2010-2011 report period.
- (d) Describe reclamation procedures used during the report period:
No reclamation occurred during the 2010-2011 report period.
1. Depth of topsoil applied. Indicate whether from stockpile or directly applied.
 2. Type of seed used for seeding during the report period.
 3. Dates of seeding during the report period.
 4. Seeding procedures used.
 5. Rate of seed application.
 6. Type and rate of any fertilizer applied.
 7. Type and rate of mulch applied.
 8. Rate of irrigation water applied.
 9. Any deviations to the approved reclamation plan including, in addition to the items above, changes to the contour or location of post mining features.
- (e) Describe results of previous revegetation efforts; include:
1. Types of seed that have germinated and are growing. None
 2. Types of seed that are not growing successfully. None
 3. Areas experiencing problems with weeds and weed types. None
 4. Significant erosional problems. None
 5. Areas if unsuitable overburden on the surface. None
 6. Procedures used or proposed to correct these problems. N/A



- (f) Summarize the actual reclamation costs incurred during the report period. Costs should be itemized for each operation (i.e., grading, topsoil replacement, seeding, etc.) and for each type of disturbance (i.e., spoil, haul roads, facilities removal, etc.) on a per-acre basis.

Not Available

5. Describe in detail mining plans for the coming year including revised time schedules and all proposed deviations from previously approved plans. Acreages should be tabulated and illustrated on a map.

See Mine and Reclamation Plan Summary and Maps AR-1.

6. Describe in detail reclamation plans for the coming year including revised time schedules and deviations from previously approved plans. Acreages should be tabulated and illustrated on a map.

See Mine and Reclamation Plan Summary and Maps AR-1.

NOTE: On items 5 and 6 above, any proposed deviation from the approved mine and reclamation plan must be described in detail. The proposed mining and reclamation plans will be reviewed and the operator will be notified if further information is required. "Significant" deviations will require permit revision application (Form 11) and public notice pursuant to Chapter VII Section 2 of Land Quality Division Noncoal Regulations.

See Mine and Reclamation Plan Summary.

7. Describe in detail all monitoring activities during the report period, summarize the data, describe procedures to correct any noted problems and deviations from previously approved methods, including:

- (a) Groundwater analyses.
- (b) Surface water analyses and discharge data.
- (c) Precipitation data.
- (d) Subsidence monitoring.
- (e) Overburden analyses.
- (f) Topsoil quantities – compare calculated and actual.
- (g) Vegetation data.
- (h) Wildlife data.
- (i) A map showing and identifying monitoring locations.

Two wells sampled for analyses during the 2010-2011 reporting period. See Tables 4, 5, & 6 and attachments for groundwater characteristics summary.

None Available

None Available

None Available

None Available

None Available

None Available

None Available

See Annual Report Map for Monitoring Well locations.

8. Operator's Reclamation Performance Bond Estimate as required by Wyoming Statute §35-11-417. Reclamation cost estimates should be itemized in detail to reflect the actual estimated costs of reclaiming all lands which have been affected to date and those lands to be affected during the next report period. Costs must reflect procedures as specified in the approved mine and reclamation plan. The estimated cost of dismantling and disposal of all facilities and structures must be included. Salvage value will not be used to offset bonding requirements. Reclamation projected for the coming year will not be used to offset bonding requirements. Pit backfill costs must reflect actual yardages to be moved. Actual yardages to be moved will reflect the removal or placement of additional material to correct any deviations between the PMT map and the map submitted for part 4.(b).

See attached Table 2 for estimated reclamation costs.

9. Supply any additional information as requested by the Division to:

- (a) Notices of violation
- (b) Orders
- (c) Permit stipulations; and
- (d) Other special conditions.

None

None

None

None



10. All drill holes used for immediate developmental expansion of the advancing pit(s) shall be tabulated by location and depth and shown on the mining plan map. Pursuant to W.S. §35-11-404(e), all drill holes used for exploration shall be reported to the LQD Abandoned Drill Hole Program Supervisor and the State Engineer. None

ANNUAL REPORT MAPS

1. Maps must be clear and legible contour maps or recent aerial photos. The preferred scale is 1" = 500'.
2. Map sheets should be of a reasonable size, generally not to exceed 48" on a side.
3. Maps must have a title block with:
 - (a) Map title.
 - (b) Name and address of permittee.
 - (c) Permit and amendment numbers.
 - (d) Annual report period.
 - (e) Scale, north arrow, contour interval, date of photography, etc.
4. All maps must show:
 - (a) Legal subdivisions – section, township, and range lines clearly labelled.
 - (b) Permit area boundary clearly shown and labelled.
 - (c) Amendment areas clearly shown and labelled.
5. The following features should all be clearly identified:
 - (a) Topsoil stockpiles (numbered)
 - (b) Settling ponds and sediment control structures.
 - (c) Haul roads.
 - (d) Pits identified by location, name, number, etc.
 - (e) Ramps (numbered)
 - (f) Out-of-pit spoil dumps including date of initial placement of material (if permanent, give approval date).
 - (g) All waste disposal sites including, but not limited to:
 1. Carbonaceous waste dumps.
 2. Partings dumps.
 3. Fly ash disposal sites, etc.
 4. Landfill sites.
 - (h) Diversion ditches
 - (i) Monitoring sites
 - (j) Facilities location (silos, labs, crushers, washbays, etc.)
6. History of mining and reclamation should be documents for all areas. The preferred method is to outline separate areas on the map and assign each a number. Then a summary should be presented listing the following information for each separate area:
 - (a) Acreage
 - (b) Initial date of disturbance.
 - (c) Date of regrading.
 - (d) Date of approval of grading.
 - (e) Date of topsoiling and approximate depth, source of topsoil.
 - (f) Date of mulching and type of mulch.
 - (g) Date of seeding.
 - (h) Seed mix.
 - (i) Date and mix of reseeding.
 - (j) Any reworking such as repair of gullies, etc.
 - (k) Bond status of areas (type of bond, date of any release and percent released).
7. All areas to be affected by mining and reclamation activities in the coming year should be outlined and labelled.



Annual Report Attachment

- A. Please indicate any change in company name or business organization.

- B. List the names and addresses of the following:

- | | | |
|----|-------------------------|-----------------------------------|
| 1. | General Manager | <u>Phil Lane, Plant Manager</u> |
| 2. | Party to Receive Notice | <u>Andy MacClugage, Geologist</u> |

- C. List the names and addresses of all officers, owners and/or controllers. Include titles/positions and beginning and ending dates.



MINE AND RECLAMATION PLAN SUMMARY

Introduction

Mountain Cement Company continued to mine at the Weaver Quarry during the past report period. Groundwater monitoring has occurred using the installed monitoring wells (Map AR-1).

Mine Plan

The following mine plan describes the actual mining activities for the 2010-2011 report period and future mining operations for the 2011-2012 report period at Mountain Cement Company Weaver Limestone Quarry, Permit No. 658.

Past Mining Activities: There were about 20 acres disturbed during the 2010-2011 report period. These 20 acres were stripped and the topsoil has been placed on the pit floor as pile TS-16. As the DEQ is aware, mining at the Weaver Quarry not been as intense as in the past because the focus of rock production has been the Etchepare Quarry. Mountain Cement continues to haul rock in from the quarry to keep it active. **247,130 tons** of limestone was mined at the Weaver Quarry during the report period. A total of **155.7 acres** have been affected to date. A total of **101,240 CY** of topsoil and **89,190 CY** of overburden are stockpiled for reclamation use.

Projected Mining Activities: Mountain Cement Company plans to continue mining eastward toward the disturbance limit. It is anticipated that during the 2011-2012 report period no new disturbance will be necessary as MCC has already stripped the area. Mountain Cement will continue to mine as needed for production.



Reclamation Plan

The following reclamation plan describes actual past reclamation and expected future efforts.

Past Reclamation Activities:

Reclamation has not yet been initiated at this mine site. Limestone mining began during the 1997-1998 report period. Upon completion of mining in the north section, reclamation will occur. Initial backfilling of material has occurred along the north and west highwall to prepare for reclamation. In December 2010 the Weaver Reclamation Plan revision, TFN 5 1/059, was approved; MCC will begin on the reclamation work as soon as time and equipment availability allows.

Future Reclamation Activities:

In the spring of 2011, Mountain Cement hopes to begin reducing sections of the north highwall with the techniques discussed in the approved Reclamation Plan. This will include blasting the limestone just as it would be for production, but it will be dozed down and splayed out instead to create the desired grading.

Estimated Reclamation Costs

Mountain Cement Company's reclamation performance bond estimate for the current disturbances and expected disturbances during the 2011-2012 report period are itemized in the Appendix, "Itemized Performance Bond Calculations." The total reclamation costs plus an additional twenty percent (20%) contingency cost, is calculated to be approximately **\$413,000**. The current bond held is **\$500,000**.



Table 1 - Description of Weaver Quarry Lands.

(Includes acreage projected to be disturbed during the upcoming report period.)

Land Description	Acres
Permit Area	1,372.5
<i>Acreage-to-Affect</i>	<i>511.14</i>
Current Affected Acreage	155.7
<i>Total Acreage-to-Affect Remaining</i>	<i>355.44</i>
Lands Requiring Area Bond Cost	155.7
Proposed Disturbance for 2011-2012	0.0
Lands w/ Approved Full Bond Release	0.0
Subtotal (Incremental Bond Total)	155.7
Total Native Land Remaining in Permit Area	1216.8



Table 2 - Estimated Reclamation Costs Summary Table for Disturbances through February 28, 2011 and Projected Disturbances for the 2011-2012 Report Period, Weaver Quarry, LQD Permit No. 658. Using Guideline 12 dated 11/2010.

RECLAMATION ACTIVITY	APPENDIX LQD, Guideline #12	UNIT	UNIT COST (\$/unit)	TOTAL (\$)
Drilling and Blasting	n/a	42,000 CY	\$0.235/CY	9,870
Dozing	E	21,000 CY	\$0.195/CY	4,095
Backfilling and Contouring	C 637E Scraper	89,190 CY Overburden	\$1.090/CY	97,217
Topsoil Redistribution	C 637E Scraper	101,240 CY Topsoil	\$1.090/CY	110,351
Final Grading	G 16H Motor Grader	155.7 Acres	\$68.61/acre	10,683
Scarification	P 16H Motor Grader	155.7 Acres	\$62.93/acre	9,798
Culvert Removal	J 200 ft.	10 (20' section.)	\$122.02/unit	1,220
Removal Groundwater Monitoring Wells	L	-	-	1,660
Seed, Mulch, Prepare Soil	Q	125.7 Acres	\$750/acre	94,275
Fencing- removal	Q	16,200 LF	\$0.31/Ft	5,022

		Subtotal	\$344,191
		20% DEQ Contingency	\$ 68,838
Bond Amount=	\$500,000	TOTAL	\$413,000



Table 3- Current Stockpile Summary Table

Pile	Volume	Placement Date
TS-1	230	1996-1997
TS-2	970	1997-1998
TS-3	10,500	1997-1998
TS-4	3,900	2000-2001
TS-5	6,910	2001-2002
TS-6	14,700	2003-2004,2004-2005
TS-7	2,300	2004-2005
TS-8	21,300	2004-2005
TS-9	1,051	2004-2005
TS-10	4,350	2006-2007
TS-11	5,050	2007-2008
TS-12	3,700	2007-2008
TS-13	990	2007-2008
TS-14	11,000	2008-2009
TS-15	3,290	about 2003-2004
TS-16	11,000	2010-2011
OB-1	620	Unknown, Harney Creek Crossing
OB-2	31,000	1997-1998,2002-2003
OB-3	27,570	2005-2006
OB-4	17,000	2002-2003
OB-5	13,000	2007-2008
<i>Total Topsoil available for reclamation:</i>		101,240 CY
<i>Total Overburden available for reclamation:</i>		89,190 CY

Western Water Consultants surveyed the volumes of all stockpiles in the December 2009.



Table 4 - Groundwater characteristics summary table for monitoring well # P151433W

Parameter	3/11/10	6/3/10	8/16/10	11/23/10
Depth to Water (feet)	194.1	193.6	195.8	194.8
Lab Conductivity @ 25 °C, $\mu\text{mhos/cm}$	429	430	417	398
Total Dissolved Solids @ 180 °C, (mg/L)	260	250	240	240
Total Alkalinity as CaCO_3 , (mg/L)	295	220	215	217
Total Hardness (mg/L) as CaCO_3 , mg/L	234	219	217	225
Nitrate + Nitrate as N (mg/L)	1.05	1.07	1.11	1.14
Total Petroleum Hydrocarbons, TPH 418.1, (mg/L)	<5; i.e., ND	<5; i.e., ND	<5; i.e., ND	<5; i.e., ND

Table 5- Groundwater characteristics summary table for monitoring well # P151434W

Parameter	3/11/10	6/3/10	8/16/10	11/23/10
Depth to Water (feet)	19.1	16.1	16.2	16.1
Lab Conductivity @ 25 °C, $\mu\text{mhos/cm}$	397	427	484	449
Total Dissolved Solids @ 180 °C, (mg/L)	250	260	290	280
Total Alkalinity as CaCO_3 , (mg/L)	271	217	214	219
Total Hardness (mg/L) as CaCO_3 , mg/L	195	218	246	250
Nitrate + Nitrate as N (mg/L)	1.63	1.79	3.28	2.46
Total Petroleum Hydrocarbons, TPH 418.1, (mg/L)	<5; i.e., ND	<5; i.e., ND	<5; i.e., ND	<5; i.e., ND

Table 6- Blind Duplicate Locations by Quarter.

Quarter	Duplicate Name	Location
Q1	BD31110	P-151434
Q2	BD6310	Waitkus-R
Q3	BD81610	P-151434
Q4	BD112310	P-151433



First Quarter Water Quality Analysis

658



Date: 3/24/2010

CLIENT: Mountain Cement Company
Project: Weaver/Red Buttes/Etchepare
Lab Order: S1003217

CASE NARRATIVE

Report ID: S1003217001

Samples BD31110, FB31210, Linton, MC-MW-1, P-151433, P-151434, and Waitkus-R were received on March 16, 2010.

All samples were received and analyzed within the EPA recommended holding times, except those noted in this case narrative. Samples were analyzed using the methods outlined in the following references:

U.S.E.P.A. 600 "Methods for Chemical Analysis of Water and Wastes", 1993
"Standard Methods For The Examination of Water and Wastewater", 20th ed., 1998
Test Methods for Evaluating Solid Waste, Physical/Chemical Methods, SW846, 3rd Edition
Methods indicated with the Monday, March 12, 2007 Federal Register, 40 CFR Part 122, 136 et al.

All Quality Control parameters met the acceptance criteria defined by EPA and Inter-Mountain Laboratories except as indicated in this case narrative.





Inter-Mountain Labs
Sheridan, WY and Gillette, WY

- CHAIN OF CUSTODY RECORD -

This is a **LEGAL DOCUMENT**. All shaded fields must be completed. See reverse for instructions.

121384

Client Name MOUNTAIN CEMENT		Project Identification WEAVER/RED BUTTES/ETCHEPARE		Sampler (Signature/Printed) <i>[Signature]</i> / BERRETH, JACOB C		Telephone # 307-745-7474	
Report Address 5 SAND CREEK RD. LARAMIE, WY 82070		Contact Name MARK ANDREWS		ANALYSES / PARAMETERS			
Invoice Address SAME		Email		TPH	NUTRIENTS	TRACE METALS	GENERAL
		Phone 307-745-4879					
		Purchase Order #		Quote #		REMARKS	

ITEM	LAB ID (Lab Use Only)	DATE SAMPLED	TIME SAMPLED	SAMPLE IDENTIFICATION	WT	3	TPH	NUTRIENTS	TRACE METALS	GENERAL	REMARKS
1	SD003217-01	3/11/10	0952	P-151433	WT	3	X	X		X	PLEASE SEE BOTTLE
2	1 002	3/11/10	1108	P-151434	WT	3	X	X		X	ORDER FOR SPECIFIC
3		3/11/10	0752	MC-1-WEST	WT	23		X	X	X	TEST TO BE RUN
4		3/11/10	0846	MC-2-EAST	WT	23		X	X	X	
5	003	3/12/10	1102	MC-MW-1	WT	3	X	X		X	
6	004	3/12/10	0946	WAITKUS-R	WT	3	X	X		X	
7	005	3/12/10	1137	LINTON	WT	3	X	X		X	
8	007-006	3/12/10	1223	FB31210	WT	3	X	X		X	
9	006-007	3/11/10	-	BD31110	WT	3	X	X		X	
10											
11											
12											
13											
14											

Rec'd
3/17/10
from Jacob
Revised
via e-mail

LAB COMMENTS 	Relinquished By (Signature/Printed)	DATE	TIME	Received By (Signature/Printed)	DATE	TIME
	<i>[Signature]</i> BERRETH, Jacob C	3/15/10	1700			

SHIPPING INFO		MATRIX CODES		TURNAROUND TIMES		COMPLIANCE INFORMATION		ADDITIONAL REMARKS	
☒ UPS	☒ Fed Express	☒ Water	☒ WT	☒ Check desired service	☒ Standard turnaround	Compliance Monitoring?	☒ Y ☐ N		
☐ US Mail	☐ Hand Carried	☐ Solid	☐ SD	☐ RUSH - 5 Working Days	☐ URGENT - < 2 Working Days	Program (SDWA, NPDES ...)			
☐ Other		☐ Trip Blank	☐ TB	Rush & Urgent Surcharges will be applied		PWSID / Permit #			
		☐ Other	☐ OT			Chlorinated?	☒ Y ☐ N		
						Sample Disposal: Lab	☒ Client		

Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 3/24/2010
Report ID: S1003217001

Project: Weaver/Red Buttes/Etchepare
Lab ID: S1003217-001
Client Sample ID: P-151433
COC: 127384

Work Order: S1003217
Collection Date: 3/11/2010 9:52:00 AM
Date Received: 3/16/2010 10:44:00 AM
Sampler: JB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	429	5		µmhos/cm	03/17/2010 1503 KO	SM 2510B
Total Dissolved Solids (180)	260	10		mg/L	03/16/2010 1530 AMB	SM 2540
Alkalinity, Total (As CaCO ₃)	295	5		mg/L	03/17/2010 1503 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	234	1		mg/L	03/19/2010 838 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	03/16/2010 1557 LJK	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	1.05	0.05		mg/L	03/17/2010 1427 SK	EPA 353.2
Cations						
Calcium	60	1		mg/L	03/16/2010 2028 DG	EPA 200.7
Magnesium	20	1		mg/L	03/16/2010 2028 DG	EPA 200.7



These results apply only to the samples tested.

Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- M Value exceeds Monthly Ave or MCL
- O Outside the Range of Dilutions

RL - Reporting Limit

- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- L Analyzed by a contract laboratory
- ND Not Detected at the Reporting Limit
- S Spike Recovery outside accepted recovery limits

Reviewed by:

Connie Mattson

Connie Mattson, Project Manager

Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 3/24/2010
Report ID: S1003217001

Project: Weaver/Red Buttes/Etchepare
Lab ID: S1003217-002
Client Sample ID: P-151434
COC: 127384

Work Order: S1003217
Collection Date: 3/11/2010 11:08:00 AM
Date Received: 3/16/2010 10:44:00 AM
Sampler: JB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	397	5		µmhos/cm	03/17/2010 1511 KO	SM 2510B
Total Dissolved Solids (180)	250	10		mg/L	03/16/2010 1535 AMB	SM 2540
Alkalinity, Total (As CaCO ₃)	271	5		mg/L	03/17/2010 1511 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	195	1		mg/L	03/19/2010 838 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	03/16/2010 1616 LJK	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	1.63	0.05		mg/L	03/17/2010 1428 SK	EPA 353.2
Cations						
Calcium	47	1		mg/L	03/16/2010 2031 DG	EPA 200.7
Magnesium	19	1		mg/L	03/16/2010 2031 DG	EPA 200.7



These results apply only to the samples tested.

Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- M Value exceeds Monthly Ave or MCL
- O Outside the Range of Dilutions

RL - Reporting Limit

- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- L Analyzed by a contract laboratory
- ND Not Detected at the Reporting Limit
- S Spike Recovery outside accepted recovery limits

Reviewed by: Connie Mattson
Connie Mattson, Project Manager

Sample Analysis Report

NT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 3/24/2010
Report ID: S1003217001

Project: Weaver/Red Buttes/Etchepare
Lab ID: S1003217-006
Client Sample ID: BD31110
COC: 127384

Work Order: S1003217
Collection Date: 3/11/2010
Date Received: 3/16/2010 10:44:00 AM
Sampler: JB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	395	5		µmhos/cm	03/17/2010 1542 KO	SM 2510B
Total Dissolved Solids (180)	260	10		mg/L	03/16/2010 1555 AMB	SM 2540
Alkalinity, Total (As CaCO ₃)	272	5		mg/L	03/17/2010 1542 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	207	1		mg/L	03/19/2010 838 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	03/17/2010 1025 LJK	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	1.54	0.05		mg/L	03/17/2010 1433 SK	EPA 353.2
Cations						
Calcium	49	1		mg/L	03/16/2010 2047 DG	EPA 200.7
Magnesium	20	1		mg/L	03/16/2010 2047 DG	EPA 200.7

These results apply only to the samples tested.

Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- M Value exceeds Monthly Ave or MCL
- O Outside the Range of Dilutions

RL - Reporting Limit

- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- L Analyzed by a contract laboratory
- ND Not Detected at the Reporting Limit
- S Spike Recovery outside accepted recovery limits

Reviewed by: *Connie Mattson*
Connie Mattson, Project Manager



Sample Analysis Report

NT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 3/24/2010

Report ID: S1003217001

Project: Weaver/Red Buttes/Etchepare
Lab ID: S1003217-007
Client Sample ID: FB31210
COC: 127384

Work Order: S1003217
Collection Date: 3/11/2010 12:33:00 PM
Date Received: 3/16/2010 10:44:00 AM
Sampler: JB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	ND	5		µmhos/cm	03/17/2010 1547 KO	SM 2510B
Total Dissolved Solids (180)	ND	10		mg/L	03/16/2010 1600 AMB	SM 2540
Alkalinity, Total (As CaCO ₃)	ND	5		mg/L	03/17/2010 1547 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	ND	1		mg/L	03/19/2010 838 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	03/17/2010 1042 LJK	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	ND	0.05		mg/L	03/17/2010 1442 SK	EPA 353.2
Cations						
Calcium	ND	1		mg/L	03/16/2010 2049 DG	EPA 200.7
Magnesium	ND	1		mg/L	03/16/2010 2049 DG	EPA 200.7

These results apply only to the samples tested.

Qualifiers: * Value exceeds Maximum Contaminant Level
E Value above quantitation range
J Analyte detected below quantitation limits
M Value exceeds Monthly Ave or MCL
O Outside the Range of Dilutions

RL - Reporting Limit

B Analyte detected in the associated Method Blank
H Holding times for preparation or analysis exceeded
L Analyzed by a contract laboratory
ND Not Detected at the Reporting Limit
S Spike Recovery outside accepted recovery limits

Reviewed by: Connie Mattson
Connie Mattson, Project Manager



Second Quarter Water Quality Analysis

658



Date: 6/21/2010

CLIENT: Mountain Cement Company
Project: Weaver & Etchepare
Lab Order: S1006102

CASE NARRATIVE
Report ID: S1006102001

Samples BD6310, FB6310, Linton, MC-MW-1, MC-MW-2, P-151433, P-151434, and Waitkus-R were received on June 4, 2010.

All samples were received and analyzed within the EPA recommended holding times, except those noted in this case narrative. Samples were analyzed using the methods outlined in the following references:

U.S.E.P.A. 600 "Methods for Chemical Analysis of Water and Wastes", 1993
"Standard Methods For The Examination of Water and Wastewater", 20th ed., 1998
Test Methods for Evaluating Solid Waste, Physical/Chemical Methods, SW846, 3rd Edition
Methods indicated with the Monday, March 12, 2007 Federal Register, 40 CFR Part 122, 136 et al.

All Quality Control parameters met the acceptance criteria defined by EPA and Inter-Mountain Laboratories except as indicated in this case narrative.

Reviewed by:

Connie Mattson

Connie Mattson, Project Manager





Inter-Mountain Labs
Sheridan, WY and Gillette, WY

This is a **LEGAL DOCUMENT**. All shaded fields must be completed. See reverse for instructions.

- CHAIN OF CUSTODY RECORD -

128878

Client Name MOUNTAIN CEMENT			Project Identification WENNER & ETCHEPARE			Sampler (Signature/Printed) <i>[Signature]</i> / BERZEM, JACOB C			Telephone # 307-745-7474																													
Report Address 5 SAND CREEK RD. LARAMIE, WY 82070			Contact Name MARK ANDREWS			ANALYSES / PARAMETERS <table border="1"><thead><tr><th>TPH</th><th>NUTRIENTS</th><th>GENERAL</th><th></th><th></th><th></th><th></th><th></th><th></th><th></th><th></th><th></th></tr></thead><tbody><tr><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr></tbody></table>									TPH	NUTRIENTS	GENERAL																					
TPH	NUTRIENTS	GENERAL																																				
Invoice Address SAME			Email 307-745-4874			Purchase Order #			Quote #			REMARKS																										
ITEM	LAB ID (Lab Use Only)	DATE SAMPLED	TIME	SAMPLE IDENTIFICATION	Matrix	# of Containers	TPH	NUTRIENTS	GENERAL																													
1	5100602-001	6-3-10	0918	P-151433	WT	3	X	X	X											PLEASE SEE BOTTOM																		
2	002	6-3-10	0951	P-151434	WT	3	X	X	X											ORDER FOR SPECIFIC																		
3	003	6-3-10	1117	MC-MW-1	WT	3	X	X	X											TESTS / PARAMETERS																		
4	004	6-3-10	1216	WAITKUS-R	WT	3	X	X	X											TO BE RUN																		
5	005	6-3-10	1344	MC-MW-2	WT	3	X	X	X																													
6	006	6-3-10	1238	LINION	WT	3	X	X	X																													
7	007	6-3-10	—	BD6310	WT	3	X	X	X																													
8	1 + 008	6-3-10	1401	FB6310	WT	3	X	X	X																													
9																																						
10																																						
11																																						
12																																						
13																																						
14																																						
LAB COMMENTS		Relinquished By (Signature/Printed) <i>[Signature]</i>				DATE 6-3-10	TIME 1700	Received By (Signature/Printed) <i>[Signature]</i>				DATE	TIME																									
3.8 2.9 																																						
SHIPPING INFO		MATRIX CODES		TURNAROUND TIMES		COMPLIANCE INFORMATION				ADDITIONAL REMARKS																												
☒ UPS		Water WT		Check desired service		Compliance Monitoring? Y/N																																
☐ Fed Express		Soil SL		☒ Standard turnaround		Program (SDWA, NPDES,...)																																
☐ US Mail		Solid SD		☐ RUSH - 5 Working Days		PWSID / Permit #																																
☐ Hand Carried		Trip Blank TB		☐ URGENT - < 2 Working Days		Chlorinated? Y/N																																
☐ Other		Other OT		Rush & Urgent Surcharges will be applied		Sample Disposal: Lab X Client																																

Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 6/21/2010

Report ID: S1006102001

Project: Weaver & Etchepare
Lab ID: S1006102-001
Client Sample ID: P-151433
COC: 128878

Work Order: S1006102
Collection Date: 6/3/2010 9:18:00 AM
Date Received: 6/4/2010 11:33:00 AM
Sampler: JCB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	430	5		µmhos/cm	06/04/2010 2308 KO	SM 2510B
Total Dissolved Solids (180)	250	10		mg/L	06/07/2010 1016 MJH	SM 2540
Alkalinity, Total (As CaCO ₃)	220	5		mg/L	06/04/2010 2308 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	219	1		mg/L	06/21/2010 1003 CJM	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	06/09/2010 000 MJD	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	1.07	0.05		mg/L	06/15/2010 1709 AS	EPA 353.2
Cations						
Calcium	57	1		mg/L	06/04/2010 1437 RS	EPA 200.7
Magnesium	19	1		mg/L	06/04/2010 1437 RS	EPA 200.7

These results apply only to the samples tested.

Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- M Value exceeds Monthly Ave or MCL
- O Outside the Range of Dilutions

RL - Reporting Limit

- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- L Analyzed by a contract laboratory
- ND Not Detected at the Reporting Limit
- S Spike Recovery outside accepted recovery limits

Reviewed by:

Connie Mattson

Connie Mattson, Project Manager



Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 6/21/2010

Report ID: S1006102001

Project: Weaver & Etchepare
Lab ID: S1006102-002
Client Sample ID: P-151434
COC: 128878

Work Order: S1006102
Collection Date: 6/3/2010 9:51:00 AM
Date Received: 6/4/2010 11:33:00 AM
Sampler: JCB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	427	5		µmhos/cm	06/04/2010 2316 KO	SM 2510B
Total Dissolved Solids (180)	260	10		mg/L	06/07/2010 1021 MJH	SM 2540
Alkalinity, Total (As CaCO ₃)	217	5		mg/L	06/04/2010 2316 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	218	1		mg/L	06/21/2010 1003 CJM	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	06/09/2010 000 MJD	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	1.79	0.05		mg/L	06/15/2010 1710 AS	EPA 353.2
Cations						
Calcium	53	1		mg/L	06/04/2010 1439 RS	EPA 200.7
Magnesium	21	1		mg/L	06/04/2010 1439 RS	EPA 200.7



These results apply only to the samples tested.

Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- M Value exceeds Monthly Ave or MCL
- O Outside the Range of Dilutions

RL - Reporting Limit

- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- L Analyzed by a contract laboratory
- ND Not Detected at the Reporting Limit
- S Spike Recovery outside accepted recovery limits

Reviewed by: Connie Mattson
Connie Mattson, Project Manager

Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 6/21/2010
Report ID: S1006102001

Project: Weaver & Etchepare
Lab ID: S1006102-007
Client Sample ID: BD6310
COC: 128878

Work Order: S1006102
Collection Date: 6/3/2010
Date Received: 6/4/2010 11:33:00 AM
Sampler: JCB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	368	5		µmhos/cm	06/04/2010 2353 KO	SM 2510B
Total Dissolved Solids (180)	220	10		mg/L	06/07/2010 1046 MJH	SM 2540
Alkalinity, Total (As CaCO ₃)	191	5		mg/L	06/04/2010 2353 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	195	1		mg/L	06/21/2010 1003 CJM	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	06/09/2010 000 MJD	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	1.70	0.05		mg/L	06/15/2010 1721 AS	EPA 353.2
Cations						
Calcium	52	1		mg/L	06/04/2010 1451 RS	EPA 200.7
Magnesium	16	1		mg/L	06/04/2010 1451 RS	EPA 200.7



These results apply only to the samples tested.

Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- M Value exceeds Monthly Ave or MCL
- O Outside the Range of Dilutions

RL - Reporting Limit

- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- L Analyzed by a contract laboratory
- ND Not Detected at the Reporting Limit
- S Spike Recovery outside accepted recovery limits

Reviewed by: Connie Mattson
Connie Mattson, Project Manager

Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 6/21/2010

Report ID: S1006102001

Project: Weaver & Etchepare
Lab ID: S1006102-008
Client Sample ID: FB6310
COC: 128878

Work Order: S1006102
Collection Date: 6/3/2010 2:01:00 PM
Date Received: 6/4/2010 11:33:00 AM
Sampler: JCB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	ND	5		µmhos/cm	06/04/2010 2359 KO	SM 2510B
Total Dissolved Solids (180)	ND	10		mg/L	06/07/2010 1056 MJH	SM 2540
Alkalinity, Total (As CaCO ₃)	ND	5		mg/L	06/04/2010 2359 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	ND	1		mg/L	06/21/2010 1003 CJM	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	06/09/2010 000 MJD	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	ND	0.05		mg/L	06/15/2010 1722 AS	EPA 353.2
Cations						
Calcium	ND	1		mg/L	06/04/2010 1500 RS	EPA 200.7
Magnesium	ND	1		mg/L	06/04/2010 1500 RS	EPA 200.7

These results apply only to the samples tested.

Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- M Value exceeds Monthly Ave or MCL
- O Outside the Range of Dilutions

RL - Reporting Limit

B Analyte detected in the associated Method Blank
H Holding times for preparation or analysis exceeded
L Analyzed by a contract laboratory
ND Not Detected at the Reporting Limit
S Spike Recovery outside accepted recovery limits

658



Reviewed by:

Connie Mattson
Connie Mattson, Project Manager

Third Quarter Water Quality Analysis

658



Date: 9/3/2010

CLIENT: Mountain Cement Company
Project: Weaver + Red Butte
Lab Order: S1008288

CASE NARRATIVE

Report ID: S1008288001

Samples BD81610, FB81610, MC-1-West, MC-2-East, P-151433, and P-151434 were received on August 17, 2010.

All samples were received and analyzed within the EPA recommended holding times, except those noted in this case narrative. Samples were analyzed using the methods outlined in the following references:

U.S.E.P.A. 600 "Methods for Chemical Analysis of Water and Wastes", 1993
"Standard Methods For The Examination of Water and Wastewater", 20th ed., 1998
Test Methods for Evaluating Solid Waste, Physical/Chemical Methods, SW846, 3rd Edition
Methods indicated with the Monday, March 12, 2007 Federal Register, 40 CFR Part 122, 136 et al.

All Quality Control parameters met the acceptance criteria defined by EPA and Inter-Mountain Laboratories except as indicated in this case narrative.



Reviewed by:



Lacey Ketron, Project Manager



Inter-Mountain Labs
Sheridan, WY and Gillette, WY

This is a **LEGAL DOCUMENT** All shaded fields must be completed. See reverse for instructions.

- CHAIN OF CUSTODY RECORD -

105680

Client Name MOUNTAIN CEMENT		Project Identification WEAVER + RED BUTTE		Sampler (Signature/Printed) <i>Jacob C Berrett</i> BERRETT, JACOB C		Telephone # 307 745 7474	
Report Address 5 SAND CREEK RD. LARAMIE, WY 82070		Contact Name MARK ANDREWS		ANALYSES / PARAMETERS			
Invoice Address SAME		Email					
		Phone 307-745-4879					
		Purchase Order #		Quote #		REMARKS	

ITEM	LAB ID (Lab Use Only)	DATE SAMPLED	TIME	SAMPLE IDENTIFICATION	Matrix	# of Containers	TPH	NUTRIENTS	GENERAL	METALS									REMARKS
1	51003288-00	8-16-10	0949	P-151433	WT	4	X	X	X	X	Q								PLEASE SEE BUTTE
2	022	8-16-10	1046	P-151434	WT	4	X	X	X	X	Q								ORDER FOR SPICE
3	023	8-16-10	1157	MC-1-WEST	WT	3		X	X	X	68								TESTS/PARAMETERS
4	024	8-16-10	1246	MC-2-EAST	WT	3		X	X	X	68								10 BE RUN
5	025	8-16-10	-	BD81610	WT	4	X	X	X	X									
6	026	8-16-10	1054	FB81610	WT	4	X	X	X	X									
7																			
8																			
9																			
10																			
11																			
12																			
13																			
14																			

LAB COMMENTS	Relinquished By (Signature/Printed)	DATE	TIME	Received By (Signature/Printed)	DATE	TIME
4.22	<i>Jacob C Berrett</i> BERRETT, JACOB C	8/16/10	1700	<i>Kathy Boyd</i>	8/16/10	15:10

SHIPPING INFO	MATRIX CODES	TURNAROUND TIMES	COMPLIANCE INFORMATION	ADDITIONAL REMARKS
☒ UPS ☐ Fed Express ☐ US Mail ☐ Hand Carried ☐ Other _____	Water WT Soil SL Solid SD Trip Blank TB Other OT	☒ Check desired service ☐ Standard turnaround ☐ RUSH - 5 Working Days ☐ URGENT - < 2 Working Days Rush & Urgent Surcharges will be applied	Compliance Monitoring? (Y/N) Program (SDWA, NPDES,...) PWSID / Permit # Chlorinated? (Y/N) Sample Disposal: Lab X Client	



Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 9/3/2010

Report ID: S1008288001

Project: Weaver + Red Butte
Lab ID: S1008288-001
Client Sample ID: P-151433
COC: 135680

Work Order: S1008288
Collection Date: 8/16/2010 9:49:00 AM
Date Received: 8/17/2010 10:18:00 AM
Sampler: JB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	417	5		µmhos/cm	08/18/2010 1701 KO	SM 2510B
Total Dissolved Solids (180)	240	10		mg/L	08/19/2010 820 AMB	SM 2540
Alkalinity, Total (As CaCO ₃)	215	5		mg/L	08/18/2010 1701 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	217	1		mg/L	08/24/2010 849 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	08/23/2010 1143 MJD	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	1.11	0.05		mg/L	08/25/2010 1101 AS	EPA 353.2
Cations						
Calcium	55	1		mg/L	08/18/2010 1646 DG	EPA 200.7
Magnesium	20	1		mg/L	08/18/2010 1646 DG	EPA 200.7

These results apply only to the samples tested.

Qualifiers: * Value exceeds Maximum Contaminant Level
E Value above quantitation range
J Analyte detected below quantitation limits
M Value exceeds Monthly Ave or MCL
O Outside the Range of Dilutions

RL - Reporting Limit

B Analyte detected in the associated Method Blank
H Holding times for preparation or analysis exceeded
L Analyzed by a contract laboratory
ND Not Detected at the Reporting Limit
S Spike Recovery outside accepted recovery limits



Reviewed by:

Lacey Ketron
Lacey Ketron, Project Manager

Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 9/3/2010
Report ID: S1008288001

Project: Weaver + Red Butte
Lab ID: S1008288-002
Client Sample ID: P-151434
COC: 135680

Work Order: S1008288
Collection Date: 8/16/2010 10:46:00 AM
Date Received: 8/17/2010 10:18:00 AM
Sampler: JB
Matrix: Water


Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	484	5		µmhos/cm	08/18/2010 1708 KO	SM 2510B
Total Dissolved Solids (180)	290	10		mg/L	08/19/2010 825 AMB	SM 2540
Alkalinity, Total (As CaCO ₃)	214	5		mg/L	08/18/2010 1708 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	246	1		mg/L	08/24/2010 849 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	08/23/2010 1158 MJD	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	3.28	0.05		mg/L	08/25/2010 1102 AS	EPA 353.2
Cations						
Calcium	59	1		mg/L	08/18/2010 1648 DG	EPA 200.7
Magnesium	24	1		mg/L	08/18/2010 1648 DG	EPA 200.7

These results apply only to the samples tested.

Qualifiers: * Value exceeds Maximum Contaminant Level
E Value above quantitation range
J Analyte detected below quantitation limits
M Value exceeds Monthly Ave or MCL
O Outside the Range of Dilutions

RL - Reporting Limit

B Analyte detected in the associated Method Blank
H Holding times for preparation or analysis exceeded
L Analyzed by a contract laboratory
ND Not Detected at the Reporting Limit
S Spike Recovery outside accepted recovery limits

Reviewed by: 
Lacey Ketron, Project Manager



Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 9/3/2010
Report ID: S1008288001

Project: Weaver + Red Butte
Lab ID: S1008288-005
Client Sample ID: BD81610
COC: 135680

Work Order: S1008288
Collection Date: 8/16/2010
Date Received: 8/17/2010 10:18:00 AM
Sampler: JB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	483	5		µmhos/cm	08/18/2010 1737 KO	SM 2510B
Total Dissolved Solids (180)	290	10		mg/L	08/19/2010 845 AMB	SM 2540
Alkalinity, Total (As CaCO ₃)	216	5		mg/L	08/18/2010 1737 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	249	1		mg/L	08/24/2010 849 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	08/23/2010 1213 MJD	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	3.29	0.05		mg/L	08/25/2010 1111 AS	EPA 353.2
Cations						
Calcium	60	1		mg/L	08/18/2010 1702 DG	EPA 200.7
Magnesium	24	1		mg/L	08/18/2010 1702 DG	EPA 200.7

These results apply only to the samples tested.


Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- M Value exceeds Monthly Ave or MCL
- O Outside the Range of Dilutions

RL - Reporting Limit

- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- L Analyzed by a contract laboratory
- ND Not Detected at the Reporting Limit
- S Spike Recovery outside accepted recovery limits

Reviewed by:


Lacey Ketron, Project Manager





Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 9/3/2010
Report ID: S1008288001

Project: Weaver + Red Butte
Lab ID: S1008288-006
Client Sample ID: FB81610
COC: 135680

Work Order: S1008288
Collection Date: 8/16/2010 10:54:00 AM
Date Received: 8/17/2010 10:18:00 AM
Sampler: JB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	ND	5		µmhos/cm	08/18/2010 1752 KO	SM 2510B
Total Dissolved Solids (180)	ND	10		mg/L	08/19/2010 850 AMB	SM 2540
Alkalinity, Total (As CaCO ₃)	ND	5		mg/L	08/18/2010 1752 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	ND	1		mg/L	08/24/2010 849 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	08/23/2010 1228 MJD	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	ND	0.05		mg/L	08/25/2010 1112 AS	EPA 353.2
Cations						
Calcium	ND	1		mg/L	08/18/2010 1704 DG	EPA 200.7
Magnesium	ND	1		mg/L	08/18/2010 1704 DG	EPA 200.7

These results apply only to the samples tested.

Qualifiers: * Value exceeds Maximum Contaminant Level
E Value above quantitation range
J Analyte detected below quantitation limits
M Value exceeds Monthly Ave or MCL
O Outside the Range of Dilutions

RL - Reporting Limit

B Analyte detected in the associated Method Blank
H Holding times for preparation or analysis exceeded
L Analyzed by a contract laboratory
ND Not Detected at the Reporting Limit
S Spike Recovery outside accepted recovery limits

Reviewed by:

Lacey Ketron, Project Manager



Fourth Quarter Water Quality Analysis

658





Date: 12/8/2010

CLIENT: Mountain Cement Company
Project: Weaver
Lab Order: S1011392

CASE NARRATIVE
Report ID: S1011392001

Samples BD112310, FB112310, P-151433, and P-151434 were received on November 24, 2010.

All samples were received and analyzed within the EPA recommended holding times, except those noted in this case narrative. Samples were analyzed using the methods outlined in the following references:

U.S.E.P.A. 600 "Methods for Chemical Analysis of Water and Wastes", 1993
"Standard Methods For The Examination of Water and Wastewater", 20th ed., 1998
Test Methods for Evaluating Solid Waste, Physical/Chemical Methods, SW846, 3rd Edition
Methods indicated with the Monday, March 12, 2007 Federal Register, 40 CFR Part 122, 136 et al.

All Quality Control parameters met the acceptance criteria defined by EPA and Inter-Mountain Laboratories except as indicated in this case narrative.



Reviewed by:

Connie Mattson

Connie Mattson, Project Manager

Client Name Mountain Cement			Project Identification WEAVER			Sampler (Signature/Printed) <i>Jacob Berrett</i>			Telephone # 307-745-7474								
Report Address 5 SAND CREEK RD. LARAMIE, WY 82070			Contact Name MARK ANDREWS			ANALYSES / PARAMETERS											
Invoice Address SAME			Email			Phone 307-745-4879			Purchase Order #			Quote #			REMARKS		
ITEM	LAB ID (Lab Use Only)	DATE SAMPLED	TIME	SAMPLE IDENTIFICATION	Matrix	# of Containers	TPH	NUTRIENTS	GENERAL	METALS							
1	51011372-002	11/23/10	1040	P-151433	WT	4	X	X	X	X							
2	002	11/23/10	1148	P-151434	WT	4	X	X	X	X							
3	003	11/23/10	1151	FB112310	WT	4	X	X	X	X							
4	004	11/23/10		BD112310	WT	4	X	X	X	X							
5																	
6																	
7																	
8																	
9																	
10																	
11																	
12																	
13																	
14																	
LAB COMMENTS			Relinquished By (Signature/Printed)			DATE	TIME	Received By (Signature/Printed)			DATE	TIME					
1.0			<i>Jacob Berrett</i>			11/23/10	1700	<i>Kathy K...</i>			11/23/10	1100					
SHIPPING INFO			MATRIX CODES			TURNAROUND TIMES			COMPLIANCE INFORMATION			ADDITIONAL REMARKS					
☒ UPS			Water WT			☒ Check desired service			Compliance Monitoring? ☒ Y ☐ N								
☐ Fed Express			Soil SL			☐ Standard turnaround			Program (SDWA, NPDES,...)								
☐ US Mail			Solid SD			☐ RUSH - 5 Working Days			PWSID / Permit #								
☐ Hand Carried			Trip Blank TB			☐ URGENT - < 2 Working Days			Chlorinated? ☐ Y ☒ N								
☐ Other			Other OT			Rush & Urgent Surcharges will be applied			Sample Disposal: Lab ☒ Client								

Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 12/8/2010

Report ID: S1011392001

Project: Weaver
Lab ID: S1011392-001
Client Sample ID: P-151433
COC: 136825

Work Order: S1011392
Collection Date: 11/23/2010 10:40:00 AM
Date Received: 11/24/2010 11:36:00 AM
Sampler: JB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	398	5		µmhos/cm	11/30/2010 1551 KO	SM 2510B
Total Dissolved Solids (180)	240	10		mg/L	11/24/2010 1425 JF	SM 2540
Alkalinity, Total (As CaCO ₃)	217	5		mg/L	11/30/2010 1551 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	225	1		mg/L	12/06/2010 1226 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	12/03/2010 936 JF	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	1.15	0.05		mg/L	12/06/2010 1432 AS	EPA 353.2
Cations						
Calcium	58	1		mg/L	11/29/2010 834 DG	EPA 200.7
Magnesium	20	1		mg/L	11/29/2010 834 DG	EPA 200.7

These results apply only to the samples tested.

Qualifiers: * Value exceeds Maximum Contaminant Level
E Value above quantitation range
J Analyte detected below quantitation limits
M Value exceeds Monthly Ave or MCL
O Outside the Range of Dilutions

RL - Reporting Limit

B Analyte detected in the associated Method Blank
H Holding times for preparation or analysis exceeded
L Analyzed by a contract laboratory
ND Not Detected at the Reporting Limit
S Spike Recovery outside accepted recovery limits

Reviewed by:

Connie Mattson

Connie Mattson, Project Manager



Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 12/8/2010

Report ID: S1011392001

Project: Weaver
Lab ID: S1011392-002
Client Sample ID: P-151434
COC: 136825

Work Order: S1011392
Collection Date: 11/23/2010 11:48:00 AM
Date Received: 11/24/2010 11:36:00 AM
Sampler: JB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	449	5		µmhos/cm	11/30/2010 1558 KO	SM 2510B
Total Dissolved Solids (180)	280	10		mg/L	11/24/2010 1430 JF	SM 2540
Alkalinity, Total (As CaCO ₃)	219	5		mg/L	11/30/2010 1558 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	250	1		mg/L	12/06/2010 1226 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	12/03/2010 946 JF	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	2.46	0.05		mg/L	12/06/2010 1439 AS	EPA 353.2
Cations						
Calcium	61	1		mg/L	11/29/2010 839 DG	EPA 200.7
Magnesium	24	1		mg/L	11/29/2010 839 DG	EPA 200.7

These results apply only to the samples tested.

Qualifiers: * Value exceeds Maximum Contaminant Level
E Value above quantitation range
J Analyte detected below quantitation limits
M Value exceeds Monthly Ave or MCL
O Outside the Range of Dilutions

RL - Reporting Limit

B Analyte detected in the associated Method Blank
H Holding times for preparation or analysis exceeded
L Analyzed by a contract laboratory
ND Not Detected at the Reporting Limit
S Spike Recovery outside accepted recovery limits

Reviewed by:

Connie Mattson

Connie Mattson, Project Manager

658



Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 12/8/2010

Report ID: S1011392001

Project: Weaver
Lab ID: S1011392-003
Client Sample ID: FB112310
COC: 136825

Work Order: S1011392
Collection Date: 11/23/2010 11:51:00 AM
Date Received: 11/24/2010 11:36:00 AM
Sampler: JB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	ND	5		µmhos/cm	11/30/2010 1603 KO	SM 2510B
Total Dissolved Solids (180)	ND	10		mg/L	11/24/2010 1435 JF	SM 2540
Alkalinity, Total (As CaCO ₃)	ND	5		mg/L	11/30/2010 1603 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	ND	1		mg/L	12/06/2010 1226 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	12/03/2010 956 JF	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	ND	0.05		mg/L	12/06/2010 1440 AS	EPA 353.2
Cations						
Calcium	ND	1		mg/L	11/29/2010 843 DG	EPA 200.7
Magnesium	ND	1		mg/L	11/29/2010 843 DG	EPA 200.7

These results apply only to the samples tested.

Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- M Value exceeds Monthly Ave or MCL
- O Outside the Range of Dilutions

RL - Reporting Limit

B Analyte detected in the associated Method Blank
H Holding times for preparation or analysis exceeded
L Analyzed by a contract laboratory
ND Not Detected at the Reporting Limit
S Spike Recovery outside accepted recovery limits

Reviewed by: Connie Mattson
Connie Mattson, Project Manager



Sample Analysis Report

CLIENT: Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Date Reported: 12/8/2010
Report ID: S1011392001

Project: Weaver
Lab ID: S1011392-004
Client Sample ID: BD112310
COC: 136825

Work Order: S1011392
Collection Date: 11/23/2010
Date Received: 11/24/2010 11:36:00 AM
Sampler: JB
Matrix: Water

Analyses	Result	RL	Qual	Units	Date Analyzed/Init	Method
General Parameters						
Electrical Conductivity	417	5		µmhos/cm	11/30/2010 1611 KO	SM 2510B
Total Dissolved Solids (180)	240	10		mg/L	11/24/2010 1440 JF	SM 2540
Alkalinity, Total (As CaCO ₃)	225	5		mg/L	11/30/2010 1611 KO	SM 2320B
Hardness, Calcium/Magnesium (As CaCO ₃)	231	1		mg/L	12/06/2010 1226 KO	SM 2340B
Total Petroleum Hydrocarbons (SGT-HEM)	ND	5		mg/L	12/03/2010 1006 JF	EPA 1664A
Anions						
Nitrogen, Nitrate-Nitrite (as N)	1.06	0.05		mg/L	12/06/2010 1441 AS	EPA 353.2
Cations						
Calcium	60	1		mg/L	11/29/2010 853 DG	EPA 200.7
Magnesium	20	1		mg/L	11/29/2010 853 DG	EPA 200.7



These results apply only to the samples tested.

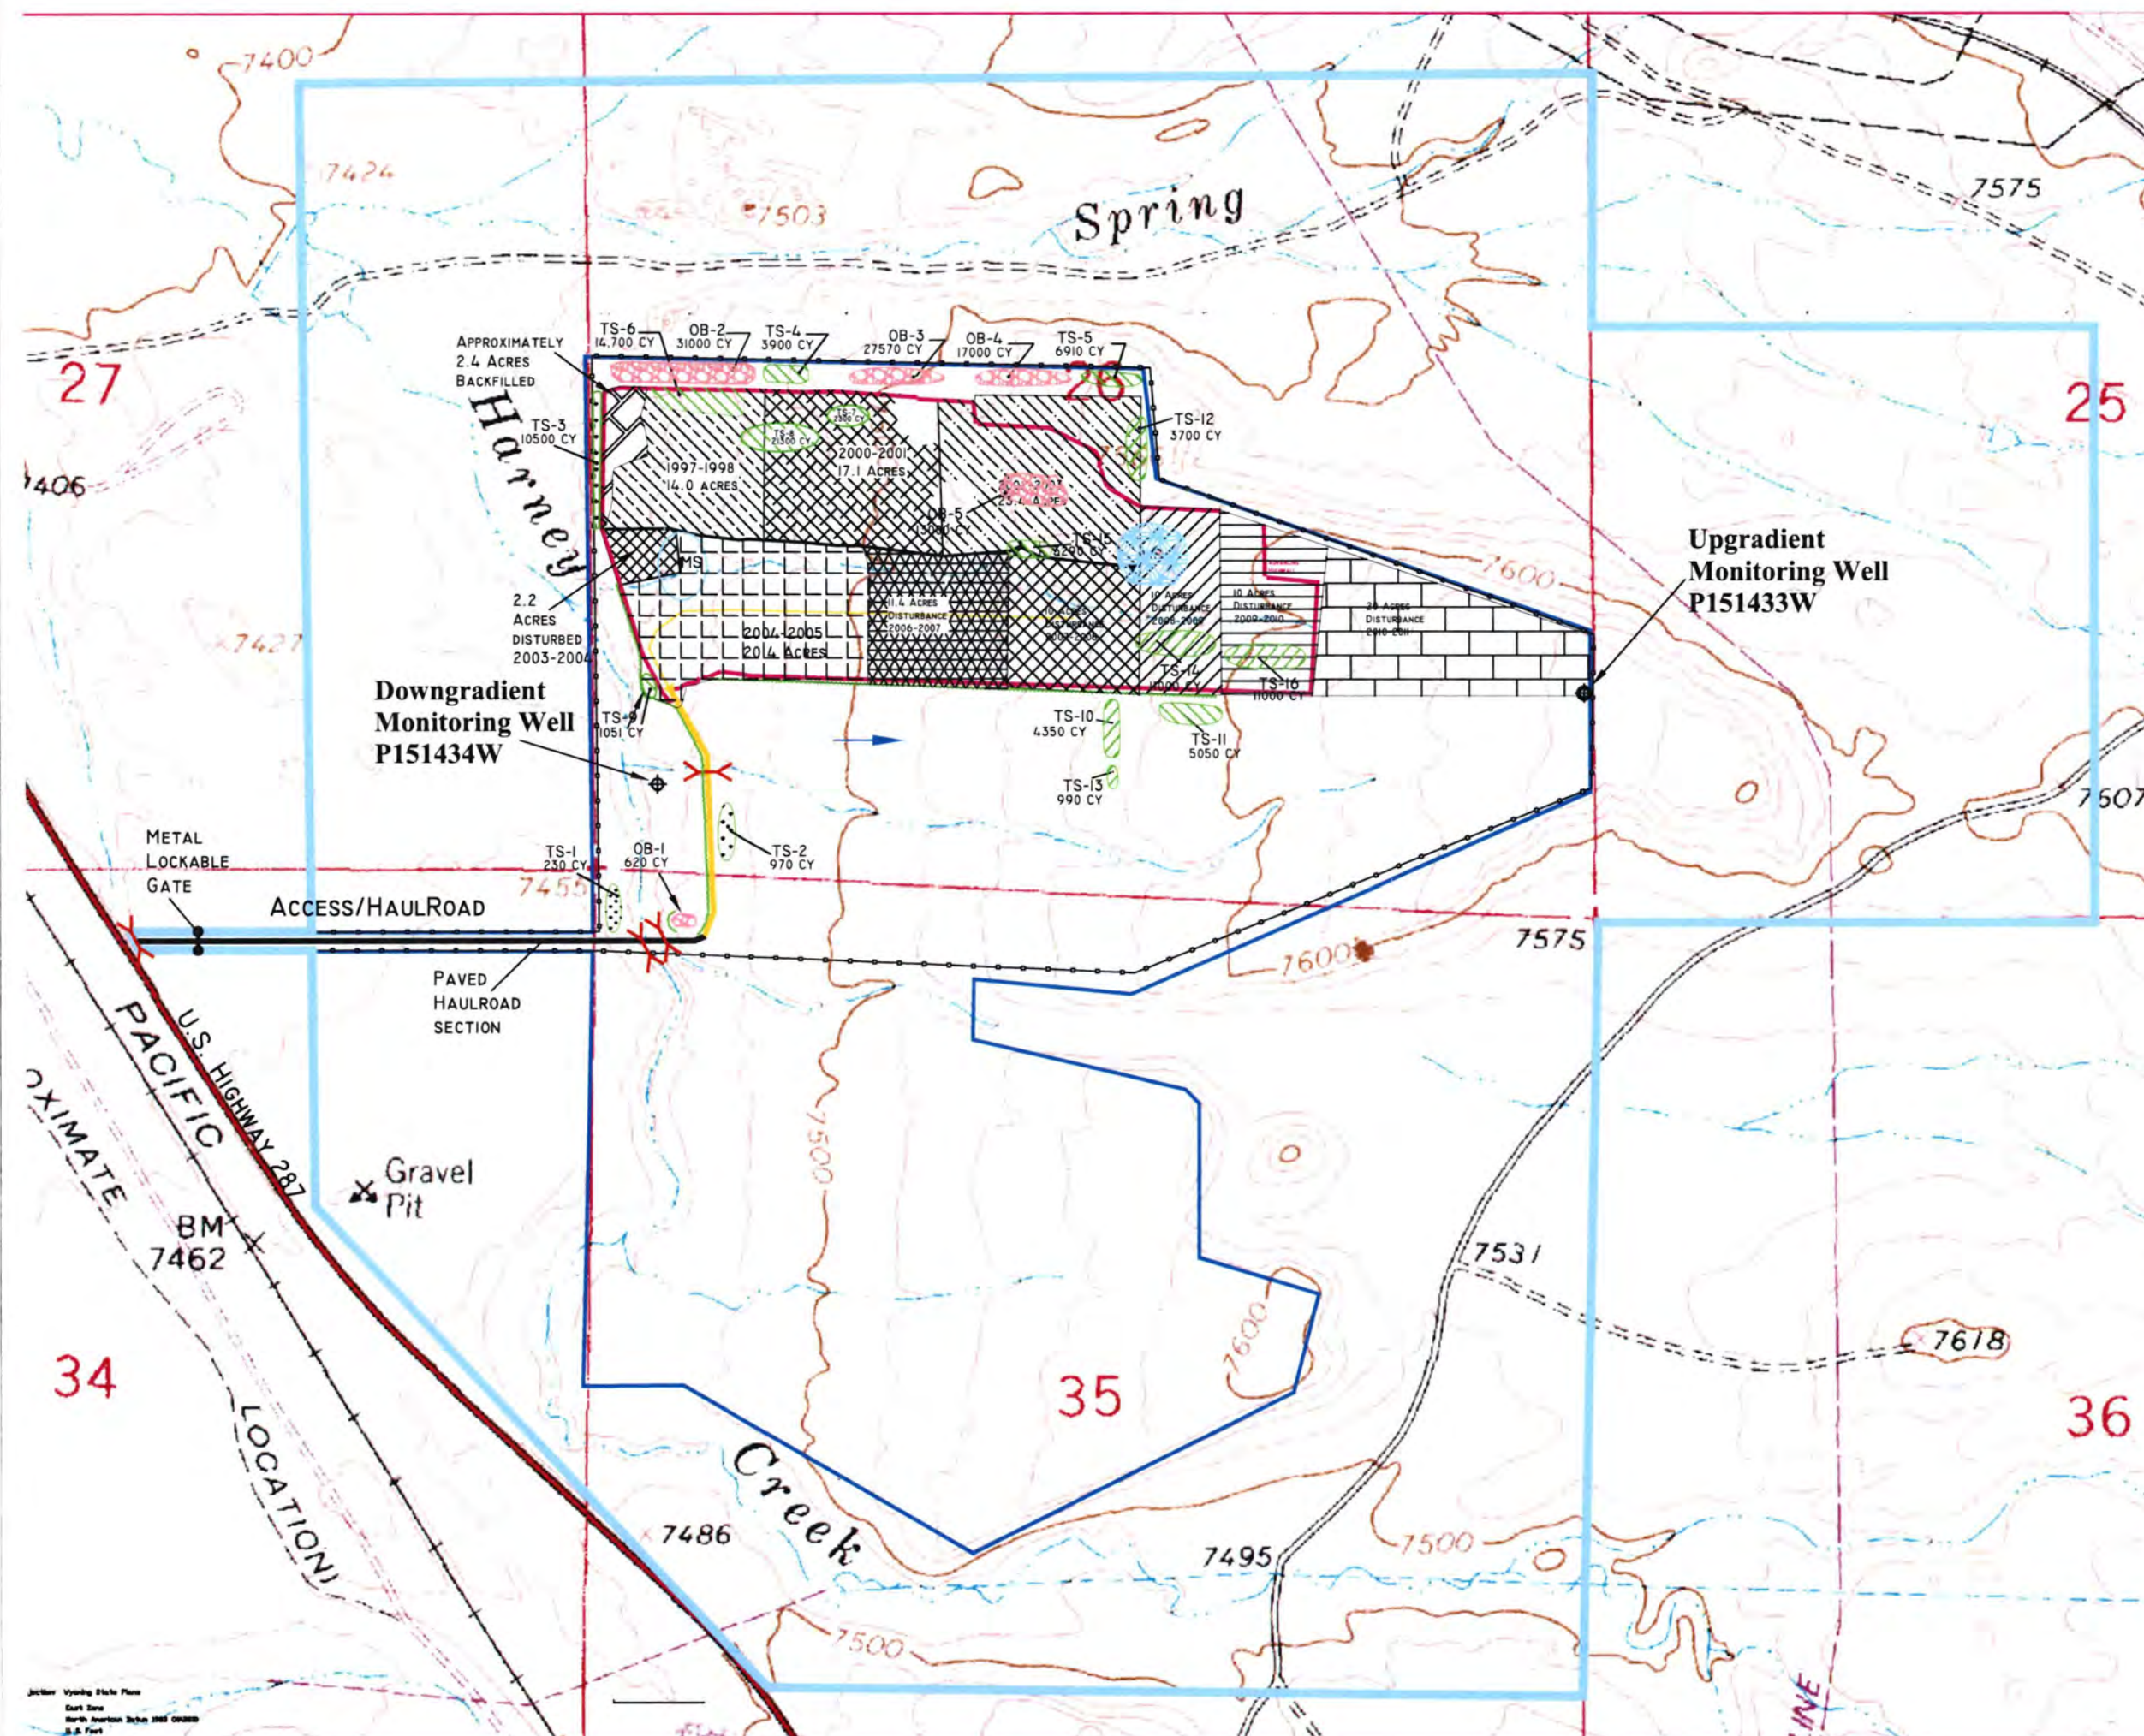
Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- M Value exceeds Monthly Ave or MCL
- O Outside the Range of Dilutions

RL - Reporting Limit

- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- L Analyzed by a contract laboratory
- ND Not Detected at the Reporting Limit
- S Spike Recovery outside accepted recovery limits

Reviewed by: Connie Mattson
Connie Mattson, Project Manager



LEGEND

- Permit Boundary
- Affected Area Boundary Limit
- Access/Haulroad with Paved Section
- Established (Seeded) Topsoil Stockpile with reference number
- Current Topsoil Stockpile with reference number
- Current Overburden Stockpile with reference number
- MS Current Material Stockpiles

CONTOUR INTERVAL 20'

N

0 500'

SCALE

1" = 850'

- Disturbed 1997-1998 Approximately 14.0 Acres
- Disturbed 2000-2001 Approximately 17.1 Acres
- Disturbed (Stripped) 2002-2003 Approximately 23.4 Acres
- Disturbed (Stripped) 2003-2004 Approximately 5.3 Acres
- Disturbance 2004-2005 Approximately 20.4 Acres
- Disturbance 2006-2007 Approximately 11.4 Acres
- Disturbance 2007-2008 Approximately 10 Acres
- Disturbance 2008-2009 Approximately 10 Acres
- Disturbance 2009-2010 Approximately 10 Acres
- Disturbance 2010-2011 Approximately 20 Acres
- Backfilled 2004-2005 Approximately 2.4 Acres
- Fence
- Culverts
- Monitoring Wells
- Direction of Mining

Stockpile Volumes		
Pile	Volume	Placement Date
TS-1	230	1996-1997
TS-2	970	1997-1998
TS-3	10,500	1997-1998
TS-4	3,900	2000-2001
TS-5	6,910	2001-2002
TS-6	14,700	2003-2004, 2004-2005
TS-7	2,300	2004-2005
TS-8	21,300	2004-2005
TS-9	1,051	2004-2005
TS-10	4,350	2006-2007
TS-11	5,050	2007-2008
TS-12	3,700	2007-2008
TS-13	990	2007-2008
TS-14	11,000	2008-2009
TS-15	3,290	about 2003-2004
TS-16	11,000	2010-2011
OB-1	620	Unknown, Harney Creek Crossing
OB-2	31,000	1997-1998, 2002-2003
OB-3	27,570	2005-2006
OB-4	17,000	2002-2003
OB-5	13,000	2007-2008
Total Topsoil available for reclamation:		101,240 CY
Total Overburden available for reclamation:		89,190 CY

Permit #658
Weaver Limestone Quarry
Annual Report Map AR-1
February 28, 2010 - February 27, 2011

Mountain Cement Company
5 Sand Creek Road
Laramie, WY 82070

Red Buttes, Wyo.
USGS Quad Map (Enhanced DRG)
Township 14N, Range 73W, 6th P.M.
Sections 25, 26, 34 & 35
Albany County, Wyoming

February 8, 2011 by AHM



Department of Environmental Quality

To protect, conserve and enhance the quality of Wyoming's environment for the benefit of current and future generations.



Dave Freudenthal, Governor

John Corra, Director

December 2, 2010

Mountain Cement Company
5 Sand Creek Road
Laramie WY 82070

RE: Permit No. 658

Dear Mr. MacClugage:

Enclosed is an Annual Report Form for your use in reporting all mining and reclamation activities in the referenced permit area since the last report. The time period covered by your Annual Report is the 12-month period ending no more than 60 days prior to this year's due date, February 28, 2011. Please specify the exact dates covered by your report. This report is required by W. S. §35-11-411(a).

Upon receipt and review of the report, you will be contacted by a District Staff member to arrange the annual inspection.

If you have questions, please contact the appropriate permit coordinator if known to you, or Lowell Spackman at 307.777.7052 or lspack@wyo.gov.

Sincerely,

Niomi Crase
Administrative Assistant
Land Quality Division

/ncc
Enclosure

