
Slot test plate

READY TO PRINT

Part (as modelled; print orientation in the STL)

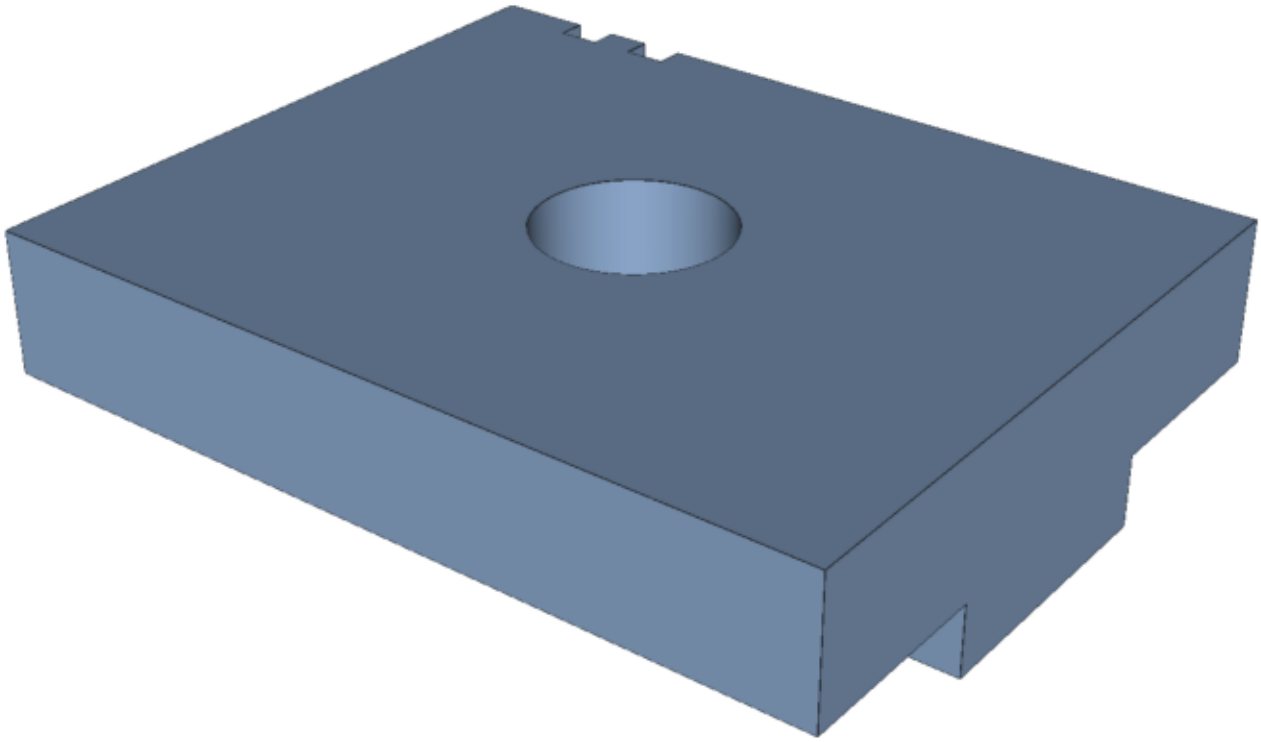

What: One test plate, key 9.6 mm (clearance 0.2 mm per side, 2 notches). Slides into the slot and bolts on with one M6 + T-nut: checks key fit, hole and bolt length.

Size: 30 x 24 x 8 mm


Mount: M6 button-head screws in slot-10 T-nuts; key 9.6 mm in the slot

Still needed: nothing


IAA100 DIN-rail mount

READY (datasheet)

Part (as modelled; print orientation in the STL)

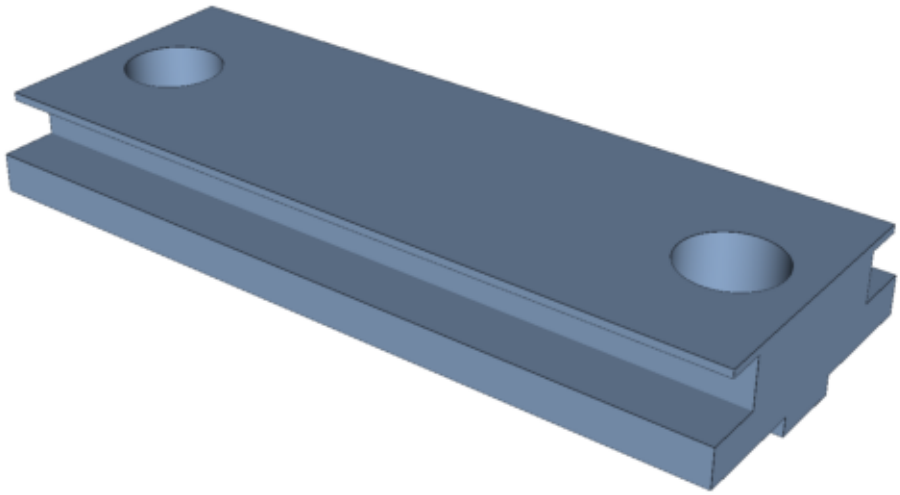

Mounted on the profile (grey); device envelope in red

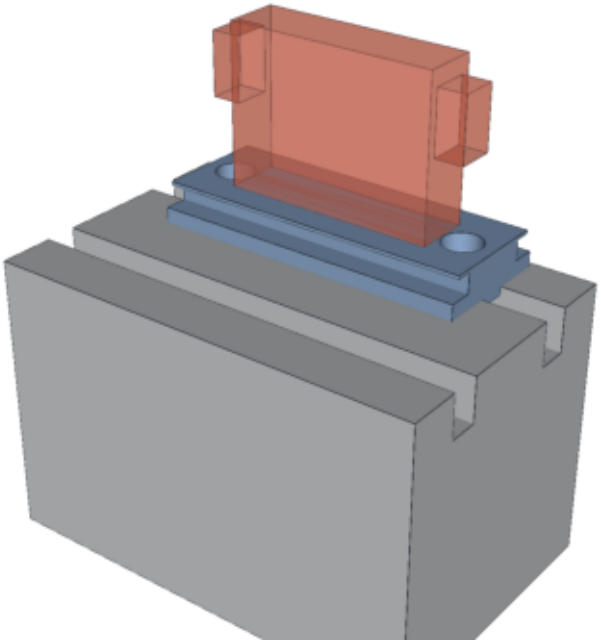

What: 100 mm printed 35 mm top-hat rail on a one-slot plate. The Futek IAA100 clips on (spring DIN clip, FI1573); plugs point up and down along the profile. Alternative: bolt a short steel DIN rail instead.

Size: 100 x 40 x 15 mm


Mount: M6 button-head screws in slot-10 T-nuts; key 9.6 mm in the slot

Still needed: check your IAA100 has the DIN clip (66.8 x 50.4 x 17.8 mm version)


24 V supply plate (RS-15-24)

READY (datasheet)

Part (as modelled; print orientation in the STL)

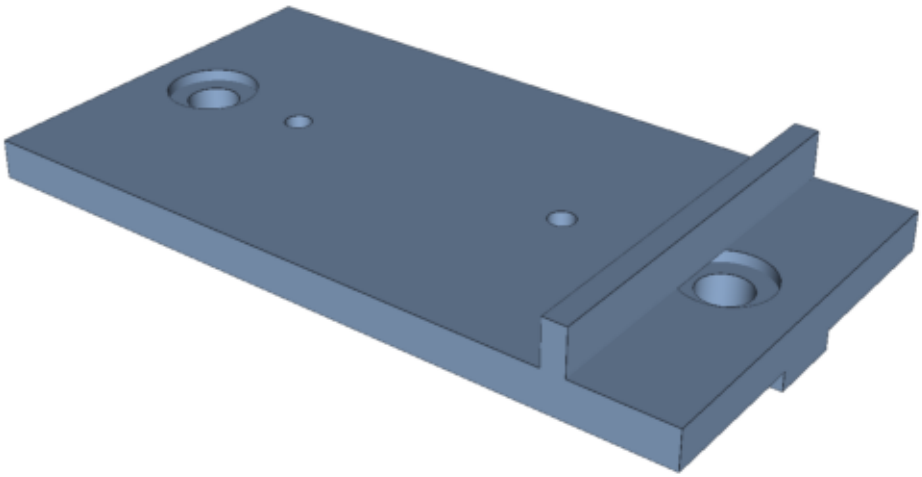

Mounted on the profile (grey); device envelope in red

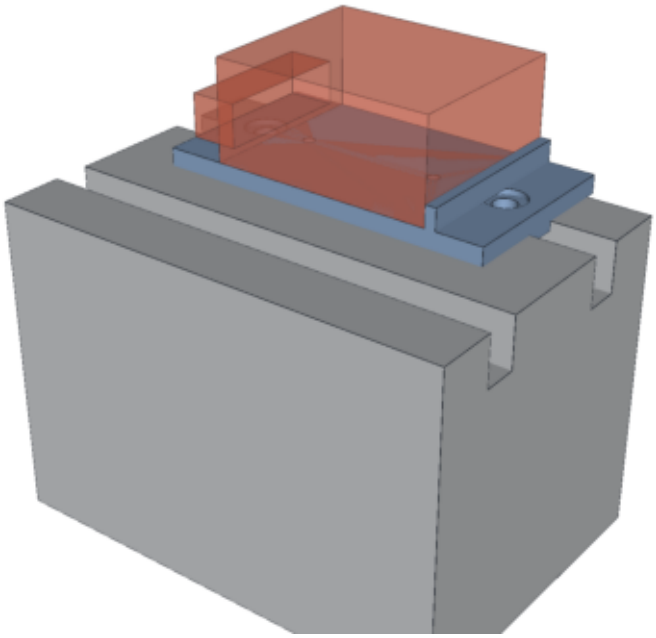

What: Plate under the Mean Well RS-15-24 (62.5 x 51 x 28 mm, case 971A), held by its 2 bottom M3 holes with M3 x 6 screws from the back; end stop opposite the terminals.

Size: 95 x 51 x 14 mm


Mount: M6 button-head screws in slot-10 T-nuts; key 9.6 mm in the slot

Still needed: M3 x 6 screws; a cover for the open 230 V terminals (electrician)


48 V supply brackets (RSP-2000-48)

READY (datasheet)

Part (as modelled; print orientation in the STL)

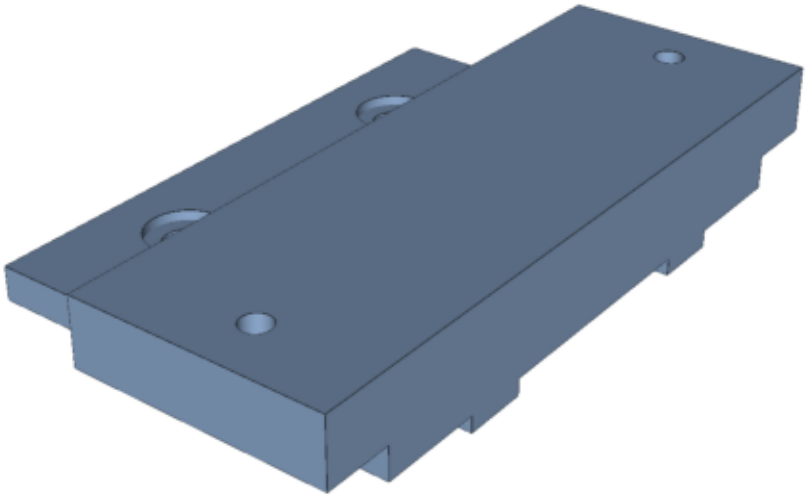

Mounted on the profile (grey); device envelope in red

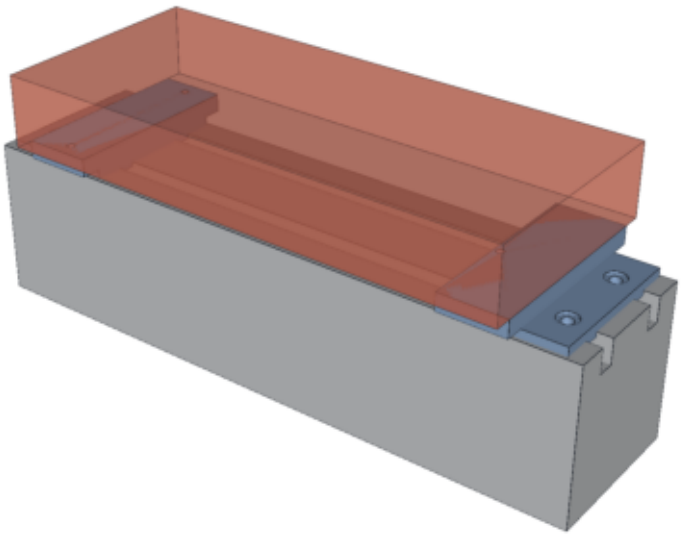

What: Two end brackets (A: 2 x M4, B: 1 x M4) under the Mean Well RSP-2000-48 (295 x 127 x 41 mm, 1.95 kg, case 952D). Keyed into both slots; M6 bolts past the supply ends stay reachable; 10 mm air gap behind the supply; fan ends free. Screw the supply onto both brackets first (M4 x 12 from the back, max 4 mm into the case), then bolt them to the profile. Print in ASA or PETG.

Size: 62 x 107 x 18 mm

Mount: M6 button-head screws in slot-10 T-nuts; key 9.6 mm in the slot

Still needed: M4 x 12 screws; check the supply's 3 M4 holes on the wide face match (case 952D)