




TOP

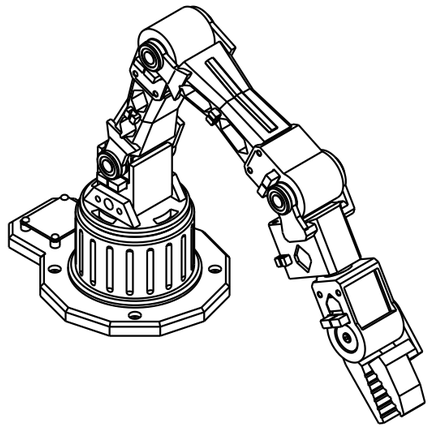

ISOMETRIC (NOT TO SCALE)

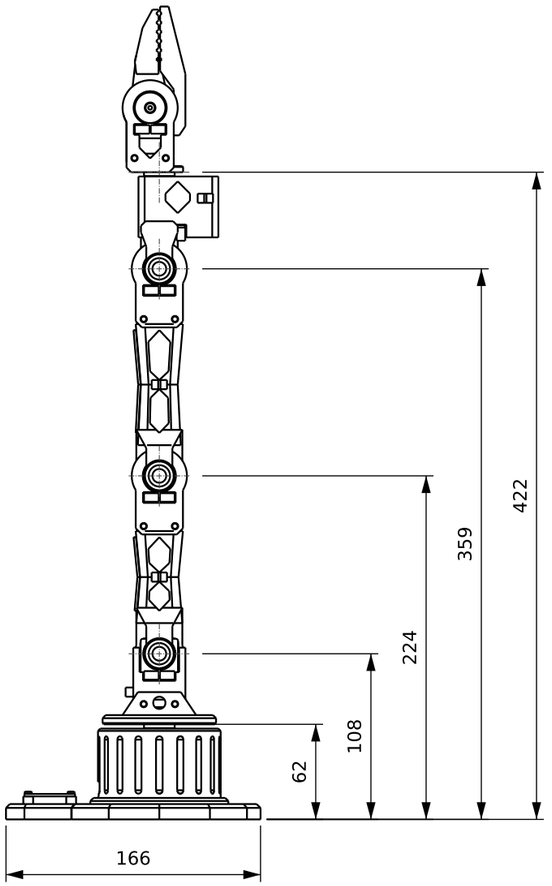

FRONT

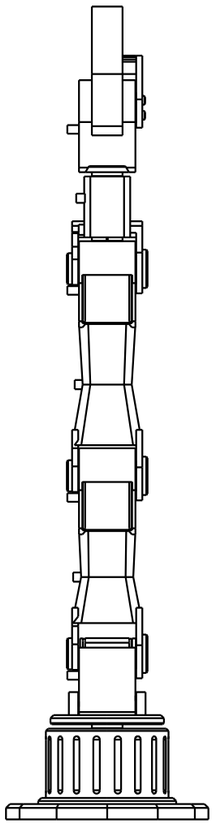

RIGHT

PARTS LIST (set = work set, A or B)

1.	TAL-101 Base	1	PLA	set A
2.	TAL-102 Shoulder (turntable+cradle)	1	PLA	set A
3.	TAL-103 Upper arm	1	PLA	set A
4.	TAL-104 Forearm	1	PLA	set B
5.	TAL-105 Wrist	1	PLA	set B
6.	TAL-106 Gripper body	1	PLA	set B
7.	TAL-107 Moving jaw	1	PLA	set B
8.	TAL-108 Hub cap, large	3	PLA	set A
9.	TAL-109 Hub cap, small	3	PLA	set A
10.	Feetech STS3215 servo (12 V)	6	bought	
11.	Waveshare Bus Servo Adapter (A)	1	bought	
12.	M3 x 6 button head (servo horns)	24	bought	
13.	M3 x 8 button head (passive horns)	3	bought	
14.	M2 x 5 self-tapping (servo cases)	12	bought	
15.	M2 x 6 self-tapping (servo cases)	8	bought	
16.	M2.5 x 6 self-tapping (board)	4	bought	
17.	M4 bolts to the table (user's)	4	bought	
18.	3-pin bus servo cables	6	with servos	

JOINT LAYOUT

1. Pan axis: vertical through the base centre. Pan horn face 62 above the table.
2. Shoulder axis (along Y): 46 above the pan horn face, on the pan axis.
3. Upper arm 116, forearm 135 (axis to axis). Wrist flex axis to roll horn face 63. Jaw pivot 42 ahead of the roll horn face, 6 above the roll axis.
4. Clevis plates on every pitch joint: output plate +Y (y 18.9..22.9), idler plate -Y (y -22.9..-18.9).
5. Front view: zero pose (all joints 0, arm straight up). Isometric: 'ready' pose.

NOTES

- All dimensions mm. Third-angle projection. Do not scale the drawing.
- Part sheets give each part in its own frame; this sheet shows where those frames sit.

REFERENCE: in work sets A and B

THIRD ANGLE

PROJECT TALOS 5-axis arm	EST. MASS -
PART **General assembly and parts list**	SCALE 1:4
PART NO. **TAL-000**	UNITS / REV mm / A
QTY / ARM -	DATE 2026-11-03
MATERIAL -	SHEET 1 of 12