

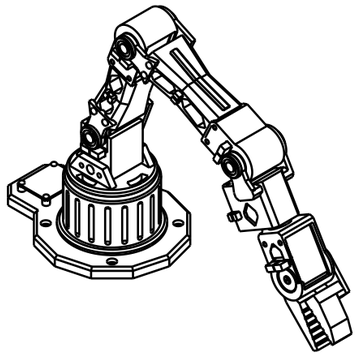


ISOMETRIC (NOT TO SCALE)

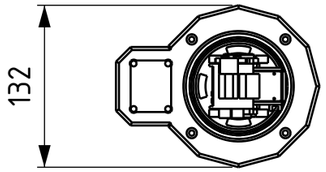

TOP

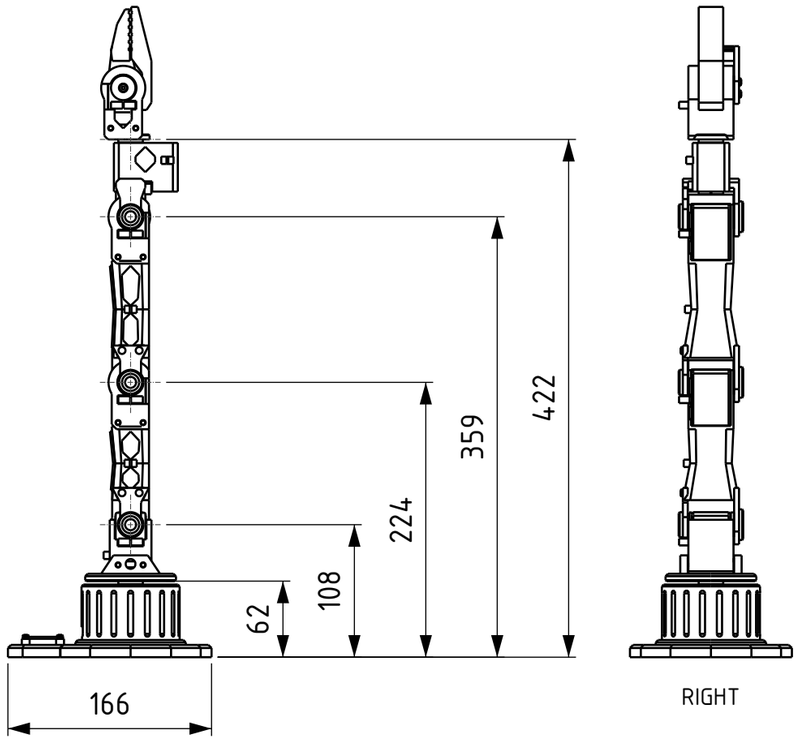

FRONT

RIGHT

PRINTED PARTS

PART NO.	NAME	QTY	SET
TAL-101	Base	1	A
TAL-102	Shoulder (turntable + cradle)	1	A
TAL-103	Upper arm	1	A
TAL-104	Forearm	1	B
TAL-105	Wrist	1	B
TAL-106	Gripper body	1	B
TAL-107	Moving jaw	1	B
TAL-108	Hub cap, large	3	A
TAL-109	Hub cap, small	3	A
TAL-110	Idler plate	2	B

BOUGHT PARTS

ITEM	QTY
Feetech STS3215 servo (12 V)	6
Waveshare Bus Servo Adapter (A)	1
M3 x 6 button head (servo horns)	24
M3 x 8 button head (passive horns)	3
M3 x 10 button head (idler plates)	4
M2 x 5 self-tapping (servo cases)	12
M2 x 6 self-tapping (servo cases)	8
M2.5 x 6 self-tapping (board)	4
M4 bolts to the table (user's)	4
3-pin bus servo cables (with servos)	6

JOINT LAYOUT

1. Pan axis vertical through the base centre; pan horn face 62 above the table. Plinth 132 across corners.
2. Shoulder axis (along Y) 46 above the pan horn face. Upper arm 116, forearm 135 (axis to axis). Wrist flex axis to roll horn face 63.
3. Front view: zero pose (all joints 0). Isometric: 'ready' pose.

NOTES

- All dimensions mm. Third-angle projection. Do not scale the drawing.
- Part sheets give each part in its own frame; this sheet shows where those frames sit.

THIRD ANGLE PROJECTION

REFERENCE SHEET: in work sets A and B

PROJECT TALOS 5-axis arm	EST. MASS -
PART General assembly and parts list	SCALE 1:5
PART NO. TAL-000	UNITS / REV mm / A
QTY / ARM -	DATE 2026-11-05
MATERIAL -	SHEET 1 of 21