

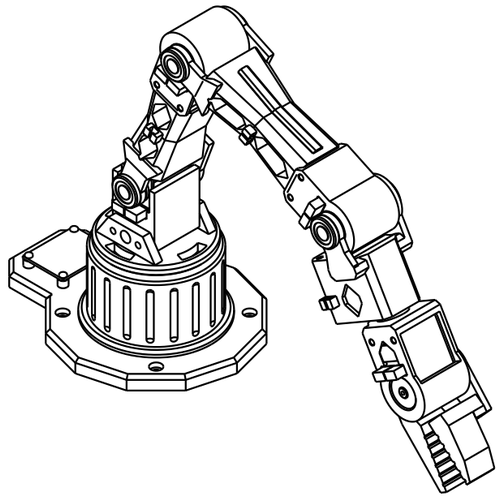


ISOMETRIC (NOT TO SCALE)

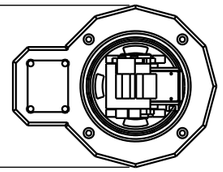

TOP

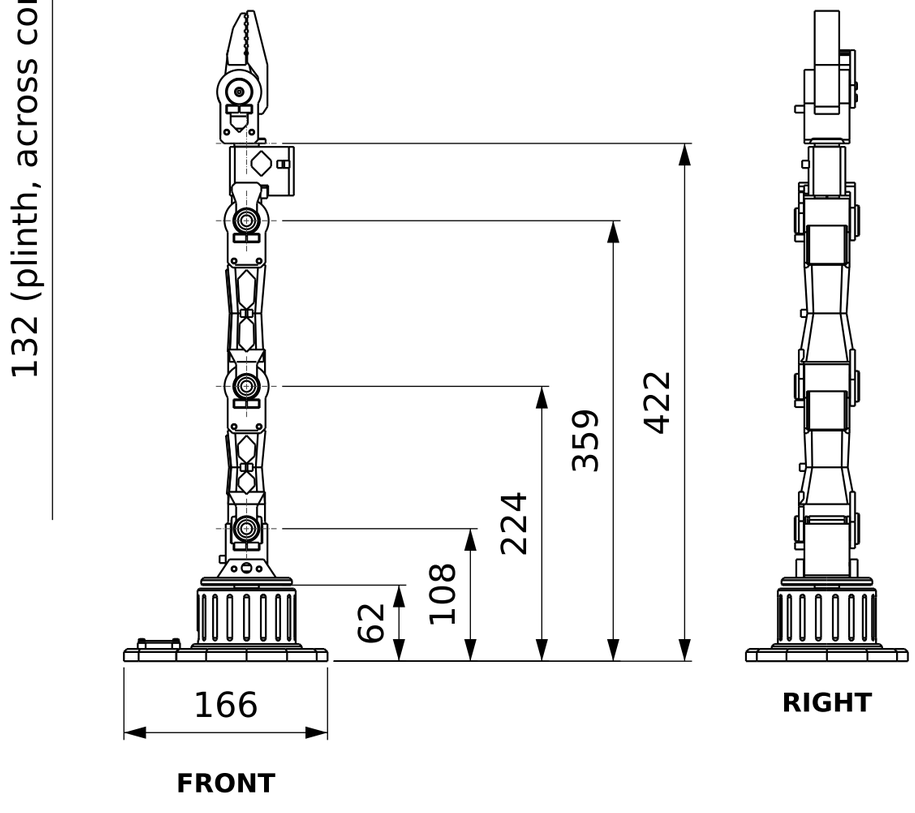

FRONT

RIGHT

PARTS LIST (set = work set, A or B)

1.	TAL-101	Base	1	PLA, set A
2.	TAL-102	Shoulder (turntable+cradle)	1	PLA, set A
3.	TAL-103	Upper arm	1	PLA, set A
4.	TAL-104	Forearm	1	PLA, set B
5.	TAL-105	Wrist	1	PLA, set B
6.	TAL-106	Gripper body	1	PLA, set B
7.	TAL-107	Moving jaw	1	PLA, set B
8.	TAL-108	Hub cap, large	3	PLA, set A
9.	TAL-109	Hub cap, small	3	PLA, set A
10.	Feetech STS3215 servo (12 V)		6	bought
11.	Waveshare Bus Servo Adapter (A)		1	bought
12.	M3 x 6 button head (servo horns)		24	bought
13.	M3 x 8 button head (passive horns)		3	bought
14.	M2 x 5 self-tapping (servo cases)		12	bought
15.	M2 x 6 self-tapping (servo cases)		8	bought
16.	M2.5 x 6 self-tapping (board)		4	bought
17.	M4 bolts to the table (user's)		4	bought
18.	3-pin bus servo cables		6	with servos

JOINT LAYOUT

1. Pan axis: vertical through the base centre. Pan horn face 62 above the table.
2. Shoulder axis (along Y): 46 above the pan horn face, on the pan axis.
3. Upper arm 116, forearm 135 (axis to axis). Wrist flex axis to roll horn face 63. Jaw pivot 42 ahead of the roll horn face, 6 above the roll axis.
4. Clevis plates on every pitch joint: output plate +Y (y 18.9..22.9), idler plate -Y (y -22.9..-18.9).
5. Front view: zero pose (all joints 0, arm straight up). Isometric: 'ready' pose.

NOTES

- All dimensions mm. Third-angle projection. Do not scale the drawing.
- Part sheets give each part in its own frame; this sheet shows where those frames sit.

THIRD ANGLE PROJECTION

REFERENCE SHEET: in work sets A and B	
PROJECT TALOS 5-axis arm	EST. MASS -
PART **General assembly and parts list**	SCALE 1:5
PART NO. **TAL-000**	UNITS / REV mm / A
QTY / ARM -	DATE 2026-11-04
MATERIAL -	SHEET 1 of 12