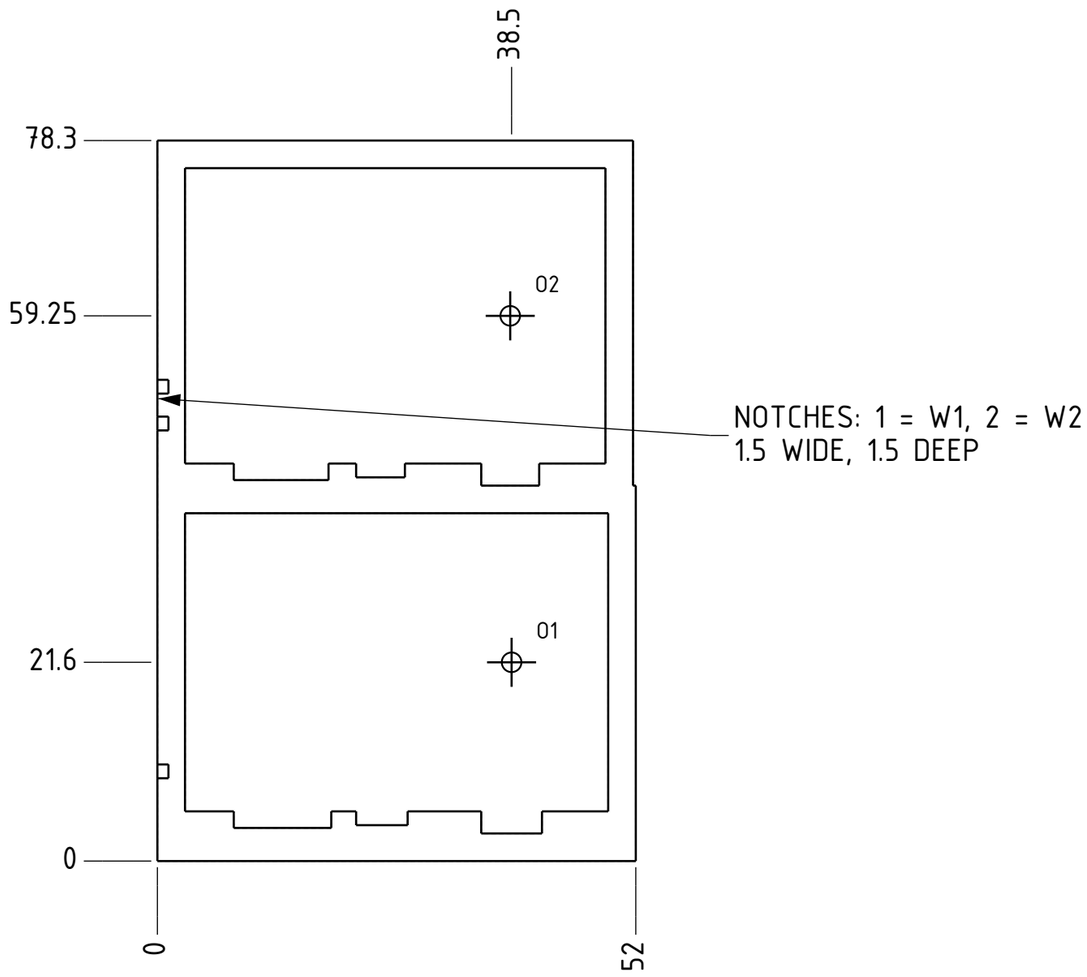

TOP (AS PRINTED)

FRONT

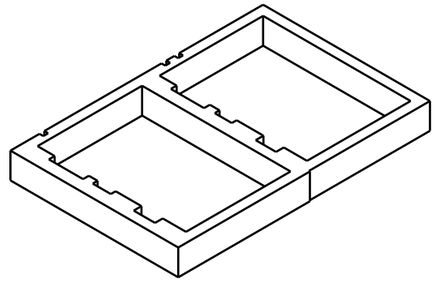

ISOMETRIC (NOT TO SCALE)

GAUGE WINDOW AT ZERO CLEARANCE (X, Y)

RECTANGLE	X	Y
Body	−35.2 to 10.2	−15.9 to 15.9
Back pad notch	−29.9 to −19.9	−17.7 to 0
Header notch	−16.6 to −11.6	−17.4 to 0
Boss notch	−3 to 3	−18.3 to 0

FEATURES (in order)

1. Two frames, 8 thick (z 0 to 8), 3 walls, sharing the middle wall; overall 52 × 78.3.
2. Window W1 about O1 (38.5, 21.6): the four rectangles grown by 0.3, the clearance every servo pocket uses. Cut through Z.
3. Window W2 about O2 (38.35, 59.25): the same, grown by 0.15 (tight).
4. Notches on the x 0 wall's top edge: one beside W1, two beside W2.

NOTES

- All dimensions mm. Third-angle projection. Do not scale the drawing.
- Use: push the bare servo (no horns, no cables) through each window along its width, back face (connectors, idler boss) toward the notched side of the window.
- It should go through W1 by hand with light friction and not through W2. If W1 binds, or W2 lets it through, tune the printer (flow, horizontal expansion) before printing the arm.
- Print: flat; no support. Print it first, with the same settings as the arm.

THIRD ANGLE PROJECTION

WORK SET A: base, shoulder, upper arm, hub caps, fit gauge	
PROJECT TALOS 5-axis arm	EST. MASS 10 g
PART Servo fit gauge	SCALE 3:2
PART NO. TAL-111	UNITS / REV mm / A
QTY / ARM 1	DATE 2026-11-06
MATERIAL PLA, 20 % infill, 3 perimeters	SHEET 21 of 21