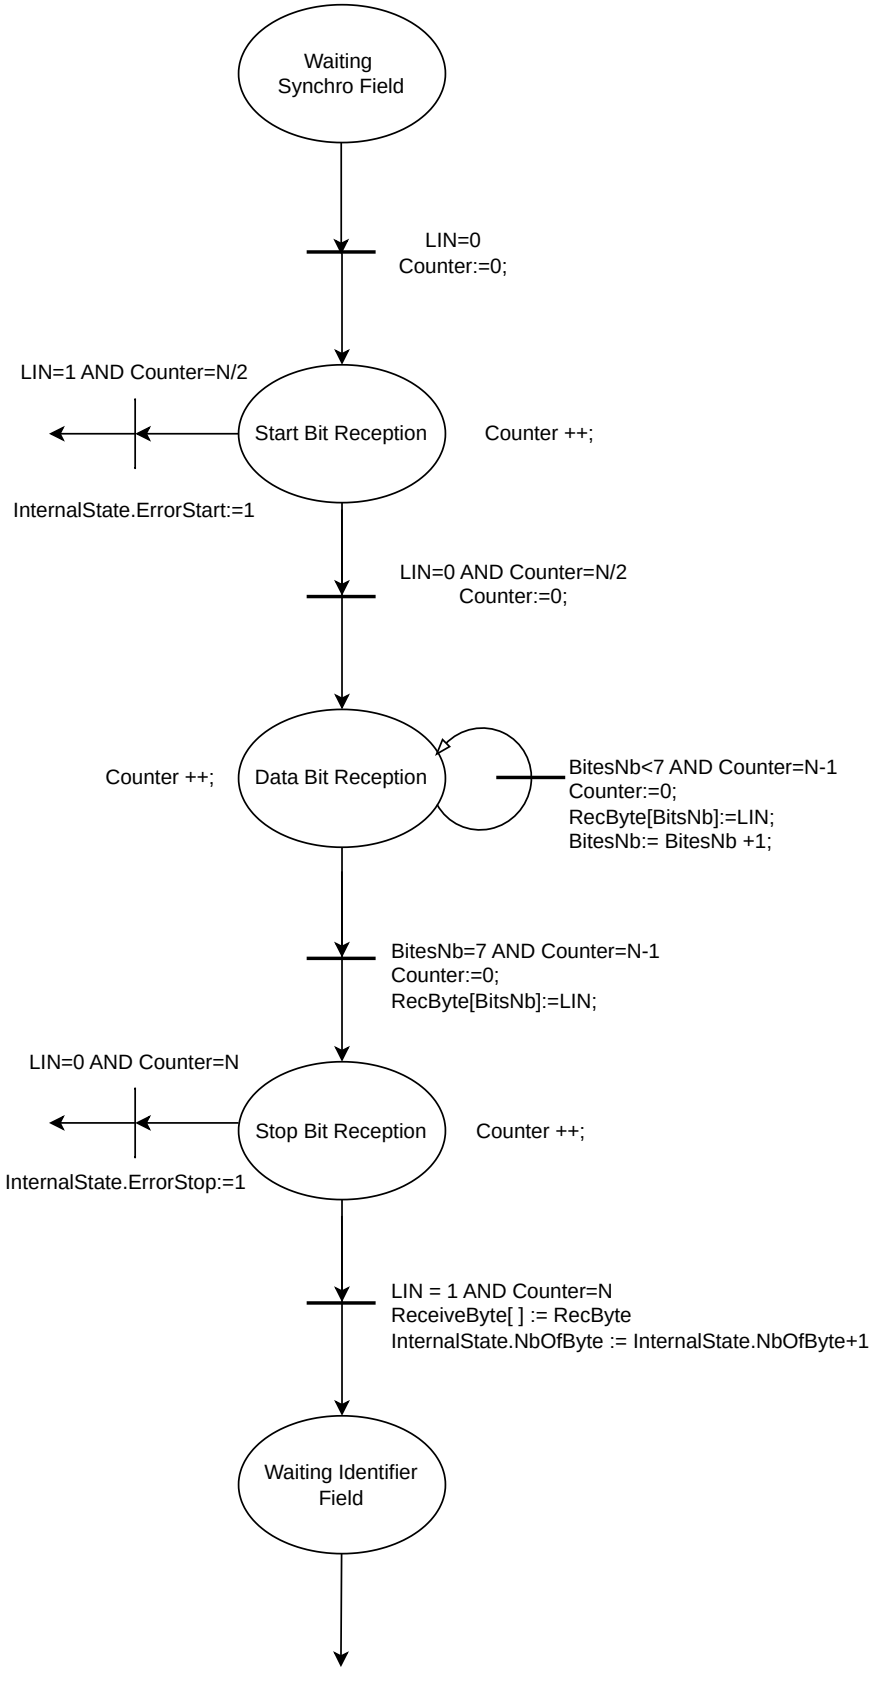
Waiting
Synchro Field
LIN=0
Counter:=0;
LIN=1 AND Counter=N/2
Start Bit Reception
Counter ++;
InternalState.ErrorStart:=1
LIN=0 AND Counter=N/2
Counter:=0;
Counter ++;
Data Bit Reception
BitesNb<7 AND Counter=N-1
Counter:=0;
RecByte[BitsNb]:=LIN;
BitesNb:= BitesNb +1;
BitesNb=7 AND Counter=N-1
Counter:=0;
RecByte[BitsNb]:=LIN;
LIN=0 AND Counter=N
Stop Bit Reception
Counter ++;
InternalState.ErrorStop:=1
LIN = 1 AND Counter=N
ReceiveByte[ ] := RecByte
InternalState.NbOfByte := InternalState.NbOfByte+1
Waiting Identifier
Field