



DEALER BEST PRACTICE SERIES

Auxiliary Fleet and
Loaders GET Chart for
Preventive Maintenance

Maintenance and Repair	Application	Component Life Management	Component Renewal (CRC)	MARC Management
Auxiliary Fleet and Loaders GET Chart for Preventive Maintenance0				
1.0 Introduction.....1				
2.0 Best Practice Description.....1				
3.0 Implementation Steps4				
4.0 Benefits.....5				
5.0 Resources Required5				
6.0 Supporting Attachments / References5				
7.0 Related Best Practices5				
8.0 Acknowledgements.....6				

DISCLAIMER: The information and potential benefits included in this document are based upon information provided by one or more Caterpillar dealers, and such dealer(s) opinion of “Best Practices”. Caterpillar makes no representation or warranty about the information contained in this document or the products referenced herein. Caterpillar welcomes additional “Best Practice” recommendations from our dealer network.

1.0 Introduction

At the Xstrata Tintaya mine site there are other Ground Engaging Tool (GET) suppliers besides Caterpillar, such as Metalogenia and BladeMaster. As a result of the presence of several suppliers, the consumption and invoicing of Caterpillar's GET has decreased. Through mechanic technicians, planners, or workshop managers, the customer has several people making the decisions for product purchasing.

To differentiate Caterpillar GET, Ferreyros has proposed an alternative solution. This proposal consists of a chart of all Caterpillar GET consumables for every piece of mine equipment. The goal is to increase Caterpillar GET's visibility, and make it easier for customers to choose Caterpillar GET.

This improvement has allowed Ferreyros to increase participation in current market and grow their sales considerably.

2.0 Best Practice Description

The chart below shows the equipment model with its Caterpillar parts number, graphics, quantity of pieces, proper fit, and customer's ellipse code.

In addition to the information in the chart below, it may be helpful to include:

- Information relating to any reuse of the parts or if they are replaced 100% of the time
- Any GET Kits that are available
- Any tooling required for the removal and installation of the GET
- Reference to any heal shrouds, MAWPs, or other wear products (Chock bars, Chocky buttons, Chocky Blocks, or Roll bars)

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT WRITTEN PERMISSION OF CATERPILLAR			
Auxiliary Fleet and Loaders GET Chart for Preventive Maintenance	DATE 2/16/2015	CHG NO 00	NUMBER 1010-2.06-1214

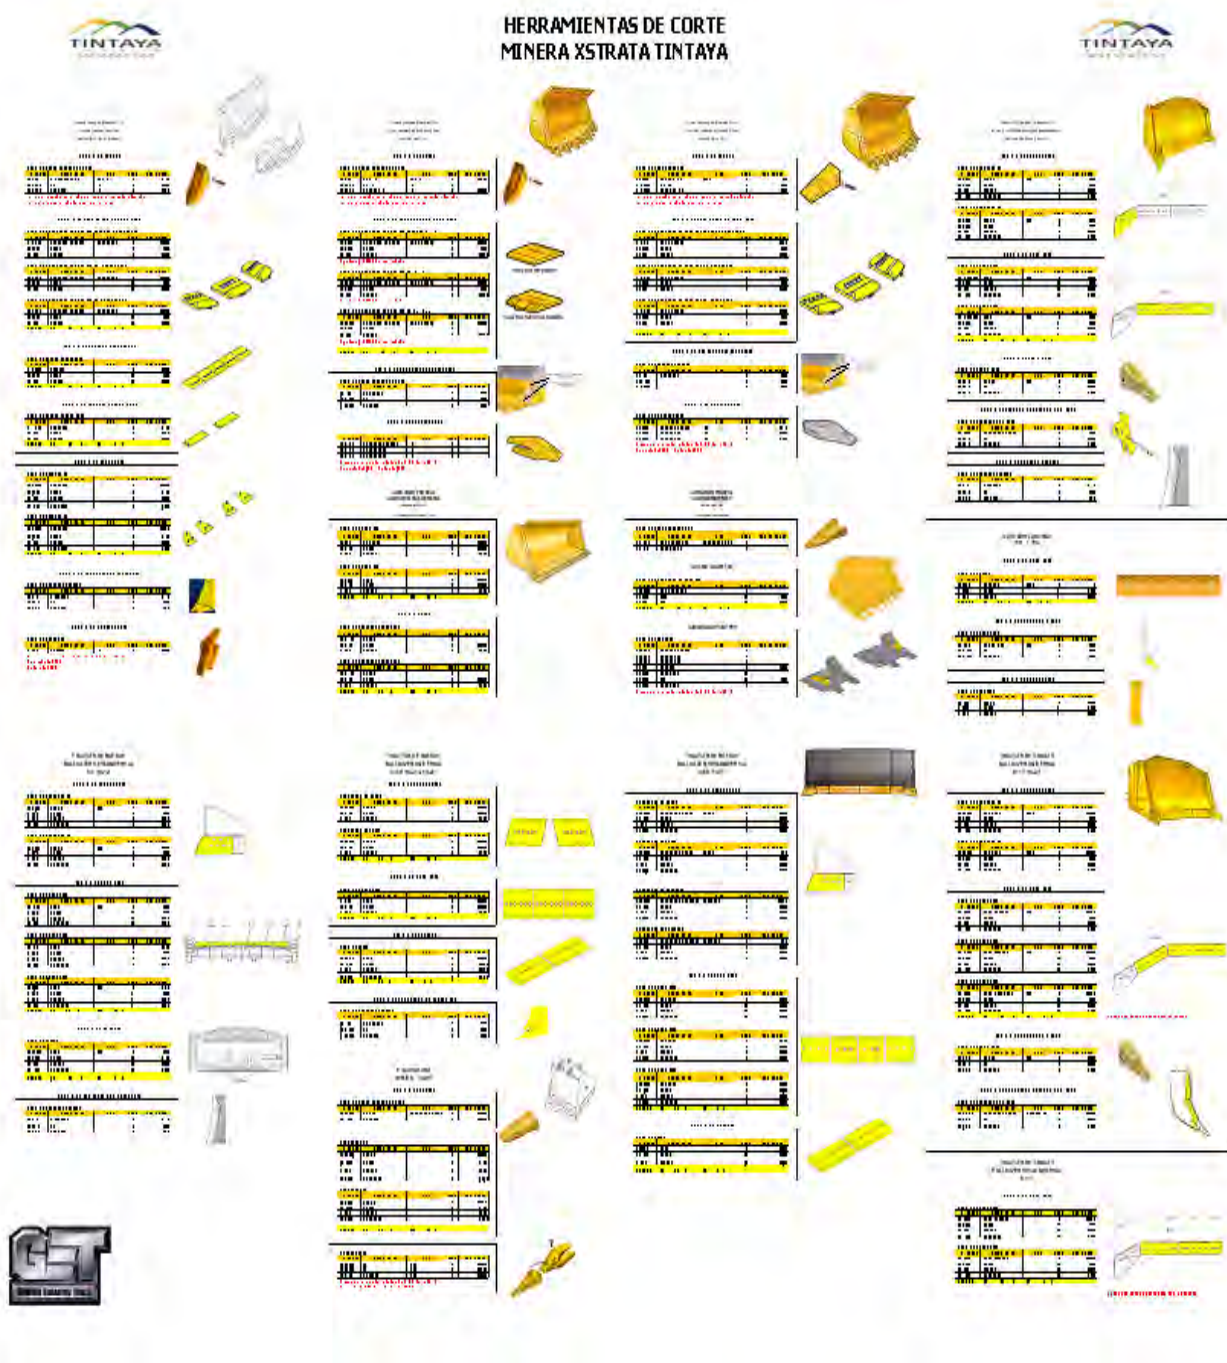


Figure 1: Part Number GET Chart - chart dimensions are 60" x 40".

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT WRITTEN PERMISSION OF CATERPILLAR

Auxiliary Fleet and Loaders GET Chart for Preventive Maintenance

DATE
2/16/2015CHG
NO
00NUMBER
1010-2.06-1214



Wheel Loader


994F 50-26 & 50-28
ROCK BUCKET

CATERPILLAR

Tip Change

HDP Penetration tip change				
Part Number	Description	Type	Quantity	Ellipse Code
135-9800	Penetration tip	HDP 3800	08	20081
134-1808	Pin	3800	08	19562
134-1809	Retainer	3800	08	11270

Install the retainer on the adapter's notch by the plastic side
Install the pin on the side of the longest stroke

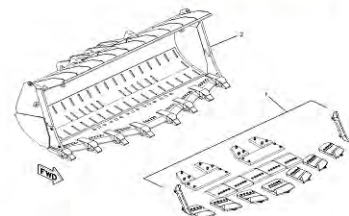


Cutting edges Segment Change

Central cutting edge segment change (Half Arrow)				
Part Number	Description	Type	Quantity	Ellipse Code
109-9033	Cutting edge segment	Half Arrow	01	165365
5P-8823	Pin		05	9944
3K-9770	Nut		05	22145

RH cutting edge segment change (Half Arrow)				
Part Number	Description	Type	Quantity	Ellipse Code
117-6805	Cutting edge segment	Half Arrow	03	165365
5P-8823	Pin		15	9944
3K-9770	Nut		15	22145

LH cutting edge segment change (Half Arrow)				
Part Number	Description	Type	Quantity	Ellipse Code
117-6806	Cutting edge segment	Half Arrow	03	165381
5P-8823	Pin		15	9944
3K-9770	Nut		15	22145


Torque: 1700 +/- 220 ft.lbs 2300 +/- 300N.m

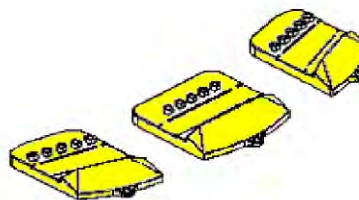

Change of front sole plate

Change of front sole plate				
Part Number	Description	Type	Quantity	Ellipse Code
107-3383	Front sole plate		05	19315
5P-8823	Pin		25	9944
3K-9770	Nut		25	22145


Torque: 1700 +/- 220 ft.lbs 2300 +/- 300N.m

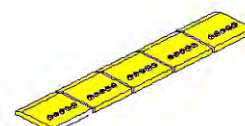

Change of rear sole plate

Change of rear sole plate				
Part Number	Description	Type	Quantity	Ellipse Code
100-4015	Posterior sole plate		02	20073
6V-8360	Pin		08	13870
3K-9770	Nut		08	22145

Torque: 1700 +/- 220 ft.lbs 2300 +/- 300N.m

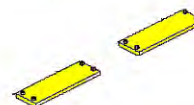


Change of heel plate

RH heel plate change				
Part Number	Description	Type	Quantity	Ellipse Code
144-1281	Heel plate		02	165399
28-1955	Pin		06	20024
3K-9770	Nut		06	22145
4K-0684	Washer		06	10892

LH heel plate change				
Part Number	Description	Type	Quantity	Ellipse Code
144-1281	Heel plate		02	165407
28-1955	Pin		06	20024
3K-9770	Nut		06	22145
4K-0684	Washer		06	10892

Torque: 1700 +/- 220 ft.lbs 2300 +/- 300N.m

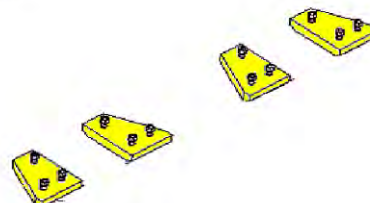

Change of Siderbar

Change of Siderbar				
Part Number	Description	Type	Quantity	Ellipse Code
125-0800	Siderbar	Half Arrow	02	20040
8E-4708	Pin		04	5363
4T-4707	Nut		04	6270



Change of Adapters

Change of Adapters				
Part Number	Description	Type	Quantity	Ellipse Code
61-8804	Adapter	3800	08	58529

Pre-heat the welding area from 204°C to 260°C
Do not exceed 315°C
Hot less than 175°C



CATERPILLAR

GROUND ENGAGING TOOLS

Figure 2: Larger view of detail in Figure 1.

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT WRITTEN PERMISSION OF CATERPILLAR

Auxiliary Fleet and Loaders GET Chart for Preventive
MaintenanceDATE
2/16/2015CHG
NO
00NUMBER
1010-2.06-1214

Cutting edges Segment Change

Central cutting edge segment change (Half Arrow)				
Part Number	Description	Type	Quantity	Ellipse Code
109-9033	Cutting edge segment	Half Arrow	01	165365
5P-8823	Pin		05	9944
3K-9770	Nut		05	22145
RH cutting edge segment change (Half Arrow)				
Part Number	Description	Type	Quantity	Ellipse Code
117-6805	Cutting edge segment	Half Arrow	03	165365
5P-8823	Pin		15	9944
3K-9770	Nut		15	22145
LH cutting edge segment change (Half Arrow)				
Part Number	Description	Type	Quantity	Ellipse Code
117-6806	Cutting edge segment	Half Arrow	03	165381
5P-8823	Pin		15	9944
3K-9770	Nut		15	22145
Torque:		1700 +/- 220 ft.lbs	2300 +/-300Nm	

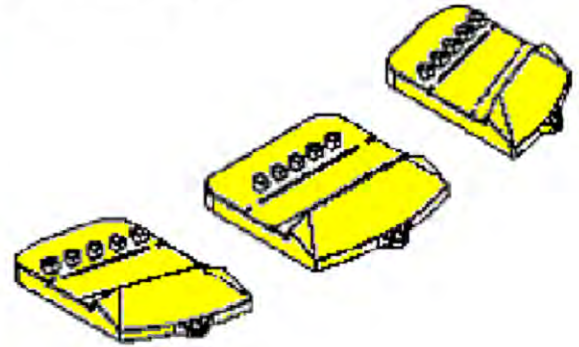


Figure 3: Table Detail included in Figure 1 and Figure 2.

3.0 Implementation Steps

1. Park machine requiring GET
2. Locate part number and amount required per machine
3. Perform a boneyard analysis to identify if current GET is correct fit for machine/application
4. Create table for each type of equipment/part and insert images
5. Enter customer's code for every part number
6. Perform a search for the torque and tooling needed to install/remove GET
7. Create chart for mine site by combining information for all equipment on site
8. Print large size chart (poster)
9. Format chart to be displayed and identify place to set in mine Workshop

Optional:

If the customer used PartStore™, set up the GET groups in the PartStore™ system to further facilitate the ordering and replacement process.

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT WRITTEN PERMISSION OF CATERPILLAR			
Auxiliary Fleet and Loaders GET Chart for Preventive Maintenance		DATE 2/16/2015	CHG NO 00
			NUMBER 1010-2.06-1214

4.0 Benefits

- Reduced searching time in parts manual
- Reduced time spent by planner when searching customer (ellipse) codes
- Reduced time to request spare parts
- Reduced time to identify proper adjustment and welding procedures
- Provides increase visibility to Caterpillar GET resulting in increased business/revenue for the dealer
- Provides an approximate time savings of 67% for the customer (Chart 1), significantly reducing the time to request GET for scheduled maintenance

Chart 1: Approximate time to perform task

Personnel	Description of the job	Spent Time (min)	Spent time using the chart (min)
M. Technician	search in parts manual	30	5
Planner	Search ellipse codes	30	0
Planner	Spare parts request	30	30
M. Technician	Torque search	30	5
Time spent		120	40
Difference		67%	

5.0 Resources Required

- GET Field Inspector

6.0 Supporting Attachments / References

- GET PSK
- Service Manual (SIS)
- Boneyard Analysis: PERJ0008-03 Cat Parts Pro Ground Engaging Tools (GET) – English
- PartStore: PEDJ0075-01 Cat[®] PartStore[™] Brochure
- Wear Protection: PEHJ0208-01 Total Wear Protection
- Wear Protection: IRM812121240 Mechanically Attached Wear Plate System (MAWPS) with Abrasion Resistant Material (ARM)
- Wear Protection: IRM804220530 Cat[®] Chocky Bars, wear buttons, roll bars, and wear blocks

7.0 Related Best Practices

None

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT WRITTEN PERMISSION OF CATERPILLAR

Auxiliary Fleet and Loaders GET Chart for Preventive Maintenance	DATE 2/16/2015	CHG NO 00	NUMBER 1010-2.06-1214
--	-------------------	-----------------	--------------------------

8.0 Acknowledgements

This Best Practice was described by:

César Roa Juárez

GETs & UC Inspector – Ferreyros

croa@ferreyros.com.pe

Martín Gallegos Barriga

GETs and UC Specialist - Ferreyros

mgallego@ferreyros.com.pe

Prepared by:

Alberto Franco D'Alfonso

CI & BP Champion – Ferreyros

afrancod@ferreyros.com.pe

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT WRITTEN PERMISSION OF CATERPILLAR

Auxiliary Fleet and Loaders GET Chart for Preventive Maintenance	DATE 2/16/2015	CHG NO 00	NUMBER 1010-2.06-1214
--	-------------------	-----------------	--------------------------